Drouare, Douglas

Subject:

Sax and Fox Lust Site

Location:

R7-R02.2-E06-10/R7-R0

Start: End:

Mon 9/19/2016 10:00 AM Mon 9/19/2016 11:00 AM

Recurrence:

(none)

Meeting Status:

Accepted

Organizer:

Bustos, Patrick

Required Attendees:

Bustos, Patrick; Drouare, Douglas; Bosch, Raymond; Reed, Brandy

Optional Attendees: Holder, Stanley; Hayes, Scott

Good to hear progress is being made

Our over-arching concern is making sure there is continued and timely project progression.

We are here to offer whatever assistance we can in our role as a regulator.

We will be responding to your latest fransmittal

Tribe

Consultant Tank Manuf.

Insurance Company

Drouare, Douglas

From:

Drouare, Douglas

Sent:

Monday, September 19, 2016 7:16 AM

To:

'Sac & Fox Truck Stop'

Cc:

Hayes, Scott; Raymond Bosch; Wilfredo Rosado-Chaparro; Patrick Bustos; 'M.Junker';

lisa.montgomery@sacfoxenviro.org

Subject:

RE: Truck Stop Reports

Thank you for transmitting this information. We will begin reviewing it immediately.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: Sac & Fox Truck Stop [mailto:sacfoxtsmgr@jbntelco.com]

Sent: Friday, September 16, 2016 4:59 PM

To: Drouare, Douglas <drouare.douglas@epa.gov>

Subject: RE: Truck Stop Reports

Doug,

Attached is an update on the continued efforts to finalize the UST rupture at Sac and Fox Truck Stop.

Sincerely,

Theresa Armbruster Manager, Sac and Fox Truck Stop

From: Drouare, Douglas [mailto:drouare.douglas@epa.gov]

Sent: Friday, July 8, 2016 8:35 AM

To: Sac & Fox Truck Stop; mark.junker@sacfoxenviro.org; lisa.montgomery@sacfoxenviro.org

Cc: Rosado-Chaparro, Wilfredo; Pomes, Michael; Hayes, Scott

Subject: RE: Truck Stop Reports

Thank you for the update. I am forwarding your message to those at our agency whose focus is on the UST systems (Wilfredo & Michael). My focus is on the release of petroleum that has occurred and the investigation and corrective action that must follow. We are in the process of drafting a formal response to your latest electronic mail.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: Sac & Fox Truck Stop [mailto:sacfoxtsmgr@jbntelco.com]

Sent: Thursday, July 07, 2016 5:34 PM

To: Drouare, Douglas < drouare.douglas@epa.gov>

Subject: RE: Truck Stop Reports

Doug,

Just a reminder Sac and Fox Truck Stop ruptured tank excavation will begin Monday July 11, 2016.

Thank You,

Theresa Armbruster Manager, Sac and Fox Truck Stop

From: Drouare, Douglas [mailto:drouare.douglas@epa.gov]

Sent: Friday, June 24, 2016 11:19 AM

To: mark.junker@sacfoxenviro.org; Sac & Fox Truck Stop; lisa.montgomery@sacfoxenviro.org; Sac & Fox Truck Stop; <a href="m

Cc: Hayes, Scott

Subject: RE: Truck Stop Reports

Good morning Mark,

The January 22, 2016 Site Investigation Report is the type of technical report we were and are expecting for this project. It was helpful in describing the current status of the project. We are wondering why it took five months to get to us.

Considering this release is near to being a year old, we consider progress toward fully evaluating the extent and degree of impact to be behind schedule. Further efforts and communications are going to need to be completed in a more timely manner.

We have the following questions...

What is being done to recover free product?

How much free product has been recovered to date?

How does this compare to the volume of fuel released?

Where is the work plan/proposal for investigation services that will be necessary to fully evaluate the degree and extent of the contaminant plume? We are skeptical that two wells will be adequate to do this as indicated in the attached notes. Perhaps the work plan/proposal is one of the documents that could not be sent by e-mail??? If so, please mail it to us ASAP so that we can review and comment.

As previously stated, we consider this project to be behind schedule. Future efforts and communications are going to need to be completed in a more timely manner.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov From: M.Junker [mailto:mark.junker@sacfoxenviro.org]

Sent: Wednesday, June 22, 2016 12:07 PM

To: Drouare, Douglas < drouare.douglas@epa.gov>

Cc: Edmore Green <egreen@sacandfoxcasino.com>; Robert L. Trump <rtrump@totalpetroleumservices.com>; 'Sac &

Fox Truck Stop' < sacfoxtsmgr@jbntelco.com>

Subject: Truck Stop Reports

Good afternoon Doug,

Due to the capabilities of the computers in my office I am forwarding to you the report that Theresa Armbruster created to reflect the most current information we have on our tank situation as well as time line reflecting the activity undertaken to characterize and remediate the site.

There are the three attachments included. The first is her report which sites nine different attachments. Due to formatting issues only one is included. It is the one labeled attachment 9. The second attachment include items 1-8. The 3rd attachment contains the bulk of the site characterization.

The documentation represents the most thorough compilation of all data we capable of providing at this time.

You are more than welcome to come visit us at the Truck Stop on July 11, 2016 when we will begin excavating the tank and formulating some plans for completing the data gathering process and remediation.

Mark Junker

Tribal Response Coordinator Sac & Fox Nation Of Missouri in Kansas and Nebraska (785) 742-4706



Attachement #8

Pace Analytical Services, Inc. 9608 Loiret Blvd. Lenexa, KS 66219 (913)599-5665

July 27, 2016

Robert Trump Total Petroleum Services 16601 W. 132nd Circle Olathe, KS 66062

RE: Project: SAC-N-FOX

Pace Project No.: 60223766

Dear Robert Trump:

Enclosed are the analytical results for sample(s) received by the laboratory on July 15, 2016. The results relate only to the samples included in this report. Results reported herein conform to the most current TNI standards and the laboratory's Quality Assurance Manual, where applicable, unless otherwise noted in the body of the report.

If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Shui Dasensdando_

Sherri Rosenstangle sherri.rosenstangle@pacelabs.com Project Manager

Enclosures







CERTIFICATIONS

Project:

SAC-N-FOX

Pace Project No.:

60223766

Minnesota Certification IDs

1700 Elm Street SE Suite 200, Minneapolis, MN 55414

525 N 8th Street, Salina, KS 67401 A2LA Certification #: 2926.01 Alaska Certification #: UST-078 Alaska Certification #MN00064 Alabama Certification #40770 Arizona Certification #: AZ-0014 Arkansas Certification #: 88-0680 California Certification #: 01155CA

Colorado Certification #Pace Connecticut Certification #: PH-0256 EPA Region 8 Certification #: 8TMS-L

Florida/NELAP Certification #: E87605

Guam Certification #:14-008r Georgia Certification #: 959 Georgia EPD #: Pace

Idaho Certification #: MN00064 Hawaii Certification #MN00064 Illinois Certification #: 200011 Indiana Certification#C-MN-01 Iowa Certification #: 368

Kansas Certification #: E-10167

Kentucky Dept of Envi. Protection - DW #90062 Kentucky Dept of Envi. Protection - WW #:90062

Louisiana DEQ Certification #: 3086 Louisiana DHH #: LA140001 Maine Certification #: 2013011 Maryland Certification #: 322

Michigan DEPH Certification #: 9909

Indiana Certification IDs

7726 Moller Road, Indianapolis, IN 46268

Illinois Certification #: 200074 Indiana Certification #: C-49-06 Kansas/NELAP Certification #:E-10177 Kentucky UST Certification #: 0042 Kentucky WW Certification #:98019

Kansas Certification IDs

9608 Loiret Boulevard, Lenexa, KS 66219 WY STR Certification #: 2456.01 Arkansas Certification #: 15-016-0 Illinois Certification #: 003097 lowa Certification #: 118

Kansas/NELAP Certification #: E-10116

Minnesota Certification #: 027-053-137

Mississippi Certification #: Pace Montana Certification #: MT0092 Nevada Certification #: MN_00064 Nebraska Certification #: Pace New Jersey Certification #: MN-002 New York Certification #: 11647 North Carolina Certification #: 530

North Carolina State Public Health #: 27700

North Dakota Certification #: R-036

Ohio EPA #: 4150

Ohio VAP Certification #: CL101
Oklahoma Certification #: 9507
Oregon Certification #: MN200001
Oregon Certification #: MN300001
Pennsylvania Certification #: 68-00563

Puerto Rico Certification
Saipan (CNMI) #:MP0003
South Carolina #:74003001
Texas Certification #: T104704192
Tennessee Certification #: 02818
Utah Certification #: MN000642013-4
Virginia DGS Certification #: 251
Virginia/VELAP Certification #: Pace

Washington Certification #: C486 West Virginia Certification #: 382 West Virginia DHHR #:9952C Wisconsin Certification #: 999407970

Ohio VAP Certification #: CL-0065 Oklahoma Certification #: 2014-148 Texas Certification #: T104704355-15-9 West Virginia Certification #: 330 Wisconsin Certification #: 999788130 USDA Soil Permit #: P330-10-00128

Louisiana Certification #: 03055 Nevada Certification #: KS000212008A Oklahoma Certification #: 9205/9935 Texas Certification #: T104704407 Utah Certification #: KS00021

Kansas Field Laboratory Accreditation: # E-92587

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc.,



SAMPLE SUMMARY

Project:

SAC-N-FOX

Pace Project No.: 60223766

Lab ID	Sample ID	Matrix	Date Collected	Date Received
60223766001	F2-GW	Water	07/11/16 16:30	07/15/16 17:10

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..





SAMPLE ANALYTE COUNT

Project:

SAC-N-FOX

Pace Project No.: 60223766

Lab ID	Sample ID	Method	Analysts	Analytes Reported	Laboratory
60223766001	F2-GW EPA 80	EPA 8015 Alcohol-Glycol	BJW	1	PASI-I
		EPA 6010	SMW	7	PASI-K
		EPA 6010	IP	1	PASI-M
		EPA 7470	TDS	1	PASI-K
		EPA 5030B/8260	PGH	8	PASI-K
		SM 4500-H+B	LDB	1	PASI-K

REPORT OF LABORATORY ANALYSIS





ANALYTICAL RESULTS

Project:

SAC-N-FOX

Pace Project No.: 60223766

Sample: F2-GW	Lab ID: 60	223766001	Collected: 07/11/1	6 16:30	Received: 07	7/15/16 17:10 M	/latrix: Water	
Comments: • Samples requiring	g thermal preservation	were receive						
Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
8015M Alcohols in water	Analytical Me	thod: EPA 80	15 Alcohol-Glycol	(2)				
Ethanol	7.2	mg/L	5.0	1		07/20/16 15:23	64-17-5	
6010 MET ICP	Analytical Me	thod: EPA 60	10 Preparation Met	hod: EP	A 3010			
Arsenic	ND	ug/L	10.0	:1	07/21/16 11:15	07/22/16 11:17	7440-38-2	
Sulfur	5310	ug/L	500	-1		07/22/16 20:05	1110 00 2	
Barium	2260	ug/L	10.0	'n		07/22/16 11:17	7440-30-3	
Cadmium	ND	ug/L	5.0	- 1		07/22/16 11:17		
Chromium	ND	ug/L	5.0	11	07/21/16 11:15	07/22/16 11:17	7440-43-3	
.ead	ND	ug/L	5.0	1		07/22/16 11:17		
Selenium	ND	ug/L	15.0	1		07/22/16 11:17		
Silver	ND	ug/L	7.0	1		07/22/16 11:17		
7470 Mercury	Analytical Me	thod: EPA 74	70 Preparation Meth	hod: EP	A 7470			
Mercury	ND	ug/L	0.20	1	07/25/16 09:40	07/25/16 14:00	7439-97-6	
3260 MSV	Analytical Me	thod: EPA 50	30B/8260					
Benzene	5460	ug/L	50.0	50		07/22/16 14:12	74 42 0	
Ethylbenzene	136	ug/L	1.0	1		07/20/16 14:12		
oluene	11600	ug/L	250	250		07/25/16 15:30		
(ylene (Total)	9060	ug/L	150	50		07/22/16 15:30		
Surrogates		-3		00		01122110 14.12	1330-20-7	
-Bromofluorobenzene (S)	95	%	77-130	1		07/20/16 14:44	460-00-4	
,2-Dichloroethane-d4 (S)	102	%	81-127	1		07/20/16 14:44		
foluene-d8 (S)	102	%	80-120	1		07/20/16 14:44		
Preservation pH	1.0		0.10	_1		07/20/16 14:44	2001-20-0	
500H+ pH, Electrometric	Analytical Met	thod: SM 450	0-H+B	1.				
H at 25 Degrees C	6.8	Std. Units	0.10	1		07/20/16 12:45		H6



QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.:

60223766

QC Batch:

342803

QC Batch Method:

EPA 8015 Alcohol-Glycol

Analysis Method:

EPA 8015 Alcohol-Glycol

Associated Lab Samples: 60223766001

Analysis Description:

EPA 8015 Modified

METHOD BLANK: 1587707

Matrix: Water

Associated Lab Samples: 60223766001

Parameter

Units

Blank Result

Reporting

Llmit

Analyzed

Qualifiers

Ethanol

mg/L

ND

5.0 07/20/16 11:49

LABORATORY CONTROL SAMPLE: Parameter

Parameter

1587708

Spike Conc.

50

LCS Result

LCS % Rec

% Rec Limits

Qualifiers

Ethanol

Ethanol

Units mg/L

60223575001

Result

Units

mg/L

46.2

92

70-133

1587710

MSD

MS

MSD

% Rec

Max

RPD RPD Qual

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

1587709

ND

MS Spike Conc.

50

 
Spike Conc.

MSD Result Result 32.0 38.9

MS % Rec 64

% Rec 78 Limits 61-143 19

20





Project:

SAC-N-FOX

Pace Project No.:

60223766

QC Batch:

439735

EPA 7470

Analysis Method:

EPA 7470

QC Batch Method:

Analysis Description:

7470 Mercury

Associated Lab Samples: 60223766001

Matrix: Water

METHOD BLANK: 1799381 Associated Lab Samples:

60223766001

Parameter

Units

ug/L

Blank Result Reporting Limit

Analyzed

Qualifiers

Mercury

Units ug/L

ND

0.20 07/25/16 12:21

LABORATORY CONTROL SAMPLE: Parameter

Parameter

Spike Conc.

LCS Result

LCS % Rec % Rec Limits

Qualifiers

Mercury

Mercury

Units ug/L

60223593001

Result

4.8

97 80-120

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

1799383

1799384

5

MSD

% Rec

Max

RPD RPD Qual

0.61

MS Splke Conc.

MSD Spike Conc.

5

5

MS Result

MSD MS Result % Rec 5.0

% Rec 88

Limits 88 75-125

0 20





Project:

SAC-N-FOX

Pace Project No.: 60223766

QC Batch:

439438

QC Batch Method: EPA 3010

Analysis Method:

EPA 6010

Analysis Description:

6010 MET

Associated Lab Samples: 60223766001

METHOD BLANK: 1797181

Matrix: Water

Associated Lab Samples: 60223766001

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Arsenic	ug/L	ND	10.0	07/22/16 11:08	
Barium	ug/L	ND	10.0	07/22/16 11:08	
Cadmium	ug/L	ND	5.0	07/22/16 11:08	
Chromium	ug/L	ND	5.0	07/22/16 11:08	
Lead	ug/L	ND	5.0	07/22/16 11:08	
Selenium	ug/L	ND	15.0	07/22/16 11:08	
Silver	ug/L	ND	7.0	07/22/16 11:08	

ABORATORY CONTROL SAMPI	E: 1797182					
Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Arsenic	ug/L	1000	1080	108	80-120	
Barium	ug/L	1000	1010	101	80-120	
Cadmium	ug/L	1000	1120	112	80-120	
Chromium	ug/L	1000	961	96	80-120	
ead	ug/L	1000	1110	111	80-120	
Selenium	ug/L	1000	1100	110	80-120	
Silver	ug/L	500	496	99	80-120	

MATRIX SPIKE & MATRIX S	SPIKE DUPLICA	TE: 17971	83		1797184							
Parameter	Units	0223766001 Result	MS Spike Conc.	MSD Spike Conc.	MS Result	MSD Result	MS % Rec	MSD % Rec	% Rec Limits	RPD	Max RPD	Qual
Arsenic	ug/L	ND	1000	1000	1110	1120	110	111	75-125	1	20	
Barium	ug/L	2260	1000	1000	3210	3240	96	98	75-125	1	20	
Cadmium	ug/L	ND	1000	1000	1120	1130	112	113	75-125	1	20	
Chromium	ug/L	ND	1000	1000	926	930	93	93	75-125	0	20	
Lead	ug/L	ND	1000	1000	1030	1030	103	103	75-125	0	20	
Selenium	ug/L	ND	1000	1000	1120	1130	112	113	75-125	1	20	
Silver	ug/L	ND	500	500	503	504	101	101	75-125	0	20	



QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.:

60223766

QC Batch:

426351

EPA 3010

Analysis Method:

EPA 6010

QC Batch Method:

Analysis Description:

6010 MET

Associated Lab Samples:

60223766001

METHOD BLANK: 2321335 Associated Lab Samples:

60223766001

Matrix: Water

Units

ug/L

Blank

Parameter

Units

Reporting Limit

Analyzed

Qualifiers

Sulfur

Sulfur

Sulfur

ug/L

ND

500 07/22/16 19:58

100

LABORATORY CONTROL SAMPLE:

Parameter

2321336

Spike Conc.

LCS Result

LCS % Rec

% Rec Limits

Parameter

ug/L

60223766001

Result

Units

20000

Result

20000

80-120

Qualifiers

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

2321337

MS Spike

20000

Conc.

MSD Spike

Conc.

20000

MS

2321338

Result

25400

MSD Result

 
26700

MS MSD % Rec % Rec % Rec Limits

75-125

Max

RPD RPD Qual 20 5





Project:

SAC-N-FOX

Pace Project No.:

60223766

QC Batch:

439301

QC Batch Method: EPA 5030B/8260

Analysis Method:

EPA 5030B/8260

Analysis Description:

8260 MSV Water 10 mL Purge

METHOD BLANK: 1796709

Associated Lab Samples: 60223766001

Associated Lab Samples: 60223766001

Matrix: Water

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Ethylbenzene	ug/L	ND	1.0	07/20/16 09:09	
1,2-Dichloroethane-d4 (S)	%	96		07/20/16 09:09	
4-Bromofluorobenzene (S)	%	97	77-130	07/20/16 09:09	
Toluene-d8 (S)	%	99		07/20/16 09:09	

LABORATORY CONTROL SAMPLE:	1796710					
Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Ethylbenzene	ug/L	20	21.0	105	80-120	
1,2-Dichloroethane-d4 (S) 4-Bromofluorobenzene (S)	%			99	81-127	
Toluene-d8 (S)	%			98	77-130	
Tolderie-do (S)	%			99	80-120	

MATRIX SPIKE & MATRIX SP	IKE DUPLIC	ATE: 17967	11		1796712		·			_		
Parameter	Units	60223758002 Result	MS Spike Conc.	MSD Spike Conc.	MS Result	MSD Result	MS % Rec	MSD % Rec	% Rec Limits	RPD	Max RPD	Qual
Ethylbenzene	ug/L	ND	20	20	22.1	22.2	110	111	29-151	0	45	
1,2-Dichloroethane-d4 (S)	%						98	95	81-127	U	40	
4-Bromofluorobenzene (S)	%						96	96	77-130			
Toluene-d8 (S)	%				1		98	100	80-120			
Preservation pH		1.0			1.0	1.0				0		



QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.:

60223766

QC Batch:

439616

Associated Lab Samples: 60223766001

Analysis Method:

EPA 5030B/8260

QC Batch Method: EPA 5030B/8260

Analysis Description:

8260 MSV Water 10 mL Purge

METHOD BLANK: 1798182

Matrix: Water

Associated Lab Samples: 60223766001

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Benzene	ug/L	ND	1.0.	07/22/16 12:30	
Xylene (Total)	ug/L	ND	3.0		
1,2-Dichloroethane-d4 (S)	%	100	81-127	07/22/16 12:30	
4-Bromofluorobenzene (S)	%	99	77-130	07/22/16 12:30	
Toluene-d8 (S)	%	100	80-120	07/22/16 12:30	

LABORATORY CONTROL SAMPLE: 1798183

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Benzene	ug/L	20	19.9	100	79-116	
Xylene (Total)	ug/L	60	58.4	97	80-120	
1,2-Dichloroethane-d4 (S)	%			101	81-127	
4-Bromofluorobenzene (S)	%			98	77-130	
Toluene-d8 (S)	%			100	80-120	





Project:

SAC-N-FOX

Pace Project No.:

60223766

QC Batch:

439782

Analysis Method:

Ei²A 5030B/8260

QC Batch Method: EPA 5030B/8260

Analysis Description: 8260 MSV Water 10 mL Purge

Associated Lab Samples: 60223766001

METHOD BLANK: 1799456

Date: 07/27/2016 11:46 AM

Matrix: Water

Associated Lab Samples: 60223766001

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Toluene 1,2-Dichloroethane-d4 (S) 4-Bromofluorobenzene (S) Toluene-d8 (S)	ug/L % % %	ND 105 97 97	1.0 81-127, 77-130 80-120	07/25/16 10:39 07/25/16 10:39 07/25/16 10:39 07/25/16 10:39	

LABORATORY CONTROL SAMPLE: 1799457

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Toluene	ug/L	20	20.2	101	80-120	
1,2-Dichloroethane-d4 (S)	%			102	81-127	
4-Bromofluorobenzene (S)	%			97	77-130	
Toluene-d8 (S)	%			99	80-120	



QUALIFIERS

Project:

SAC-N-FOX

Pace Project No.:

60223766

DEFINITIONS

DF - Dilution Factor, if reported, represents the factor applied to the reported data due to dilution of the sample aliquot.

ND - Not Detected at or above adjusted reporting limit.

J - Estimated concentration above the adjusted method detection limit and below the adjusted reporting limit.

MDL - Adjusted Method Detection Limit.

PQL - Practical Quantitation Limit.

RL - Reporting Limit.

S - Surrogate

1,2-Diphenylhydrazine decomposes to and cannot be separated from Azobenzene using Method 8270. The result for each analyte is a combined concentration.

Consistent with EPA guidelines, unrounded data are displayed and have been used to calculate % recovery and RPD values.

LCS(D) - Laboratory Control Sample (Duplicate)

MS(D) - Matrix Spike (Duplicate)

DUP - Sample Duplicate

RPD - Relative Percent Difference

NC - Not Calculable.

SG - Silica Gel - Clean-Up

U - Indicates the compound was analyzed for, but not detected.

N-Nitrosodiphenylamine decomposes and cannot be separated from Diphenylamine using Method 8270. The result reported for each analyte is a combined concentration.

Pace Analytical is TNI accredited. Contact your Pace PM for the current list of accredited analytes.

TNI - The NELAC Institute.

LABORATORIES

PASI-I

Pace Analytical Services - Indianapolis

PASI-K

Pace Analytical Services - Kansas Clty

PASI-M

Pace Analytical Services - Minneapolis

BATCH QUALIFIERS

Batch: 439616

[M5]

A matrix spike/matrix spike duplicate was not performed for this batch due to insufficient sample volume.

Batch: 439782

[M5]

 
A matrix spike/matrix spike duplicate was not performed for this batch due to insufficient sample volume.

ANALYTE QUALIFIERS

Date: 07/27/2016 11:46 AM

H6

Analysis initiated outside of the 15 minute EPA required holding time.





QUALITY CONTROL DATA CROSS REFERENCE TABLE

Project:

SAC-N-FOX

Pace Project No.:

60223766

Lab ID	Sample ID	QC Batch Method	QC Batch	Analytical Method	Analytica Batch
60223766001	F2-GW	EPA 8015 Alcohol-Glycol	342803		
60223766001	F2-GW	EPA 3010	426351	EPA 6010	426659
60223766001	F2-GW	EPA 3010	439438	EPA 6010	439538
60223766001	F2-GW	EPA 7470	439735	EPA 7470	439802
60223766001	F2-GW	EPA 5030B/8260	439301		
60223766001	F2-GW	EPA 5030B/8260	439616		
60223766001	F2-GW	EPA 5030B/8260	439782		
60223766001	F2-GW	SM 4500-H+B	439244		



Sample Condition Upon Receipt

WO#: 60223766

Client Alana Total Dat Coleman			Michael Commence
Courier: Fedex UPS VIA Clay PEX ECI Paise Other Client Proj Duc Date: Proj Parametric Pace Shipping Label Used? Yes No Proj Duc Date: Proj Parametric Proj Duc Date: Proj D			
Description Paper Description Paper Description Description Paper Description Description Paper Description Description Paper Description Descriptio			
Tracking #: Pac	e Shippir	ig Label l	Jseć? Yes □ No □ Proj Name:
		ntact: Y	Yes □ No Δ Y
	K	Foam (□ None □ Other □
T-266/ T-239 Type	of Ice:		ue None Samples received on ice, cooling process has begun.
		(Circie	Date and Initials of person examining
			0,10
			1. Dut or temp
	Yes No	□n/a	2.
Chain of Custody relinquished:	Yes DNc	□N/A	3.
Sampler name & signature on COC:	Yes DNo	□N/A	4.
Samples arrived within holding time:	Yes DNo	□n/A	5.
Short Hold Time analyses (<72hr):	Yes 🗆 No	□n/a	6. NH
Rush Turn Around Time requested:	Yes MNo	□n/a	7.
Sufficient volume:	Yes 🗆 No	□n/a	8.
Correct containers used:	Yes DNo	□n/a	
Pace containers used:	Yes DNo	□n/a	9.
Containers intact:	Yes DNo	□n/a	10.
Unpreserved 5035A soils frozen w/in 48hrs?	Yes □No	ØN/A	
Filtered volume received for dissolved tests?	Yes □No	⊠ N/A	12.
Sample labels match COC:	Yes □No	□n/A	
Includes date/time/ID/analyses Matrix: 🍑	T		13.
All containers needing preservation have been checked.	Yes 🗆 No	□N/A	
All containers needing preservation are found to be in compliance			14
Exceptions VOA) Collform, O&G, WI-DRO (water)	Yes □No		Initial when Lot # of added
Trip Blank present		DNIA	completed preservative
Pace Trip Blank lot # (if purchased): 715			15
Headspace in VOA vials (>6mm):	Yes IINo	□N/A	
w			46
Project sampled in USDA Regulated Area:	Yes DNo	ATINIA	
			IT. List State:
Client News At Ale		- 11	76
Person Contacted: Oc v + Date/Ti		7.15	Fleid Data Required? Y VN
Deploy Pace Deploy Dep			
report CAMOINDIA 10	بطن	de,	leng Bour
Project Manager Review:			
		5	Dale: 1

CHAIN-OF-CUSTODY / Analytical Request Document The Chain-of-Custody is a LEGAL DOCUMENT. All relevant fields must be completed accurately.

			12	11	10	9	8	7	6	en .		3	2		ITEM#		Medicalox	Phone:		ADDITUSS:	Cumpany:	p.
		ADDITIONAL COMMENTS											4		SAMPLE ID One Character per box. (A-2, 0-9 /, -) Sample lds must be unique		1000 Date: 1.50 - 1(0	(913)461-5985 Fax	cberttrump@gmail.com	Olathe, KS 56062	1	್ತd Client Information:
														(Z)BP3N /3)DVAH	Waste Will Waste Will Waste Will Waste Will Product Pr	MATRIX CODE	li colore u	Project N	Purchase	i Adon	Report Ti	Required Project Information:
	7	RELIN	-	-	-	-		-	\vdash	-	-		-	WT				lame;	Order#		Rob	Project
8	1 9	OUISH	119	(4)	12.0	40			-		, li			6	SAMPLE TYPE (G=GRAB C	=COMP)	3	Ē	ιı		en To	Inform
	Sau	FD BY /									-	_	-	11/16	ST		6	?	K		콥	nation:
	1	VITELY.	Γ							\top				135	TIME	cor			2			
		NOIT	23	-	-	+	+-	T					-	ا جه		LECTE			100			
	1	遊			-	-	-	\vdash	\vdash	-	-	-		_ 1 _ w (-			
	g	DATE	L									L		2			ı	l	lĺ			
	1 1	186	\vdash	-	+	-	-	\vdash	-	-	ω	2	二	7.3		IOH	-	9 T	9	D C	1 >	=
	12	17	\vdash	-	+	╫	+-	╁	+	+-	-	-	-	-				ace P	ace C	ddres	ttentic	Invoice information:
	0	ra.	H	+-	+	+-	+-	1	1	1	1			+	112804	1		rojec!	uote	91 3	ž	info
					7									1.0	HNO3	Pe	Į,	Mana			5	matio
	M		_	-	┼	+	+	-	-	-	×	X	-	-		serva	3			V	0	2
	140	B	\vdash	+-	+	+-	+	+	+	+	+-	-	┼─	+		tives	П.			1	7	
	1 /2	EPI	-	+	+-		+	1-	1	1	+				Methanol			狐		1	4	l l
	1 1	AB GB												752	Olher			Sens		b	26	ľ
		1AFF					,				130	1		,	Analyses Test	Y/N	5000	180		v	10	
		LATE	\vdash		-	+	+-	-	+-	+	1		-	- 3			4			Ġ		
ŀ	(F)	ž	-	+-	-	-	+-	+	+	10	+	+		117		+-1	Req	SOGIE		(
				\top	\top	\top		\top	\top	-	\top	\top	ŕ		Ethenol		Jesta	com,			1	
		100												\ <u>\</u>	Sulfur		ASIa				-	
	1 1/2	9		+-	-		+	-	+	\bot	-	+	-	1.			Picy					
	9	TE	-	+	+	+	+	┼	+-	+-	+	+-	+	1		-	1	150		100		j
	++-	133		+	+	-		-	+-	+-	+	+	+	हिं		+-	2	0.850				
2	7	Ä		23	ï									S			N.	Special				
5		100		+	+	+	+	+-	+	+	-	+	-	7.5		72	0.0000	100000000000000000000000000000000000000		R		Page :
	100	1092								,			-	· · · · ·	Residual Chlorine (Y/N)			200		egulat		ā
		SAMPLE	4												6			Locan		ay Age		
	1	CONDIT													II.			07		ncy		₽
	1 5	SNO	100									1	1		7,			40000				*
	\												8		66	100		3000		100		_
		170 J. S. Mar 3/15 1310 1412 X W	SHITH 7:5% [7]D J S Me PAIS 1740 14:0	ADDITIONAL COMMENTS RELACQUISHED BY I AFFLATION DATE THE ACCEPTED BY I AFFLATION PLANE TIME SAMPLE COMDITIONS TIM South 7:45 1710 9 8 916 1710 1714 7 1.	ADDITIONAL COMMENTS RELACQUISHED BY IAFFLATION DATE TIME ACCEPTED BY IAFFLATION DATE TIME SAMPLE COMOTIONS TIAN TRUIT 7:45'6 [7]0	ADDITIONAL COMMENTS RELACISHED BY I AFFLATION DATE THE ACCEPTED BY I AFFLATION TARE SAMPLE CONDITIONS TO 1912 Y ACCEPTED BY I AFFLATION THE SAMPLE CONDITIONS	ADDITIONAL COMMENTS RELACQUISHED BY IAFFLATION DATE TIME ACCEPTED BY IAFFLATION DATE TIME SAMPLE CONDITIONS TIM Spilt 7.45% [7]/0	ADDITIONAL COMMENTS RELACISHED BY I AFFELL ON DATE TIME ACCEPTED BY I AFFELLATION TIME SAMPLE CONDITIONS TIME ACCEPTED BY I AFFELLATION TIME ACCEPTED BY I A	TIM JEINATE THE ACCEPTED IN ACTUAL COMPANY OF THE SAME COMPANY A THE SAME COMPANY OF T	TIN JULY 2.52 THE ACCEPTED BY APPLIATION DATE TIME ACCEPTED BY APPLIANCE TIME SAME CONDITIONS TIME SAME TIME ACCEPTED BY APPLIANCE TIME SAME TIME SAME TIME ACCEPTED BY APPLIANCE TIME SAME TIME SA	ADDITIONAL COMPRENTS RELIANDED BATE TAN TAN TAN TAN TAN TAN TAN	TIM ANTE DATE THE CONDITION NOT THE SAME THE TIME NOT THE SAME THE	The Same and South Astronome and and Shirt Astronome and	ADDITIONAL COMPENSAGE THE CONTINUE ACCEPTED BY APPLIATED THE SAME CONTINUE CONTINUE THE CONTINUE CONTI	ADDITIONS THE SELECTION AND THE SAME THE ACCORDING THE SAME THE SAME CONSTITUTES AND THE SAME THE	SAMPLE ID Semple to fine country per box. And the Country of the	SAMPLE ID SAMPLE ID SAMPLE TOP COLLECTED DATE THAT ANTELL COOKERS TO THE ACCORDING THE SAMPLE TEMP AT COLLECTION DATE THAT AND CONTRACTOR TO THE ACCORDING THE SAMPLE TEMP AT COLLECTION ACCO	MAPLE ID The control of the control	SAMPLE ID SAMPLE ID Con Character per loss. Cont. Character per loss. C	COLUMN C	Continue Continue	The color of the c





July 27, 2016

Robert Trump Total Petroleum Services 16601 W. 132nd Circle Olathe, KS 66062

RE: Project: SAC-N-FOX

Pace Project No.: 60223764

Dear Robert Trump:

Enclosed are the analytical results for sample(s) received by the laboratory on July 15, 2016. The results relate only to the samples included in this report. Results reported herein conform to the most current TNI standards and the laboratory's Quality Assurance Manual, where applicable, unless otherwise noted in the body of the report.

If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Shui Basensdande

Sherri Rosenstangle sherri.rosenstangle@pacelabs.com Project Manager

Enclosures





CERTIFICATIONS

Project:

SAC-N-FOX

Pace Project No.:

60223764

Minnesota Certification IDs

1700 Elm Street SE Suite 200, Minneapolis, MN 55414

525 N 8th Street, Salina, KS 67401

A2LA Certification #: 2926.01

Alaska Certification #: UST-078

Alaska Certification #MN00064

Alabama Certification #40770

Arizona Certification #: AZ-0014

Arkansas Certification #: 88-0680

California Certification #: 01155CA

Colorado Certification #Pace

Connecticut Certification #: PH-0256

EPA Region 8 Certification #: 8TMS-L

Florida/NELAP Certification #: E87605

Guam Certification #:14-008r

Georgia Certification #: 959

Georgia EPD #: Pace

Idaho Certification #: MN00064

Hawali Certification #MN00064

Illinois Certification #: 200011

Indiana Certification#C-MN-01

lowa Certification #: 368

Kansas Certification #: E-10167

Kentucky Dept of Envi. Protection - DW #90062

Kentucky Dept of Envl. Protection - WW #:90062

Louislana DEQ Certification #: 3086

Louisiana DHH#: LA140001

Maine Certification #: 2013011

Maryland Certification #: 322

Michigan DEPH Certification #: 9909

indiana Certification IDs

7726 Moller Road, Indianapolis, IN 46268

Illinois Certification #: 200074

Indiana Certification #: C-49-06

Kansas/NELAP Certification #:E-10177

Kentucky UST Certification #: 0042

Kentucky WW Certification #:98019

Kansas Certification IDs

9608 Loiret Boulevard, Lenexa, KS 66219

WY STR Certification #: 2456.01

Arkansas Certification #: 15-016-0

Illinois Certification #: 003097

lowa Certification #: 118

Kansas/NELAP Certification #: E-10116

Minnesota Certification #: 027-053-137

Mississippi Certification #: Pace

Montana Certification #: MT0092

Nevada Certification #: MN_00064

Nebraska Certification #: Pace

New Jersey Certification #: MN-002

New York Certification #: 11647

North Carolina Certification #: 530

North Carolina State Public Health #: 27700

North Dakota Certification #: R-036

Ohio EPA #: 4150

Ohio VAP Certification #: CL101

Oklahoma Certification #: 9507

Oregon Certification #: MN200001

Oregon Certification #: MN300001

Pennsylvania Certification #: 68-00563

Puerto Rico Certification

Saipan (CNMI) #:MP0003

South Carolina #:74003001

Texas Certification #: T104704192

Tennessee Certification #: 02818

Utah Certification #: MN000642013-4

Virginia DGS Certification #: 251

Virginia/VELAP Certification #: Pace

Washington Certification #: C486

West Virginia Certification #: 382 West Virginia DHHR #:9952C

Wisconsin Certification #: 999407970

Ohio VAP Certification #: CL-0065 Oklahoma Certification #: 2014-148 Texas Certification #: T104704355-15-9 West Virginia Certification #: 330

Wisconsin Certification #: 999788130

USDA Soll Permit #: P330-10-00128

Louisiana Certification #: 03055

Nevada Certification #: KS000212008A

Oklahoma Certification #: 9205/9935

Texas Certification #: T104704407

Utah Certification #: KS00021

Kansas Field Laboratory Accreditation: # E-92587

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc.





SAMPLE SUMMARY

Project:

SAC-N-FOX

Pace Project No.: 60223764

Lab ID	Sample ID	Matrix	Date Collected	Date Received
60223764001	F1-GW	Water	07/11/16 16:30	07/15/16 17:10

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..





SAMPLE ANALYTE COUNT

SAC-N-FOX

Pace Project No.: 60223764

Lab iD	Sample ID	Method	Analysts	Analytes Reported	Laboratory
60223764001 F1-	F1-GW	EPA 8015 Alcohol-Glycol	BJW	1	PASI-I
	EPA 6010	SMW	7	PASI-K	
		EPA 6010	IP	1	PASI-M
		EPA 7470	TDS	1	PASI-K
		EPA 5030B/8260	PGH	8	PASI-K
		SM 4500-H+B	LDB	1	PASI-K

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..





ANALYTICAL RESULTS

Project:

SAC-N-FOX

Pace Project No.: 60223764

Sample: F1-GW Comments: • Samples requiring	Lab ID: 602 thermal preservation		Collected: 07/11/1			7/15/16 17:10 N	flatrix: Water	
Parameters	Results	Units	Report Limit	DΕ	Prepared	Analyzed	CAS No.	Qual
8015M Alcohols in water	Analytical Met	hod: EPA 8015	Alcohoi-Glycol	1				
Ethanol	5.6	mg/L	5.0	1		07/20/16 15:32	64-17-5	
6010 MET ICP	Analytical Mel	hod: EPA 6010	Preparation Met	hod: EF	PA 3010			
Arsenic	12.2	ug/L	10.0	1	07/21/16 11:15	07/22/16 11:12	7440-38-2	
Sulfur	6700	ug/L	500	1		07/22/16 20:24	7440-00-2	
Barium	2230	ug/L	10.0	- i		07/22/16 11:12	7440 20 2	
Cadmium	ND	ug/L	5.0	1		07/22/16 11:12		
Chromium	ND	ug/L	5.0	4		07/22/16 11:12		
Lead	ND	ug/L	5.0	1		07/22/16 11:12		
Selenium	ND	ug/L	15.0	1	07/21/10 11.15	07/22/16 11:12	7439-92-1	
Silver	ND	ug/L	7.0	1		07/22/16 11:12 07/22/16 11:12		
7470 Mercury	Analytical Met	_	Preparation Meth			07/22/10 11.12	7440-22-4	
Mercury	ND	ug/L	0.20	1		07/25/16 13:55	7439-07-6	
8260 MSV	Analytical Met	hod: EPA 5030	B/8260				7 100 07 0	
Benzene	3110	ug/L	50.0	50		07/22/16 13:57	74 40 0	
Ethylbenzene	36.7	ug/L	1.0	1				
Toluene	5420	ug/L	50.0	50		07/20/16 14:15		
Kylene (Total)	6660	-				07/22/16 13:57		
Surrogates	9000	ug/L	150	50		07/22/16 13:57	1330-20-7	
4-Bromofluorobenzene (S)	98	%	77-130	1 .		07/00/10 11 15		
,2-Dichloroethane-d4 (S)	102	%	81-127			07/20/16 14:15		
Toluene-d8 (S)	100	%		1		07/20/16 14:15		
Preservation pH	1.0	70	80-120	1		07/20/16 14:15	2037-26-5	
•			0.10	1		07/20/16 14:15		
1500H+ pH, Electrometric	Analytical Met	hod: SM 4500-	H+B					
pH at 25 Degrees C	6.9	Std. Units	0.10	1		07/20/16 12:45		H6
								. 10



QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.:

60223764

QC Batch: QC Batch Method:

342803

EPA 8015 Alcohol-Glycol

Analysis Method:

EPA 8015 Alcohol-Glycol

Associated Lab Samples: 60223764001

Analysis Description:

EPA 8015 Modified

METHOD BLANK: 1587707

Matrix: Water

Associated Lab Samples: 60223764001

Blank Result Reporting Limit

Analyzed Qualifiers

Ethanol

Units mg/L

ND

5.0 07/20/16 11:49

LABORATORY CONTROL SAMPLE: 1587708

Parameter

Parameter

Parameter

Units

Spike Conc.

MS

LCS Result

LCS % Rec

% Rec Limits

Ethanol

mg/L

46.2

70-133

Qualifiers

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

1587710

MSD

92

MSD

% Rec

Max Quai

Ethanol

60223575001 Units

mg/L

Spike Result Conc.

ND

Spike Conc. 50 50

MS M\$D Result Result 32.0 38.9

MS % Rec 64

Limits 61-143

RPD RPD

19 20



QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.: 60223764

QC Batch:

439735

EPA 7470 QC Batch Method:

Analysis Method:

EPA 7470

Associated Lab Samples: 60223764001

Analysis Description:

7470 Mercury

Matrix: Water

METHOD BLANK: 1799381

Associated Lab Samples: 60223764001

Parameter

Units

ug/L

Blank Result Reporting

Analyzed Qualifiers

Limit

Mercury

Units ug/L

ND

0.20 07/25/16 12:21

LABORATORY CONTROL SAMPLE: 1799382

Parameter

Spike Conc.

LCS Result

LCS % Rec

Limits

% Rec

Qualifiers

Parameter

Mercury

Mercury

Units ug/L

80-120

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

1799383

1799384

4.8

MSD

5

MS

MSD

5.0

97

MSD

% Rec Limits

Max

RPD RPD Qual

0.61

60223593001 Result

MS Spike Conc.

Spike Conc. 5

 
5

Result Result 5.0

MS % Rec 88

% Rec

75-125





Project:

Silver

SAC-N-FOX

Pace Project No.:

60223764

QC Batch:

439438

Analysis Method:

EPA 6010

7.0 07/22/16 11:08

QC Batch Method: EPA 3010

Analysis Description:

6010 MET

Associated Lab Samples: 60223764001

Matrix: Water

METHOD BLANK: 1797181 Associated Lab Samples: 60223764001

Blank Reporting Parameter Units Result Limit Analyzed Qualifiers Arsenic ug/L ND 10.0 07/22/16 11:08 Barium ug/L ND 10.0 07/22/16 11:08 Cadmium ug/L ND 5.0 07/22/16 11:08 Chromium ug/L ND 5.0 07/22/16 11:08 Lead ug/L ND 5.0 07/22/16 11:08 Selenium ug/L 15.0 07/22/16 11:08 ND

ug/L

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Overlifeers
· · · · · · · · · · · · · · · · · · ·				76 KEC	Limits	Qualifiers
Arsenic	ug/L	1000	1080	108	80-120	
Barium	ug/L	1000	1010	101	80-120	
Cadmium	ug/L	1000	1120	112	80-120	
Chromium	ug/L	1000	961	96	80-120	
Lead	ug/L	1000	1110	111	80-120	
Selenium	ug/L	1000	1100	110	80-120	
Silver	ug/L	500	496	99	80-120	

ND

MATRIX SPIKE & MATRIX S	SPIKE DUPLICA	ATE: 17971	83		1797184							
Parameter	6 Units	0223766001 Result	MS Spike Conc.	MSD Spike Conc.	MS Result	MSD Result	MS % Rec	MSD % Rec	% Rec Limits	RPD	Max RPD	Qual
Arsenic	ug/L	ND	1000	1000	1110	1120	110	111	75-125	1	20	
Barium	ug/L	2260	1000	1000	3210	3240	96	98	75-125	1	20	
Cadmium	ug/L	ND	1000	1000	1120	1130	112	113	75-125	1	20	
Chromium	ug/L	ND	1000	1000	926	930	93	93	75-125	0	20	
Lead	ug/L	ND	1000	1000	1030	1030	103	103	75-125	0	20	
Selenium	ug/L	ND	1000	1000	1120	1130	112	113	75-125	1	20	
Silver	ug/L	ND	500	500	503	504	101	101	75-125	0	20	



QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.: 60223764

QC Batch:

426351

QC Batch Method: EPA 3010

Analysis Method: Analysis Description: EPA 6010 6010 MET

Associated Lab Samples: 60223764001

Matrix: Water

METHOD BLANK: 2321335 Associated Lab Samples: 60223764001

ND

Blank Reporting

Parameter

Units

Limit

Analyzed Qualifiers

Sulfur

ug/L

500 07/22/16 19:58

LABORATORY CONTROL SAMPLE: Parameter

2321336

ug/L

Spike Conc.

Result

LCS LCS % Rec Limits

% Rec

Qualifiers

Sulfur

Units ug/L

Result 20000

20000

80-120

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

2321337

2321338

MS

MSD

100

MSD

% Rec

Max RPD RPD

Parameter Sulfur

60223766001 Units Result

Conc.

MS Spike 5310 20000

Spike Conc. Result 20000

MSD Result 25400 26700

% Rec 101

MS

% Rec Limits 75-125

20

Qual





Project:

SAC-N-FOX

Pace Project No.: 60223764

QC Batch:

439301

Analysis Method: Analysis Description:

EPA 5030B/8260

QC Batch Method: EPA 5030B/8260

8260 MSV Water 10 mL Purge

Associated Lab Samples: 60223764001

METHOD BLANK: 1796709

Associated Lab Samples: 60223764001

Matrix: Water

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Ethylbenzene	ug/L	ND	1.0	07/20/16 09:09	
1,2-Dichloroethane-d4 (S)	%	96		07/20/16 09:09	
4-Bromofluorobenzene (S)	%	97	77-130	07/20/16 09:09	
Toluene-d8 (S)	%	99	80-120	07/20/16 09:09	
	70	55	00-120	07/20/16 09:09	

LABORATORY CONTROL SAMPLE:	1796710					
Parameter	Units	Splke Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Ethylbenzene	ug/L	20	21.0	105	80-120	
1,2-Dichloroethane-d4 (S)	%			99	81-127	
4-Bromofluorobenzene (S)	%			98	77-130	
Toluene-d8 (S)	%			99	80-120	

MATRIX SPIKE & MATRIX SP	IKE DUPLIC	ATE: 17967	11		1796712							
Parameter	Units	60223758002 Result	MS Spike Conc.	MSD Spike Conc.	MS Result	MSD Result	MS % Rec	MSD % Rec	% Rec	RPD F	Max RPD	Qual
Ethylbenzene	ug/L	ND	20	20	22.1	22.2	110	111	29-151	0	45	
1,2-Dichloroethane-d4 (S)	%						98	95	81-127	•		
4-Bromofluorobenzene (S)	%						96	96	77-130			
Toluene-d8 (S)	%				1		98	100	80-120			
Preservation pH		1.0			1.0	1.0				0		





Project:

SAC-N-FOX

Pace Project No.: 60223764

QC Batch:

439616

Analysis Method:

EPA 5030B/8260

QC Batch Method: EPA 5030B/8260

Analysis Description: 8260 MSV Water 10 mL Purge

Associated Lab Samples: 60223764001

METHOD BLANK: 1798182

Date: 07/27/2016 11:45 AM

Associated Lab Samples: 60223764001

Matrix: Water

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers	
Benzene	ug/L	ND	1.0	07/22/16 12:30		
Toiuene	ug/L	ND	1.0	07/22/16 12:30		
Xyiene (Totai)	ug/L	ND		07/22/16 12:30		
1,2-Dichloroethane-d4 (S)	%	100	81-127	07/22/16 12:30		
4-Bromofluorobenzene (S)	%	99	77-130	07/22/16 12:30		
Toluene-d8 (S)	%	100	80-120	07/22/16 12:30		

LABORATORY CONTROL SAMPLE: 1798183	3
------------------------------------	---

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Benzene	ug/L	20	19.9	100	79-116	
Toluene	ug/L	20	19.1	95	80-120	
Xylene (Totai)	ug/L	60	58.4	97	80-120	
1,2-Dichloroethane-d4 (S)	%			101	81-127	
4-Bromofluorobenzene (S)	%			98	77-130	
Toluene-d8 (S)	%			100	80-120	



QUALIFIERS

Project:

SAC-N-FOX

Pace Project No.:

60223764

DEFINITIONS

DF - Dilution Factor, if reported, represents the factor applied to the reported data due to dilution of the sample aliquot.

ND - Not Detected at or above adjusted reporting limit.

J - Estimated concentration above the adjusted method detection limit and below the adjusted reporting limit.

MDL - Adjusted Method Detection Limit.

PQL - Practical Quantitation Limit.

RL - Reporting Limit.

S - Surrogate

1,2-Diphenyihydrazine decomposes to and cannot be separated from Azobenzene using Method 8270. The result for each analyte is a combined concentration.

Consistent with EPA guidelines, unrounded data are displayed and have been used to calculate % recovery and RPD values.

LCS(D) - Laboratory Control Sample (Duplicate)

MS(D) - Matrix Spike (Duplicate)

DUP - Sample Duplicate

RPD - Relative Percent Difference

NC - Not Calculable.

SG - Silica Gei - Clean-Up

U - indicates the compound was analyzed for, but not detected.

N-Nitrosodiphenylamine decomposes and cannot be separated from Diphenylamine using Method 8270. The result reported for each analyte is a combined concentration.

Pace Analytical is TNI accredited. Contact your Pace PM for the current list of accredited analytes.

TNI - The NELAC Institute.

LABORATORIES

PASI-I

Pace Analytical Services - Indianapolis

PASI-K PASI-M Pace Analytical Services - Kansas City Pace Analytical Services - Minneapolis

BATCH QUALIFIERS

Batch: 439616

[M5]

A matrix spike/matrix spike duplicate was not performed for this batch due to insufficient sample volume.

ANALYTE QUALIFIERS

Date: 07/27/2016 11:45 AM

H6

Analysis initiated outside of the 15 minute EPA required holding time.





QUALITY CONTROL DATA CROSS REFERENCE TABLE

Project:

SAC-N-FOX

Pace Project No.:

60223764

Lab ID	Sample ID	QC Batch Method	QC Batch	Analytical Method	Analytical Batch	
60223764001	F1-GW	EPA 8015 Alcohoi-Giycol	342803			
60223764001	F1-GW	EPA 3010	426351	EPA 6010	426659	
60223764001	F1-GW	EPA 3010	439438	EPA 6010	439538	
60223764001	F1-GW	EPA 7470	439735	EPA 7470	439802	
60223764001	F1-GW	EPA 5030B/8260	439301			
60223764001	F1-GW	EPA 5030B/8260	439616			
60 22376400 1	F1-GW	SM 4500-H+B	439244			



Sample Condition Upon Receipt

WO#:60223764

Client Name:	Total	Petrolem	Mal								Optional
Courier: FedEx □	UPS 🗆	VIA 🗆	Clay 🗆	PEX 🗆	E		Paice (☐ Oth	er 🗆	Client 🔼	
Tracking #:				Pace Sh	nipping	Label L	Jsed?	Yes 🗆	No (3	Proj Name:
Custody Seal on Coole	r/Box Pre	sent:	Yes 🗆 No	o¥ s	eals in	tact: Y	es!□	No Ø			
Packing Material:	Bubble W		Bubble Ba	gs 🗗		Foam (None E		Other 🗆	
Thermometer Used:	T-26	5/ T-239	Т:	ype of lo	ce: (V	Vet Blu		e 🗆 s	amples	received o	n ice, cooling process has begun.
Cooler Temperature:		19.2	-		-	(circle	one)		Da	te and Initi	als of person examining
Temperature should be abo		to 6°C					Γ Λ	· · ·		ntents:	ما المرجل
Chain of Custody presen				Yes	□No	□N/A	1. Du	t 04	tem	φ	
Chain of Custody filled or				Yes	□No	□N/A	2				
Chain of Custody relingu	ished:			Ø Yes	□No	□n/a	3.				
Sampler name & signatu	re on COC	<u>:</u>		MYes	□No	□N/A	4.				
Samples arrived within h	olding time	:		M/Ves	□No	□n/a	5				
Short Hold Time analys	es (<72hr	<u>):</u>		MYes .	□Na	□N/A	6. NA				
Rush Turn Around Time	e request	ed:		□Yes	. MNo	□N/A	7. ¥				
Sufficient volume:			_	Œ Yes	□No	□n/a	8.				
Correct containers used:				Yes	□No	□n/a					<u> </u>
Pace containers used:				YYes	□No	□nia	9.				
Containers intact:				Yes	□No	□n/a	10.				
Unpreserved 5035A soils	frozen w/	in 48hrs?		□Yes	□No	MN/A	11.				
Filtered volume received	for dissolv	red tests?		□Yes	□No	E N/A	12.				
Sample labels match CO				MYes	□No	□N/A	1				
includes date/time/ID/an			Matrix:	WÍ			13.				
Ail containers needing prese					□No	□N/A	,				
All containers needing prese	ervation are	found to be	in compliance								
with EPA recommendation.				,	□No	□N/A	14. Initial wh	nen		l ot	# of added
Exceptions (VOA) Coliform, Trip Blank present:	O&G, WI-E	IRO (water)		Yes	□No		complet				servative
Pace Trip Blank lot # (if p		7/15		Yes	□No	□n/a					
Headspace in VOA vials		TIO			-		15.	<u>-</u>			
				∟Yes	No	□n/a					
S							16.				
Project sampled in USDA				□Yes	□No	ØN/A	17. List	State:			
Additional labels attached Client Notification/ Resolution	1 to 5035A	vials in the		□Yes		₽ N/A	18				
Person Contacted:	Signion:	- I	-7	OC to Clie		YIN	\nearrow 1	Field Da	ıta Requ	uired? Y	, 1(N)
Comments/ Resolution:	1001	Pro	Da	te/Time:	:	1.10	771	7	. 1		0.1/0.
Traduction.	_]&&	YCII		4 h C	HOI	934-	FIX) [n(<u>مه (</u>	<u> </u>	up (Shice
								7 1/	¬	(
Project Manager Review:		5H/		_			ate:	(,	7.7		
	į (ノリレ						*7			

Control Cont						CHRESSE T		i i	精	10	9	Ç	瓣7元	on .	O1		ယ	2		ITEM#		Requester	Phone	Email:	Address:	4.77	-
THE MANUAL REPORT TO PROMET TO THE PROMET TO P							ADDITIONAL COMMENTS											7 (2)0	176W MM	SAMPLE ID One Character per box. (A-Z, 0-9 /, -) Sample lds must be unique		Due Date: 7-33-1/	(913)461-5985 Fax	Dlathe, KS 56062			
TEMPLET NAME AND SIGNATURE OF START TIME SAMPLE TYPE (GAGRAG CACOMP) THAT AND SIGNATURE OF START TIME SAMPLE TYPE (GAGRAG CACOMP) THAT AND SIGNATURE OF START TIME SAMPLE TYPE (GAGRAG CACOMP) THAT AND SIGNATURE OF START TIME SAMPLE TEMP AT COLLECTION SAMPLE TEMP AT COLLECTION SAMPLE TEMP AT COLLECTION SAMPLE TEMP AT COLLECTION RESPONSE AND SIGNATURE					9	7		,									t	ANTO (3) DEAUTE	18950 (Hour			Project #:	Project Nat	Puchase	Copy Te:	Report To:	(Destricts,
Regulation THE STANFLER HAND SIGNATURE STANFLER THAN A COLLECTION PROPERTY AND SIGNATURE STANFLER HAND SIGNATURE STANFLER HA			- 5	-	3	9	RELIN	ti s		- 1				1	.8	12 11		_:		MATRIX CODE (see valid codes to	o left)	- 1	151	der #		Robe	LO oct
Regulation THE STANFLER HAND SIGNATURE STANFLER THAN A COLLECTION PROPERTY AND SIGNATURE STANFLER HAND SIGNATURE STANFLER HA					5	V	DUSHE		-	-	-	\vdash	\vdash	+	-	-		_			MP)	ā	7			M IUM	nform
TED INDICES INDICES	8 7	SAMP			- 1	5	D BY / AFFILIA									,_2		-	14 43	¥	17		2			dı	ation:
TEMP in C Residual Chlorine (Y/N) Temp in C Residual Chlorine (Y/N) Temp in C Residual Chlorine (Y/N)	GNATU	LER NA					NOI	<u> </u>	\vdash	╁	+	+			\vdash	-			3						4		
TEMP in C Residual Chlorine (V/N)	آرا و کارور	ME AN	-		- 4			_	-	+	+	+	-	+-	\vdash	-	-		_	E E							
TEMP in C Residual Chlorine (V/N)		D SIG			7	- 1	DATE	- 4					L						11	IME							
TEMP in C Residual Chlorine (V/N)	19	ER:	L		- 5	= -	9	_					-		-	[Ai	2 5	4	(J.)		_	1	70	20 3	2 0	Æ	1
NaOH Na2S2O3 NonLinesension place labs com. NaOH Na2S2O3 Melhanol Other Analyses Test YIN BTEX RCRA Metals RPH Ethanol Sulfur DATE Signed Time Time Time Time Time Time Time Time	1	1 1 2 2 4				7	TIME			+			-						y			ace Pro	ace Pro	ace Qu	ompan	tention	Aolce
NaOH Na2S2O3 NonLinesension place labs com. NaOH Na2S2O3 Melhanol Other Analyses Test YIN BTEX RCRA Metals RPH Ethanol Sulfur DATE Signed Time Time Time Time Time Time Time Time	F	t iii	_		_	9		_		\perp	_		\perp	-								file #.	ject M	કે	Name		13
NaOH Na2S2O3 ShortLosenstangle@pacelabs.com. Analyses Test VIN Analyses Test Plane Analyses Test Plane Analyses Test VIN BTEX RCRA Metals RCRA Metals Rolling	4	65		0				-	╁	-	+	+	+	+	+	X	X			HCI R		ķ	anager		1	27	HOIT.
Melhanol Other Analyses Test Y/N BTEX RCRA Metals Regulation Sulfur Time Time Time Time Time Time Time Tim	27		D		¥	7														NaOH Vativ			1		74.4V	3-	
Residual Chloring (Y/N) Residual Chloring (Y/N) Residual Chloring (Y/N) Residual Chloring (Y/N)		7			- 1,		CCE	_	1	-		-	\perp	-	-	-	_		 			5	inons.		1	10	
Residual Chloring (Y/N) Residual Chloring (Y/N) Residual Chloring (Y/N) Residual Chloring (Y/N)		दे			1	1	TEDE	-	+	+	+	+-	+	+-	╫	+	\vdash	-				3	Ueson		Ĉ.		l
Relative Community of the section of	기f	- X			- 1		TI AF		<u></u>											Analyses Test Y	'IN	Hall C	gnels		^		
DATE Temp in C Residual Chlorine (Y/N) Residual Chlorine (Y/N)	7	7		- 1	ė.	1			1	7.9	1			1	150	X			1						10		
TEMP in C Residual Chlorine (Y/N) Residual Chlorine (Y/N)	ATE	र्				1/2	₹	L	╀	+	+	+	+	+	+		×		_		\dashv	2	celab		7		١
TEMP in C Residual Chlorine (Y/N) Residual Chlorine (Y/N)	Signe				- 1		8	┝	+	+	+	+-	+	-	-	-	+-				\dashv	200	S.COM				l
TEMP in C Residual Chlorine (Y/N)	ן"נ																		×	Sulfur	\neg	4					l
TEMP in C Residual Chlorine (Y/N)	7	1			\neg	1/4	0						I									i avi					
TEMP in C Residual Chlorine (Y/N)	<u>-</u>					7	ATE		-	╀	+	+	+	+-	+	-	-	-			-	릙_	25		3 J	L	J
TEMP in C Residual Chlorine (Y/N)		125	H		-		244 121-1	-	-	+		-	+		-	-	┼─	╀			\dashv	2					
Received on 19		- 154		1		B	THE												SAIN			(N	į.				
Received on 9		殿	_		_	4	湖		_		\bot								1			1	S111.2		0		6
Received on 9	TEMP i	in C			}	3		<u> </u>											107	Residual Chlorine (Y/N)	Tues.		Sta	No.			age .
Custody Custody Gealed Cooler (Y/R) Samplus ntact		ed on	+	$\dagger \dagger$	+	4	SAL	\vdash	Τ	Τ	Τ	T	Τ	T	Τ				11			8	1/12				
Custody leaded Cooler Cooler Cyrky Samples Interior Cooler	(Y/N)				k	7	MPLE												2.5	60		# "	cato	1			-
Jonier Y/Ri) Samplus C C C C C C C C C C C C C C C C C C C	ealed	y	T		-		UGNOS							1					135	22			5	2			l
Samples V	Y/N)		1				BNOL												1 1	22			No. of				15
(CIN)	ntaci	35			*	\c							2						3	19		1000					1

பட்டின் பலிENT. All relevant fields must be completed countralely.





July 27, 2016

Robert Trump Total Petroleum Services 16601 W. 132nd Circle Olathe, KS 66062

RE: Project: SAC-N-FOX

Pace Project No.: 60223765

Dear Robert Trump:

Enclosed are the analytical results for sample(s) received by the laboratory on July 15, 2016. The results relate only to the samples included in this report. Results reported herein conform to the most current TNI standards and the laboratory's Quality Assurance Manual, where applicable, unless otherwise noted in the body of the report.

If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Shui Dosenstande_

Sherri Rosenstangle sherri rosenstangle@pacelabs.com Project Manager

Enclosures







CERTIFICATIONS

Project:

SAC-N-FOX

Pace Project No.:

60223765

Minnesota Certification IDs

1700 Elm Street SE Suite 200, Minneapolis, MN 55414

525 N 8th Street, Salina, KS 67401

A2LA Certification #: 2926.01

Alaska Certification #: UST-078

Alaska Certification #MN00064

Aiabama Certification #40770

Arizona Certification #: AZ-0014

Arkansas Certification #: 88-0680

California Certification #: 01155CA

Colorado Certification #Pace

Connecticut Certification #: PH-0256

EPA Region 8 Certification #: 8TMS-L

Fiorida/NELAP Certification #: E87605

Guam Certification #:14-008r

Georgia Certification #: 959

Georgia EPD #: Pace

idaho Certification #: MN00064

Hawaii Certification #MN00064

Illinois Certification #: 200011

Indiana Certification#C-MN-01

iowa Certification #: 368

Kansas Certification #: E-10167

Kentucky Dept of Envi. Protection - DW #90062

Kentucky Dept of Envi. Protection - WW #:90062

Louisiana DEQ Certification #: 3086

Louisiana DHH #: LA140001

Maine Certification #: 2013011

Maryland Certification #: 322

Michigan DEPH Certification #: 9909

Indiana Certification IDs

7726 Moller Road, Indianapolis, IN 46268

Illinois Certification #: 200074

Indiana Certification #: C-49-06

Kansas/NELAP Certification #:E-10177

Kentucky UST Certification #: 0042

Kentucky WW Certification #:98019

Kansas Certification IDs

9608 Loiret Boulevard, Lenexa, KS 66219

WY STR Certification #: 2456.01

Arkansas Certification #: 15-016-0

Illinois Certification #: 003097

Iowa Certification #: 118

Kansas/NELAP Certification #: E-10116

Minnesota Certi ication #: 027-053-137

Mississippi Cert fication #: Pace

Montana Certification #: MT0092

Nevada Certification #: MN_00064

Nebraska Certification #: Pace

New Jersey Certification #: MN-002

New York Certification #: 11647

North Carolina Certification #: 530

North Carolina State Public Health #: 27700

North Dakota Certification #: R-036

Ohio EPA #: 4150

Ohio VAP Certification #: CL101

Oklahoma Certification #: 9507

Oregon Certification #: MN200001

Oregon Certification #: MN300001

Pennsylvania Certification #: 68-00563

Puerto Rico Certification

Saipan (CNMI) #:MP0003

South Carolina #:74003001

Texas Certification #: T104704192

Tennessee Certification #: 02818

Utah Certification #: MN000642013-4

Virginia DGS Certification #: 251

Virginia/VELAP Certification #: Pace

Washington Certification #: C486

West Virginia Certification #: 382

West Virginia DHRR #:9952C

Wisconsin Certification #: 999407970

Ohio VAP Certification #: CL-0065 Okiahoma Certification #: 2014-148 Texas Certification #: T104704355-15-9

West Virginia Certification #: 330

Wisconsin Certification #: 999788130

USDA Soil Permit #: P330-10-00128

Louisiana Certification #: 03055

Nevada Certification #: KS000212008A

Okiahoma Certification #: 9205/9935

Texas Certification #: T104704407

Utah Certification #: KS00021

Kansas Field Laboratory Accreditation: # E-92587

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..



Pace Analytical Services, Inc. 9608 Loiret Blvd. Lenexa, KS 66219 (913)599-5665

SAMPLE SUMMARY

Project:

SAC-N-FOX

Pace Project No.: 60223765

Lab ID	Sample ID	Matrix	Date Collected	Date Received
60223765001	F3-GW	Water	07/11/16 16:30	07/15/16 17:10

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc.



Pace Analytical Services, Inc. 9608 Loiret Blvd. Lenexa, KS 66219 (913)599-5665

SAMPLE ANALYTE COUNT

Project:

SAC-N-FOX

Pace Project No.: 60223765

Lab ID	Sample ID		Methoc	Analysts	Analytes Reported	Laboratory
60223765001	F3-GW		EPA 8015 Alcohol-Giycoi	BJW	1	PASI-I
			EPA 6010	SMW	7	PASi-K
			EPA 6010	IP	1	PASI-M
			EPA 7470	TDS	1	PASI-K
			EPA 5030B/8260	PGH	8	PASI-K
			SM 4500-H+B	LDB	1	PASi-K

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..





ANALYTICAL RESULTS

Project:

SAC-N-FOX

Pace Project No.: 60223765

Sample: F3-GW	Lab ID: 602	223765001	Collected: 07/11/1	6 16:3	Received: 07	7/15/16 17:10 N	latrix: Water	
Comments: • Samples requiring	thermal preservation	were received	d outside of recomm	nended	temperature limit	s of 0-6 degrees		
Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qua
8015M Alcohols in water	Analytical Me	hod: EPA 801	5 Alcohol-Glycoi	1				
Ethanol	8.6	mg/L	5.0	1		07/20/16 15:42	64-17-5	
6010 MET ICP	Analytical Me	thod: EPA 601	0 Preparation Met	hoc: EF	PA 3010			
Arsenic	12.2	ug/L	10.0	31	07/21/16 11:15	07/22/16 11:14	7440-38-2	
Sulfur	5660	ug/L	500	1		07/22/16 20:27	1110-00-2	
Barium	2270	ug/L	10.0	1		07/22/16 11:14	7440 20 2	
Cadmium	ND	ug/L	5.0	ાં		07/22/16 11:14		
Chromium	ND	ug/L	5.0	4		07/22/16 11:14		
Lead	ND	ug/L	5.0	1		07/22/16 11:14		
Selenium	ND	ug/L	15.0	1		07/22/16 11:14		
Silver	ND	ug/L	7.0	1		07/22/16 11:14		
7470 Mercury			0 Preparation Met			07/22/10 11.14	7440-22-4	
Mercury	ND	ug/L	0.20	1		07/25/16 13:57	7439-97-6	
8260 MSV	Analytical Met	hod: EPA 503	30B/8260				1 100 07 0	
Benzene	3090	ug/L	50.0	50		07/00/40 44 07	=1	
Ethylbenzene	25 .7	ug/L	1.0			07/22/16 14:27		
Toluene	5120	ug/L	50.0	1 50		07/20/16 14:29		
Xyiene (Totai)	6440	•		50		07/22/16 14:27		
Surrogates	0440	ug/L	150	50		07/22/16 14:27	1330-20-7	
4-Bromofluorobenzene (S)	98	%	77-130	1		07/20/40 44-20	400.00.4	
1,2-Dichloroethane-d4 (S)	101	%	81-127	1		07/20/16 14:29		
Toluene-d8 (S)	101	%	80-120	4		07/20/16 14:29		
Preservation pH	1.0	/0	0.10			07/20/16 14:29	2037-26-5	
	1.0		0.10	1		07/20/16 14:29		
4500H+ pH, Electrometric	Analytical Met	hod: SM 4500	0-H+B	:				
pH at 25 Degrees C				10				
ori at 25 Degrees C	6.8	Std. Units	0.10	ୃ1		07/20/16 12:45		H6



MATRIX SPIKE & MATRIX SPIKE DUPLICATE: 1587709

Units

mg/L

Parameter

Ethanol

Pace Analytical Services, Inc. 9608 Loiret Blvd. Lenexa, KS 66219 (913)599-5665

QUALITY CONTROL DATA

Project: SAC-N-FOX Pace Project No.: 60223765							
QC Batch: 342803 QC Batch Method: EPA 8015 Alcoh Associated Lab Samples: 60223768	-	Analysis Analysis	Method: Description:	EPA 8015 Alco EPA 8015 Mod	-		
METHOD BLANK: 1587707 Associated Lab Samples: 6022376	5001	Ma	trix: Water				
Parameter	Units	Blank Result	Reportin Limit	g Analyze	ed Qua	alifiers	
Ethanol	mg/L		ND	5.0 07/20/16 1	1:49		
LABORATORY CONTROL SAMPLE:	1587708			3			
Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers	
Ethanol	mg/L	50	46.2	92	70-133		

MSD

Spike

Conc.

MS

Spike

Conc.

50

60223575001

Result

ND

1587710

MS

Result

32.0

MSD

Result

38.9

MS

% Rec

MSD

% Rec

% Rec

61-143

Limits RPD RPD

Max

Qual

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..



Pace Analytical Services, Inc. 9608 Loiret Blvd. Lenexa, KS 66219 (913)599-5665

QUALITY CONTROL DATA

Project: Pace Project No.:	SAC-N-FOX 60223765					ė						
QC Batch:	439735		Analys	is Method	:	E!PA 7470						
QC Batch Method:	EPA 7470		Analys	is Descrip	tion:	7470 Mercur	y					
Associated Lab San	ples: 6022376500	1				;						
			N	fatrix: Wa	ter	•						
Associated Lab San	nples: 6022376500	I										
Paran	neter	Units	Blank Result		eporting Limit	, Analyz	ted	Qualifiers	;			
Mercury		ug/L		ND	0.2	07/25/16	12:21		_			
LABORATORY CON	NTROL SAMPLE: 17	799382										
			Spike	LCS	5	LCS	% Re	c				
Paran	neter	Units	Conc.	Resu	ilt	% Rec	Limits	s C	ualifiers			
Mercury		ug/L	5		4.8	97	8	0-120		_		
MATRIX SPIKE & M	ATRIX SPIKE DUPLIC	CATE: 17993	83		1799384	1 '						
			MS	MSD	175550-	,						
Paramete		60223593001 Result	Spike Conc.	Spike Conc.	MS Result	MSD , Result	MS % Rec	MSD % Rec	% Rec Limits	RPD	Max RPD	Qual

5.0

5.0

88 75-125

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..

Mercury

ug/L

0.61





QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.: 60223765

QC Batch: QC Batch Method:

439438

EPA 3010

Analysis Method:

EPA 6010

Associated Lab Samples: 60223765001

Analysis Description:

6010 MET

METHOD BLANK: 1797181

Matrix: Water

Associated Lab Samples: 60223765001

Parameter	Units	Blank Result	Reporting Limit !	Analyzed	Qualifiers
Arsenic Barium Cadmium Chromium Lead	ug/L ug/L ug/L ug/L ug/L	ND ND ND ND	10.0, 5.0 5.0	07/22/16 11:08 07/22/16 11:08 07/22/16 11:08 07/22/16 11:08 07/22/16 11:08	
Selenium Silver	ug/L ug/L	ND ND	15.0 7.0	07/22/16 11:08 07/22/16 11:08	

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec		% Rec Limits	Qualifiers
senic	ug/L	1000	1080	1	08	80-120	
arium	ug/L	1000	1010		01	80-120	
admium	ug/L	1000	1120	1	112	80-120	
nromium	ug/L	1000	961	T.	96	80-120	
ead elenium	ug/L	1000	1110	1	111	80-120	
ver	ug/L	1000	1100	1	110	80-120	
ivei	ug/L	500	496		99	80-120	

MATRIX SPIKE & MATRIX		TE: 17971			1797184	ì						
			MS	MSD								
	6	0223766001	Spike	Spike	MS	MSD	MS	MSD	% Rec		Max	
Parameter	Units	Result	Conc.	Conc.	Result	Result	% Rec	% Rec	Limits	RPD		Quat
Arsenic	ug/L	ND	1000	1000	1110	1120	110	111	75-125		20	
Barium	ug/L	2260	1000	1000	3210	3240	96	98	75-125	1	20	
Cadmium	ug/L	ND	1000	1000	1120	1130	112	113	75-125	1	20	
Chromium Lead	ug/L	ND	1000	1000	926	930	93	93	75-125	0	20	
Selenium	ug/L	ND	1000	1000	1030	1030	103	103	75-125	0	20	
Silver	ug/L	ND	1000	1000	1120	1130	112	113	75-125	1	20	
	ug/L	ND	500	500	503	504	101	101	75-125	0	20	

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc..



Pace Analytical Services, Inc. 9608 Loiret Blvd. Lenexa, KS 66219 (913)599-5665

QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.:

60223765

QC Batch:

426351

QC Batch Method: EPA 3010

Associated Lab Samples: 60223765001

Analysis Method:

EPA 6010

Analysis Description:

6(10 MET

METHOD BLANK: 2321335

Matrix: Water

Associated Lab Samples:

60223765001

ug/L

Units

ug/L

Reporting Limit

Analyzed

Sulfur

Sulfur

Units

Result ND

Blank

500 07/22/16 19:58

Qualifiers

Parameter

Parameter

Parameter

LABORATORY CONTROL SAMPLE:

LCS Result

LCS % Rec % Rec Limits

100

Qualifiers

2321338

20000

MSD

80-120

MSD % Rec

Max

Qual

MATRIX SPIKE & MATRIX SPIKE DUPLICATE:

2321337

MS Spike

Spike

Conc.

20000

MSD Spike

MS Result Result

% Rec

% Rec Limits RPD RPD

Sulfur

Units ug/L

60223766001 Result 5310

Conc. Conc. 20000

25400 26700

101

MS

107 75-125

20

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.





QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.: 60223765

QC Batch:

439301

Analysis Method:

EPA 5030B/8260

QC Batch Method: EPA 5030B/8260

Analysis Description:

8260 MSV Water 10 mL Purge

Associated Lab Samples: 60223765001

Matrix: Water

METHOD BLANK: 1796709

Associated Lab Samples: 60223765001

Parameter	Units	Blank Result	Reporting :	Analyzed	Qualifiers
Ethylbenzene 1,2-Dichloroethane-d4 (S)	ug/L %	ND	1.0	011=0110 00100	
4-Bromofluorobenzene (S)	%	96 97	77-130	07/20/16 09:09 07/20/16 09:09	
Toluene-d8 (S)	%	99	80-120	07/20/16 09:09	

LABORATORY CONTROL SAMPLE: 17967	LA	BORATORY	CONTROL	SAMPLE:	179671
----------------------------------	----	----------	---------	---------	--------

Parameter	Units	Spike Conc.	LCS Result	LCS % Re		% Rec Limits	Qualifiers
Ethylbenzene	ug/L	20	21.0		105	80-120	
1,2-Dichloroethane-d4 (S)	%				99	81-127	
4-Bromofluorobenzene (S)	%				98	77-130	
Toluene-d8 (S)	%			i.	99	80-120	

MATRIX SPIKE & MATRIX SP	IKE DUPLIC	CATE: 17967	11		1796712 :							
Parameter	Units	60223758002 Result	MS Spike Conc.	MSD Spike Conc.	MS Result	MSD Result	MS % Rec	MSD % Rec	% Rec	RPD	Max RPD	Qual
Ethylbenzene	ug/L	ND ND	20	20	22.1	22.2	110	111	29-151	0	45	
1,2-Dichloroethane-d4 (S)	%						98	95	81-127	_		
4-Bromofluorobenzene (S)	%						96	96	77-130			
Toluene-d8 (S)	%						98	100	80-120			
Preservation pH		1.0			1.0	1.0				0		

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.





QUALITY CONTROL DATA

Project:

SAC-N-FOX

Pace Project No.:

60223765

QC Batch:

439616

Analysis Method:

EPA 5030B/8260

QC Batch Method: EPA 5030B/8260

Associated Lab Samples: 60223765001

Analysis Description:

8260 MSV Water 10 mL Purge

Date: 07/27/2016 11:46 AM

Matrix: Water

METHOD BLANK: 1798182

Associated Lab Samples: 60223765001

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Benzene	ug/L	ND ND	1.0	07/22/16 12:30	
Toluene	ug/L	ND		07/22/16 12:30	
Xylene (Total)	ug/L	ND		07/22/16 12:30	
1,2-Dichloroethane-d4 (S)	%	100	81-127 [:]	07/22/16 12:30	
4-Bromofluorobenzene (S)	%	99	77-130 ¹	07/22/16 12:30	
Toluene-d8 (S)	%	100	80-120	07/22/16 12:30	

LABORATORY CONTROL SAMPL	E: 1798183	Spike	LCS	LCS	% Rec	
Parameter	Units	Conc.	Result	% Rec	Limits	Qualifiers
Benzene	ug/L	20	19.9	100	79-116	
Toluene	ug/L	20	19.1	95	80-120	
Xylene (Total)	ug/L	60	58.4	97	80-120	
1,2-Dichloroethane-d4 (S)	%			101	81-127	
4-Bromofluorobenzene (S)	%			. 98	77-130	
Toluene-d8 (S)	%			100	80-120	

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.



Pace Analytical Services, Inc. 9608 Loiret Bivd. Lenexa, KS 66219 (913)599-5665

QUALIFIERS

Project:

SAC-N-FOX

Pace Project No.:

60223765

DEFINITIONS

DF - Dilution Factor, if reported, represents the factor applied to the reported data due to dilution of the sample aliquot.

ND - Not Detected at or above adjusted reporting limit.

J - Estimated concentration above the adjusted method detection limit and below the adjusted reporting limit.

MDL - Adjusted Method Detection Limit.

PQL - Practical Quantitation Limit.

RL - Reporting Limit.

S - Surrogate

1,2-Diphenylhydrazine decomposes to and cannot be separated from Azobenzene using Method 8270. The result for each analyte is a combined concentration.

Consistent with EPA guidelines, unrounded data are displayed and have been used to calculate % recovery and RPD values.

LCS(D) - Laboratory Control Sample (Duplicate)

MS(D) - Matrix Spike (Duplicate)

DUP - Sample Duplicate

RPD - Relative Percent Difference

NC - Not Calculable.

SG - Silica Gel - Clean-Up

U - Indicates the compound was analyzed for, but not detected.

N-Nilrosodiphenylamine decomposes and cannot be separated from Diphenylamine using Method 8270. The result reported for each analyte is a combined concentration.

Pace Analytical is TNI accredited. Contact your Pace PM for the current list of accredited analytes.

TNI - The NELAC Institute.

LABORATORIES

PASI-I

Pace Analytical Services - Indianapolis

PASI-K PASI-M Pace Analytical Services - Kansas City

PASI-M Pace Analytical Services - Minneapolis

BATCH QUALIFIERS
Batch: 439616

[M5]

A matrix spike/matrix spike duplicate was not performed for this batch due to insufficient sample volume.

ANALYTE QUALIFIERS

Date: 07/27/2016 11:46 AM

H6

Analysis initiated outside of the 15 minute EPA required holding time.

REPORT OF LABORATORY ANALYSIS





QUALITY CONTROL DATA CROSS REFERENCE TABLE

Project:

SAC-N-FOX

Pace Project No.: 60223765

Lab ID Sample 1D 60223765001 F3-GW		QC Batch Method	QC Batch	Analytical Method	Analytica Batch
		EPA 8015 Alcohol-Glycol	342803		2 1
60223765001	F3-GW	EPA 3010	426351	EPA 6010	426659
6 0223765001	F3-GW	EPA 3010	439438	EPA 6010	. 439538
50223765001	F3-GW	EPA 7470	439735	EPA 7470	439802
50223765001	F3-GW	EPA 5030B/8260	439301		
60223765001	F3-GW	EPA 5030B/8260	439616		
60223765001	F3-GW	SM 4500-H+B	439244		



Sample Condition Upon Receipt

WO#: 60223765

Client Name: Total Petroleum								
				Optional				
Courier: FedEx UPS VIA Clay	PEX [] [CI 🗆	Pace Other OClient Proj Due Date:				
	Pace S	hippin	g Label	Used? Yes □ No □ Proj Name:				
Custody Seal on Cooler/Box Present: Yes □ No	图	Seals i	ntact:	Yes □ No 021				
Packing Material: Bubble Wrap Bubble Ba	gs 🕅		Foam	□ None □ Other □				
T-266 T-239	ype of	lce:		ue None Samples received on ice, cooling process has begun.				
Cooler Temperature: 4.7			(circ	Date and initials of person examining				
Temperature should be above freezing to 6°C				contents: JB FIL				
Chain of Custody present:	Yes	□No	□n/a	1. Dut of temp				
Chain of Custody filled out:	Yes	□No	□n/A	2.				
Chain of Custody relinquished:	® Yes	□No	□n/a	3.				
Sampler name & signature on COC:	Yes	□No	□n/a	4.				
Samples arrived within holding time:	Yes	□No	□n/a	5.				
Short Hold Time analyses (<72hr):	M Yes	□No	□N/A	6. NA				
Rush Turn Around Time requested:	□Yes	No	□N/A	7.				
Sufficient volume:	Myes	□No	□n/a	8.				
Correct containers used:	Yes	□No	□N/A					
Pace containers used:	Yes	□No	□n/a	g.				
Containers intact:	Yes	□No	□N/A	10.				
Unpreserved 5035A soils frozen w/in 48hrs?	□Yes	□No	ØN/A	11,				
Filtered volume received for dissolved tests?	□Yes	□Na	E N/A	12.				
Sample labels match COC:	Mayes.	□No	□n/A					
Includes date/time/ID/analyses Matrix:	WI			13.				
All containers needing preservation have been checked.	DYes	□No	□n/a					
All containers needing preservation are found to be in compliance								
With EPA recommendation.	U/UYes	□No	□N/A	14.				
Exceptions (VOA) Collform, O&G, WI-DRO (water) Trip Blank present:	νes	□No		Initial when Lot # of added completed preservative				
. 11 101	X Yes	□No	□N/A					
Pace Trip Blank lot # (if purchased): 7 15 Headspace in VOA vials (>6mm):				15.				
readspace in VOA via)s (>omm):	□Yes	I No	□N/A					
				16.				
Project sampled In USDA Regulated Area:	□Yes	□No	⊠ N/A	17. List State:				
Additional labels attached to 5035A vials in the field?	□Yes	□No	MN/A	18				
Client Notification/ Resolution: Copy COC to Client? Y / N Field Data Required? Y / N								
Person Contacted: Date/Time: 17:15:								
Comments/Resolution: Le 2011 en la la la formate den D 1566								
Project Manager Review:				7.19.16				
Tojour Mariager Review:			ī	Date:				


Email: robertifump@gmail.com Phone: (913)461-5885 Fi Requested Due Date: アースランパッ Required Client Information:
Company Total Petroleum Services
Address: 16501 W 132nd Circle 7 6 9 Ch w ITEM# Pare Aminoni 71 Olatha, KS 66062 SAMPLE ID
One Character per box.
[A.Z. 0-9 / , -)
Sample lds must be unique w 1 ADDITIONAL COMMENTS CM BONDOSDIN (3) DIAN COMM MATRIX
Deniary Weter
Where
Whate Vister
Penduct
Self-Soid
Ja
Vipe
Air
Coner
Tissue Report To: Robert Trump Project Name: Copy Ta: Purchase Order #: Required Project Information: RELINQUISHED BY / AFFILIATION MI MATRIX CODE (see valid codes to left) ¥ SAMPLETYPE (G=GRAB C=COMP) 6 7ーかる 12 START MIK die.h SAMPLER MAME AND SIGNATURE TIME. COLLECTED FOR THE PRINT Name of SAMPLER: TOMETHY SIGNATURE of SAMPLER: CHAIN-OF Co. The Chain-of-Custody is a -.. in END V TIME. DATE 15% SAMPLE TEMP AT COLLECTION Company Name:

Address: SAYAE AS (1/cN)

Paco Quote:

Paco Project Namayer: sherri_rosenstungle@pacenabs.com,

Paco Profile #: -6941.5 V.C.4 | Requeste Attention: 7 PS 0/2/0 U8 6V # OF CONTAINERS verilan C 7 TIME Unpreserved H2SO4 ниоз Preservatives メーソ HCI NaOH Line Alexand fields must be compreted accurately. ACCEPTED BY I APPLIATION Na2S2O3 Methanol Other **Analyses Test** Y/N BTEX RCRA Metals . i locurent ρН Elhanol Sulfur 2/15 DATE 元 BARE Page : しから TEMP in C Regulatory Agency Residual Chlorine (Y/N) Received on SAMPLE CONDITIONS (Y/N) Custod Spaled Cooler 잋 (Y/N) Samples E Intact (Y/N)

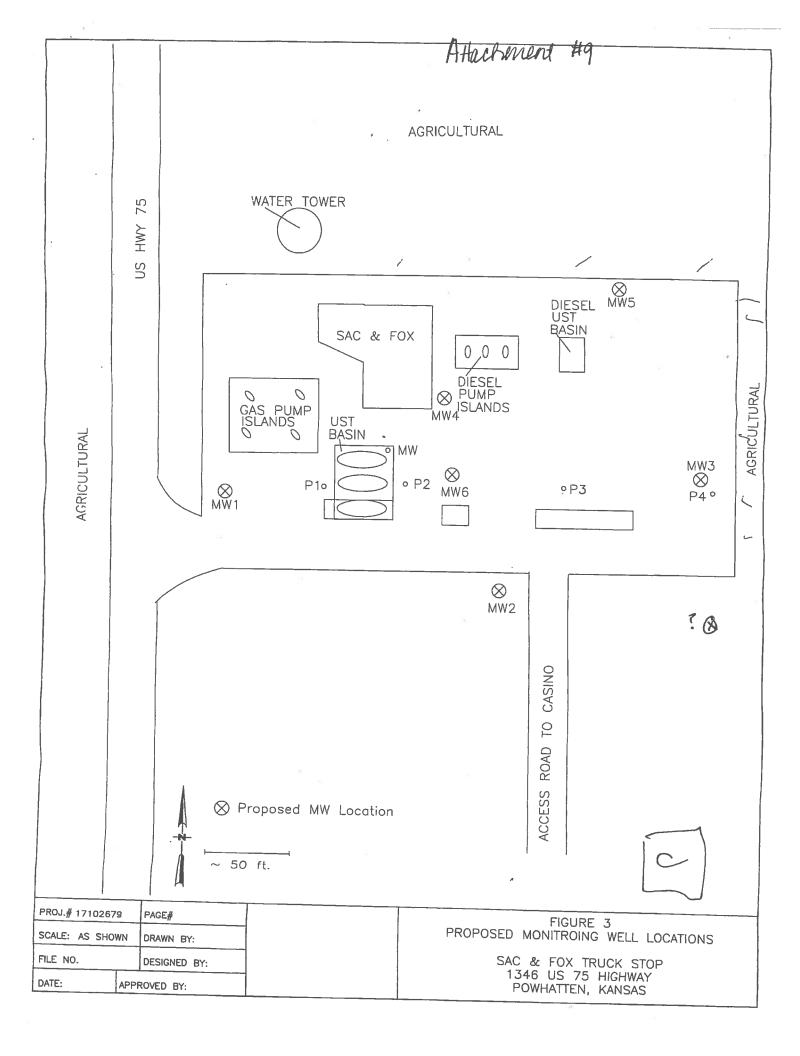

Douglas E Drouare, CPG USEPA, Region 7 11201 Renner Boulevard Lenexa, Kansas 66219

August 20, 2015 Revised June 21, 2016

RE: Leaking Underground Storage Tank Sac & Fox Truck Stop 1346 US Hwy 75 Powhattan, Kansas 66527

Dear Mr. Drouare,

Sac and Fox Truckstop was built in 1998 by M.A.C. Corporation, Independence MO. Robert Andrew who is still currently with M.A.C. was involved at the time of construction. Four fuel tanks were installed at that time. Documentation (Attachment 1) show that the tanks were XERXES double wall tanks with a 30 Year warranty.

Here is a timeline of events and actions taken regarding the ruptured fuel tank at Sac and Fox Truck Stop. (Attachment 2) is a diagram of the Truck Stop and where tanks set on the property for reference.

- July 20, 2015 Phone call from staff stating tank alarm was going off at approximately 9:30 p.m. Amanda responded by having them ck fuel levels and the North tank was below alarm level and needed fuel to siphon from the South tank. A few minutes later staff calls back and says alarm is still going off, Amanda then has them check water levels. At this time we now have a vehicle in the parking lot that will not stay running. Immediately all pumps are shut off at approximately 9:35p.m. Any car fueling with midgrade fuel during that 5 minute period would not run. Police, fire, emergency management and all other personnel needed responded. Parking lot was evacuated for everyones safety until we could assess the situation. We knew water was coming from somewhere but had no idea where from. Spent lots of time trying to determine water source. Our tank monitoring print out showed no water in the fuel at the beginning of the day.
- July 22, 2015 Robert Trump with Adler Tank Rentals, brought a Frac tank and pumped approximately 19,000 gallons of fuel and water into the Frac tank. At this time we could tell tank was ruptured and the probe was stuck in the ground from the pressure and that ground water was the responsible water source. At this time fuel needs to separate from water for 2-3 days to determine how much fuel was recovered. Then samples need to be sent for testing.
- July 24, 2015 Robert Trump with Adler returns to take samples of fuel and water for testing. We also determine that on July 20, 2015 Midgrade tank totals were

5,882.00 gallons, we sold 2185.11 gallons of midgrade fuel and that 2357.00 gallons of midgrade fuel was in the Frac tank, (Attachment 3) leaving 1339.89 gallons of midgrade fuel unaccounted for. Water and fuel samples are taken to Pace Analytical.

- July 27, 2015 Results of fuel and water samples come back from Pace Analytical. (Attachment 4)
- Fuel can be recovered but need to determine who will recover fuel from Frac tank
 and how to properly handle the contaminated water. Activated carbon vs. reclaim
 facility.
- July 27, 2015 Tankology Inc. comes to scope tanks and determine possible cause and damage. North midgrade tank is ruptured and south midgrade has a crack on top where vent pipe had been run over recently. South and north tanks are manifolded. Appears water pressure from excessive ground water caused pea gravel to erode, allowing tank to rupture.
- August 6, 2015 Estimates come from Robert Trump with Adler to determine procedure of disposing of contaminated water.
- August 11, 2015 Tribal Council approved to have midgrade fuel recovered from Frac tank by HAAG oil and to have contaminated water hauled to a reclaim facility.
- August 18, 2015 2000 gallons of fuel is recovered from Frac tank and blended with 1250 gallons of premium fuel to make fuel the correct octane level. (Attachment 5)
- August 19, 2015 Adler hauls contaminated water to reclaiming facility (Attachment 6). Also delivers a 300 gallon bladder for the ongoing process of reclaiming fuel from ruptured tank. Waiting on estimate to purchase a diaphragm pump and a compressor.
- At this time we know that there is still fuel in the ground because we have stuck the tank. Our thought is that it is in overfill tanks and that we will recover most of the missing fuel.
- Ongoing, will now start to pump bi-weekly out of ground to recover any fuel
 missing. Will store in bladder, let fuel separate from water and keep track of all
 product recovered each time. This procedure could take up to 12 months or until
 we can no longer recover any more fuel. After a period of time when there is no
 more recovery of product we will need to have soil tested.
- At this time we are possibly considering properly abandoning the North ruptured tank which is no longer in use.

- August 27, 2015 Ethan with PEI capped off manifold to south tank so we could start operating north tank. Reclaimed 442 gallons of fuel. (tank reading) (Attachment 7)
- August 28, 2015 Josh with PEI flushed fuel lines and recovered 150 gallons of fuel. Remaining gallons of fuel unaccounted for now totaling 746 gallons.
- Estimate received 9-21-2015 from Total Petroleum Services for Consultant, Geologist and site characterization. Waiting for Tribal Councils approval to continue with clean up/compliance efforts and free product recovery.
- Ace North American Claims is insurance covering remediation only. Contact Brian Hong 866-635-5698.
- Sac and Fox Truck Stop has been operational since incident on 7-20-2015 excluding the use of the ruptured North midgrade tank.
- November 19, 2015 Geologist take analytical samples for testing and drill for 4 Temporary Piezometers. Robert Trump from Total Petroleum Services, Robert Andrew from M.A.C. Corporation who installed the tanks, Ethan Kappler with P.E.I. and Mark Junker with Tribal EPA were all here. Appears contamination is within the Truck Stop property. Ruptured tank video was viewed by all, video shows a rupture approximately one third of the way up on east side approximately 7-8 inches in diameter. I was to receive test results in 10-12 days.
- January 18, 2016 have not received any results from analytical testing or piezometers. Still no response from Robert Andrew on Xerxes warranty.
- February 16, 2016 Received Site Investigation Report of general soil
 characteristics of the subsurface and initial impacts to the soil and groundwater
 due to failing gasoline underground storage tank. Terranext also provided cost to
 install 5 permanent monitoring wells, collect groundwater samples, complete an
 initial conceptual site model (CSM), screen and model groundwater data to
 determine soil vapor inhalation risk at Sac and Fox Truckstop. (Attachment 8)
- February 29, 2016 Meeting onsite at Sac and Fox Truckstop to discuss next steps and overall plan to continue with finalization of remediation and repair or abandonment of ruptured fuel tank. In attendance were Randy Dolifka PEI, William Millard Crawford and Company, Robert Trump Total Petroleum Services, Chris Kinn Geologist, Robert Andrews MAC Corp., Lisa Montgomery Sac and Fox EPA, Gary Bahr Sac and Fox Tribal Council, Theresa Armbruster Sac and Fox Truck Stop Manager, Amanda Kramer Sac and Fox Asst. Manager and VIA phone Anita Ketola ACE Insurance. It was unanimous by all in

attendance that the only way to determine the cause of the ruptured fuel tank would be to investigate the site. After determining the cause, being impact or defect then the decision will be made to either repair the existing Xerxes double wall tank with a 30 year warranty which was installed in 1998 and have it recertified or properly abandon the tank which would be the safest option and install a new tank in a new site. While the tank site is open we will be prepared to deal with free product, define plume and install wells. Initially 5 wells were suggested but was determined 2 would be sufficient. All work pending estimates and approval from Insurance Companies.

- March 21, 2016 Received estimate to repair ruptured fuel tank.
- April 20, 2016 Robert Trump Total Petroleum Services responds to Region 7.
- April 22, 2016 Insurance needing a breakdown of proposed estimate and an estimate for a replacement tank from M.A.C. Corp.
- May 11, 2016 Currently waiting for Estimates to install new tank if that determination is made immediately following the excavation of the northern area of the tank exposing the ruptured tank.
- May 17, 2016 Received estimate from Randy Dolifka PEI for new tank not sure of status on estimate from Robert Andrew MAC Corp.
- May 20, 2016 Received revised estimate from M.A.C. Corp.
- May 25, 2016 Tribal Council approved the excavation work proposed by M.A.C. Corp. Need to contact Robert Andrew to confirm a start date.
- June 8, 2016 Robert Andrew, M.A.C. Corp. still trying to coordinate with XERXES.
- June 16, 2016 M.A.C. Corp has a start date July 11, 2016 need to confirm with all involved.
- June 20, 2016 Confirmed with M.A.C. Corp. Everyone would be available for July 11, 2016 start date.
- June 21, 2016 contacted Robert Trump about providing Region 7 with an acceptable form of reporting.
- July 10, 2016 Robert Trump with Total Petroleum comes to start removing water to prepare for excavation on July 11, 2016 only to discover excessive amounts of water. Three FRAC tanks were needed for 60,000 plus gallons of contaminated water.

- July 11, 2016 Robert Andrew M.A.C. Corp starts preparing for excavation but due to large amounts of rain and excessive rain in the forecast suggests we delay all work. Rescheduled for week of July 26, 2016.
- July 15, 2016 Analytical results from water in three FRAC tanks are available. (Attachment #8)
- July 26, 2016 Week of. Partially expose ruptured fuel tank on East end enough to see that it IS NOT a red XERXES fuel tank. The tank is white and it is a Containment Solutions tank. All work is once again postponed. Prior to all of this Xerxes nor Containment Solutions had any records of tanks at our Truck Stop. Once we provided Containment Solutions with Serial numbers then they acknowledge us having those tanks.
- August 15, 2016 Week of. Completion of exposing ruptured fuel tank finally happens with everyone required in attendance. Robert Andrew M.A.C. Corp, Knudeson Construction sub contractor for M.A.C., Kyle Minden Central Region Engineering Manager, William Millard Crawford and Company, Matthew Cansen ACE/CHUBB, Gary Bahr Sac and Fox Tribal Council, Total Petroleum to assist with continued water removal and two Field Service Technicians from Containment Solutions. Containment Solutions technicians prepared and opened the east end of the ruptured fuel tank. On the SE side of the tank was approximately a five foot section of the fiberglass tank that had pulled away from the frame laying on top of the gravel underneath the rupture. At this time it was determined by Containment Solutions Field Service Techs that the tank WAS NOT Repairable. Time Line to receive a new fuel tank 4 months.
- September 6, 2016 Geologist installs 8 monitoring wells. Attachment showing well locations on the property. Geologist will return for sampling week of September 19, 2016. Sampling report expected by the first week of October 2016. (Attachment #9)
- September 1, 2016 Tribal Council decides we are no longer waiting on Insurance Companies to decide who is covering what, that we have been more than cooperative with their demands which have caused this situation to accrue a lot of unnecessary cost that they now want to fight over who is responsible for paying.
- September 6, 2016 Total Petroleum starts hauling off contaminated water from FRAC tanks to reclaim facility. Takes until September 12, 2016 to complete. Recovered free product from FRAC tank #1 was 5 inches. Recovered free product from FRAC tank #2 was 1 inch. Nothing was recovered from FRAC tank #3. The recovered free product should cover the 746 gallons of product not accounted for prior to this date.
- September 19, 2016 Scheduled conference call with Sac and Fox EPA, Region 7 and Theresa Armbruster to go over this information and to update.

Sincerely,

Theresa Armbruster Manager, Sac and Fox Truck Stop

Drouare, Douglas

From:

Drouare, Douglas

Sent:

Tuesday, September 27, 2016 7:25 AM

To:

'M.Junker'; 'Sac & Fox Truck Stop'; Lisa Montgomery

Subject:

Sac & Fox Truck Stop LUST Situation

Categories:

EZ Record - Shared

All,

Here is some contact information for Tom Schruben. Tom led the ASTM effort to develop forensic standards for failed tank systems. He might be helpful.

http://schruben.com/

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: M.Junker [mailto:mark.junker@sacfoxenviro.org]

Sent: Monday, September 19, 2016 2:06 PM

To: Drouare, Douglas <drouare.douglas@epa.gov>

Cc: Bustos, Patrick <Bustos.Patrick@epa.gov>; Hayes, Scott <Hayes.Scott@epa.gov>; Bosch, Raymond

<Bosch.Raymond@epa.gov>; Lisa Montgomery <lisa.montgomery@sacfoxenviro.org>

Subject: RE: Follow Up to Discussion this Morning

Thanks Doug,

Patrick Lisa and I discussed increased USEPA visibility when we toured the site during our RTOC and I shot off a quick email to you about that same time.

We were all very frustrated with the delays we had been experiencing and what we perceived as stall tactics.

Later when we learned the insurance company expressed to Theresa that their obligation might cease due to the time it took to expose the tank we assumed some of these delays may have been manufactured.

We see no down side to your increased participation. It helps us and the other entities better understand the mindset of EPA. Carolyn Hoskinson echoed that when I spoke to her in August at the Tribal Lands Forum.

Additionally, I think it helps us moving forward with not only this issue but with other concerns unique to tanks in Indian Country.

We were also interested in determining just how and why the tank failed. I had a chance to speak with Robin Davis who worked the State of Utah and has done vapor intrusion work for USEPA and she suggested we might be able to get someone interested in doing a study of our tank. We have at least three different theories floating around and I see major flaws in all of them. Do you know of anyone in the EPA Tank universe who might be interested in trying to help us find an answer?

It was really nice being able to have you, Patrick, Raymond and Scott on the line with us and it will be great seeing this project regain a sense of direction moving forward.

From: Drouare, Douglas [mailto:drouare.douglas@epa.gov]

Sent: Monday, September 19, 2016 1:10 PM

To: Sac & Fox Truck Stop; <u>lisa.montgomery@sacfoxenviro.org</u>; <u>mark.junker@sacfoxenviro.org</u>

Cc: Bosch, Raymond; Hayes, Scott; Bustos, Patrick **Subject:** Follow Up to Discussion this Morning

After our phone call this morning we continued to discuss the situation at the truck stop and how we could have a beneficial influence. We were wondering if it would be helpful for us to become a participant in the conversations between the parties involved. Perhaps if we participated in your next conference call, or if you scheduled a conference call that we could participate in, the mere weight of our presence may move parties to quicker action. We would not want to be the "lead" entity in the conversation or the sole reason for having the conversation. We would think that you would be the lead and we would be present to listen and comment where appropriate. Perhaps if the mere weight of our presence does not work select comments may. We would think that such a conversation would at least include you, your consultant, the tank manufacturer and your insurance company. What are your thoughts?

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

Drouare, Douglas

From:

Barolo, Mark

Sent:

Friday, September 23, 2016 7:18 AM

To:

Drouare, Douglas; Rosado-Chaparro, Wilfredo

Cc:

Hoskinson, Carolyn

Subject:

RE: Insurance Guide

Categories:

EZ Record - Shared

Hi Doug,

I felt like the more we talked about it the more we thought it would be unlikely that Containment Solutions would engage casually on the case, given the possibility of litigation. That said, here is the contact information we have. If you ever feel the time is right to call Ron, feel free.

Thanks, Mark

Containment Solutions Ron Shaffer rshaffer@csiproducts.com 936/756-7731

From: Drouare, Douglas

Sent: Thursday, September 22, 2016 2:01 PM

To: Rosado-Chaparro, Wilfredo <Rosado-Chaparro.Wilfredo@epa.gov>; Barolo, Mark <Barolo.Mark@epa.gov>

Cc: Hoskinson, Carolyn < Hoskinson. Carolyn@epa.gov>

Subject: RE: Insurance Guide

Just a quick follow up question...

Did I hear someone was or was not going to reach out to Containment Solutions?

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: Rosado-Chaparro, Wilfredo

Sent: Thursday, September 22, 2016 12:46 PM

To: Barolo, Mark <Barolo.Mark@epa.gov>; Drouare, Douglas <drouare.douglas@epa.gov>

Cc: Hoskinson, Carolyn < Hoskinson. Carolyn@epa.gov>

Subject: RE: Insurance Guide

Thanks Mark!

Wilfredo Rosado-Chaparro, aka Wilo Chief of the Enforcement, Inspection, & Compliance Section (EICS) Chemical and Oil Release Prevention Branch (CORP), AWMD U.S. E.P.A., Region 7
11201 Renner Boulevard
Lenexa, KS 66219
Tel. 913-551-7944, Cel. 816-225-3089, Fax. 913-551-9944
rosado-chaparro.wilfredo@epa.gov

"La razón no grita, la razón convence." Luis A. Ferré

The information in this email and in any of its attachments is confidential and may be privileged. If you are not the intended recipient, please destroy this message, delete any copies held on your systems and notify the sender immediately. You should not retain, copy or use this email for any purpose, nor disclose all or any part of its content to any other person.

La información contenida en este mensaje electrónico y cualquiera de sus anexo es confidencial y puede ser privilegiada. Si usted no es el destinatario, por favor destruya este mensaje, borre cualquier copia que pueda existir en su sistema y avise inmediatamente al remitente. No deberá retener, copiar o utilizar este mensaje para ningún otro propósito, ni divulgar su contenido total o parcialmente a cualquier otra persona o entidad.

From: Barolo, Mark

Sent: Thursday, September 22, 2016 12:44 PM

To: Rosado-Chaparro, Wilfredo < Rosado-Chaparro. Wilfredo @epa.gov >; Drouare, Douglas < drouare.douglas@epa.gov >

Cc: Hoskinson, Carolyn < Hoskinson. Carolyn@epa.gov>

Subject: Insurance Guide

FYI - here is the link to the insurance guide for UST owners we mentioned. Jill Hall spearheaded this issue for ASTSWMO.

Feel free to share with others if you think it could be helpful.

Mark

http://astswmo.org/files/policies/Tanks/2011.10 Guide to Tank Insurance FINAL.pdf

Sent from my iPhone

CERTIFIED MAIL RETURN RECEIPT REQUESTED

Article Number: #######

Mr. Edmore Green, Chairperson Sac & Fox Nation 305 North Main Street Reserve, Kansas 66434

RE: RESPONSE REQUIRED

LEAKING UNDERGROUND STORAGE TANK SITE

SAC & FOX TRUCK STOP 1346 US HIGHWAY 75

POWHATTAN, KANSAS 66527

 
Dear Chairperson Green:

The Sac & Fox Nation is the responsible party of record for the leaking underground storage tank site noted above. We are now approaching a year since the release was reported to our office. Limited information regarding the responsible party's actions to address the release of petroleum has been provide to us. Given the age of this release, the information provided is inadequate and our attempts to gather the necessary information from current responsible party contacts have proven unsuccessful. In addition, reported plans for further action are inadequate.

Under 40 CFR, Part 280.64 you are required to recover free product to the maximum extent practicable. Under 40 CFR, parts 280.65 you are required to determine the full extent and location of contamination. You are required to provide us the following with 30 calendar days of receipt of this letter:

<u>Free Product Recovery Report/Work Plan</u> – A complete accounting of the type of product lost, volume of product lost, product recovered, dates of product recovered, method of recovery, method of storage/disposal, plans and schedule for future free product recovery efforts, reporting schedule and all other requirements under 40 CFR, Part 280.64.

<u>Site Investigation Work Plan</u> – A technical work plan describing the proposed scope of work for investigating the full extent of contaminants released to the environment, in all lateral directions from the point of release, to its full depth, for all potentially impacted media (soil, groundwater, surface water, air, etc. – as applicable to site specific conditions) and all other requirements under 40 CFR, Part 280.65. The scope of proposed work described in previous communications by the responsible party is deemed inadequate.



Failure to adequately respond will result in the consideration of this situation for enforcement action. If you have any questions, please contact us.

Sincerely,


Scott D. Hayes, Branch Chief Chemical & Oil Release Prevention (913) 551-7670 hayes.scott@epa.gov Douglas E. Drouare, CPG
Chemical & Oil Release Prevention
(913) 551-7299
drouare.dougla@epa.gov


pc:

Tanks Section Chief, Kansas Department of Health and Environment

Ms. Lisa Montgomery, Sac & Fox Nation Mr. Mark Junker, Sac & Fox Nation

Ms. Theresa Armbruster, Sac & Fox Truck Stop

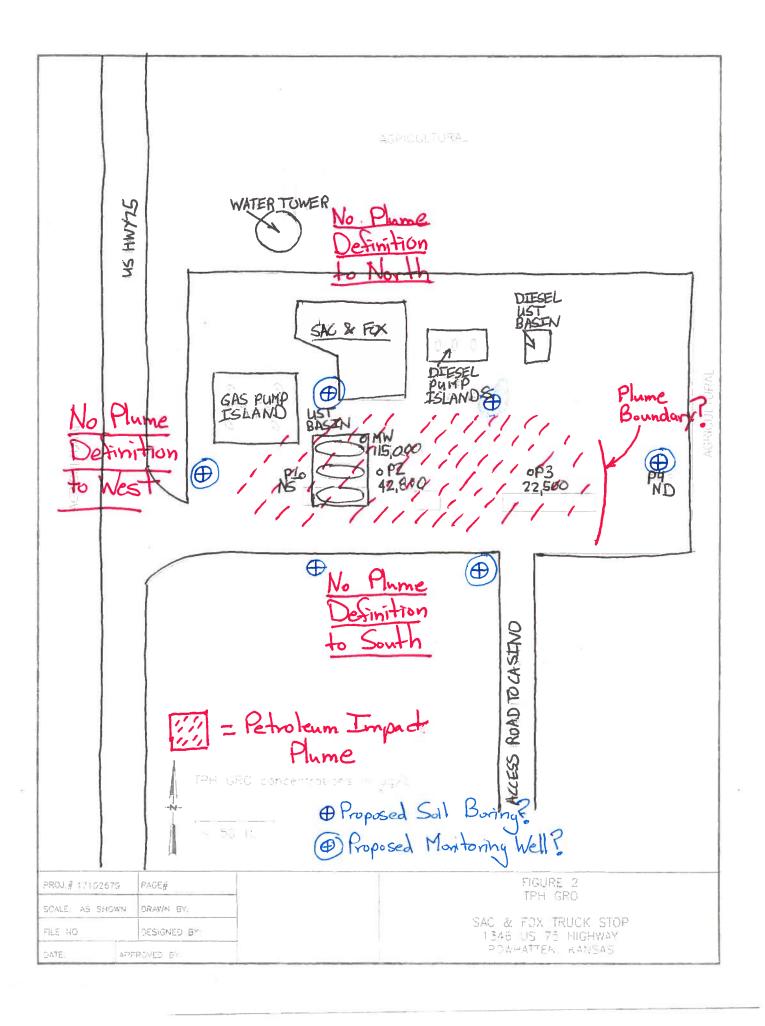

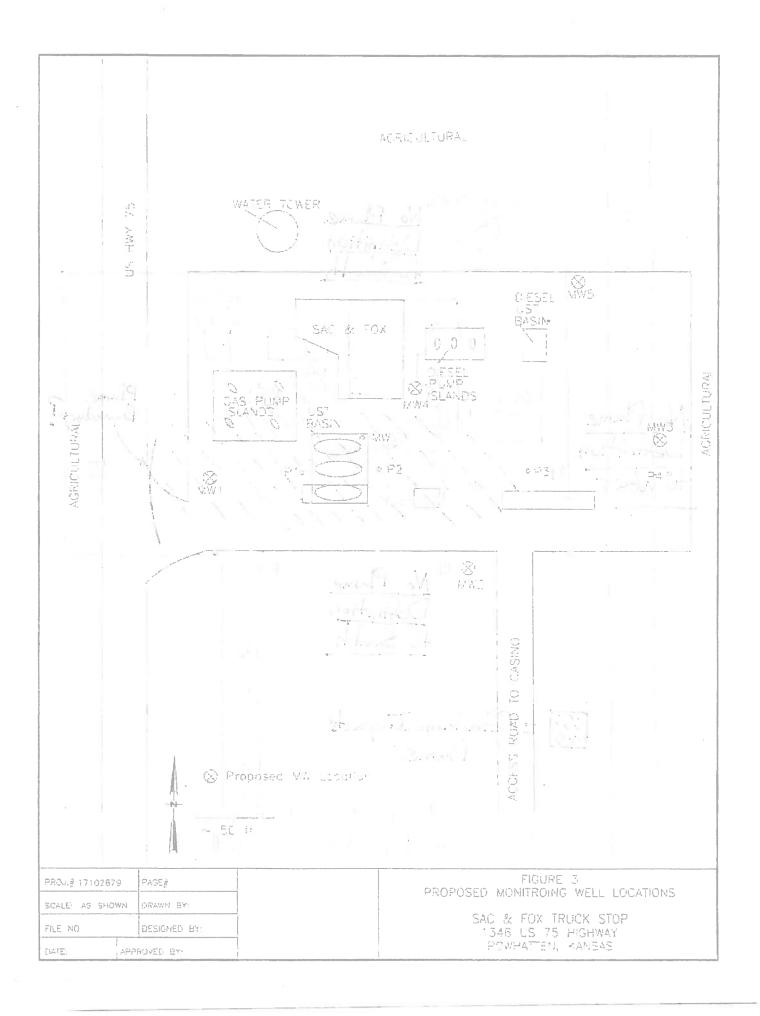


∞ SITE DRAWING ∞

Date: 26 September 2013 Time on Site: 12:00pm Time off Site: 2:24pm

Weather: Sunny

ENVIRONMENTALLY SENSITIVE AREA: Yes No

If "Yes" please describe:

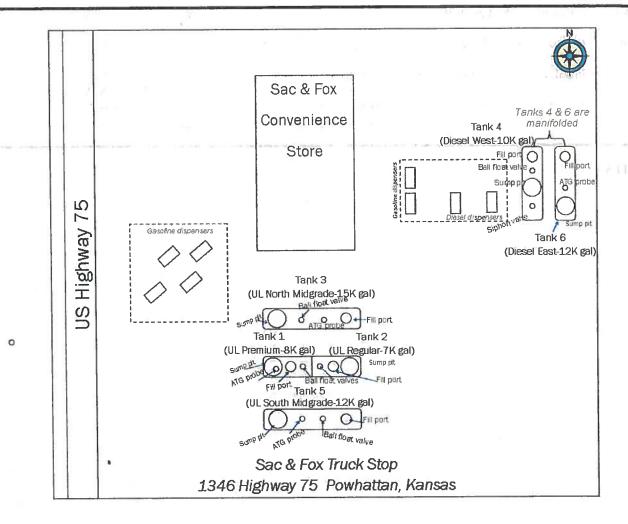

CP Testing: YES NO Sacrificial Impressed

Location of tank contact:

half cell:

Measured Vlt at Tank:

Pipe:

Pictures (see attached) Yes No

AND MARKS BY

0.00

JL I N

Drouare, Douglas

From:

Hayes, Scott

Sent:

Monday, July 11, 2016 1:26 PM

To:

Bustos, Patrick

Cc: Subject: Drouare, Douglas; Bosch, Raymond FW: Sac & Fox Truck Stop LUST

Attachments:

Draft Sac & Fox Reg Letter 07_11_2016.doc

Patrick,

We are have some problems getting the Sac & Fox to be responsive regarding investigation and cleanup of a release they had last year. Attached is a letter we would like to send. Let me know if you have any suggestions.

From: Drouare, Douglas

Sent: Monday, July 11, 2016 10:04 AM

To: Hayes, Scott < Hayes. Scott@epa.gov>; Bosch, Raymond < Bosch. Raymond@epa.gov>

Subject: Sac & Fox Truck Stop LUST

My recommendation for a next step. See attached. Let me know if I should start this down the concurrence path and any other thoughts you have.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

Drouare, Douglas

From:

Sac & Fox Truck Stop <sacfoxtsmgr@jbntelco.com>

Sent:

Friday, June 24, 2016 5:30 PM

To:

Drouare, Douglas; egreen@sacandfoxcasino.com; lisamontgomery@sacfoxenviro.org;

mark.junker@sacfoxenviro.org

Subject: Attachments: RE: Truck Stop Reports 201606241714.pdf

Categories:

EZ Record - Shared. Record Saved - Shared

Doug,

I apologize that you are not satisfied with the timely manner in which you are receiving information. When you were seeking information from other parties involved I assumed you were getting the information you wanted. When Robert Trump responded

I assumed you got information you were after. Then you requested a conference call which we were all more than happy to do so that we could all be on the same page, you then were not available for the scheduled call time. Then you sent a 300 page report as a reference of what you were wanting on a spill that was 20 years ongoing which I could never convert and did get from Mark Junker. I have called and left you several messages but am unaware of any call backs. As Mark Junker stated in the email accompanying the report and findings, due to capabilities of computers I had been unable to send you all of this information. For this I am apologetic. I have no problem with sharing information, I believe we are trying to do everything to the best of our ability to resolve this unfortunate situation and we have nothing to hide. Currently we are not recovering any free product at the advise of Robert Trump, hired to help guide us thru this situation properly. As stated on the February 29, 2016 bullet, While tank site is open we would be prepared to deal with free product and define plume. Tank site will be exposed on July 11, 2016 Robert Trump will be on site to handle the situation. Once analysis is received from the data gathered it will be determined from supportive documentation if more than two wells are needed. Geologist findings showed that spill was contained within Truck Stop property and that there is nothing that has adverse effect on health or environment. Which is why we have waited for insurance approval to move forward. Had geologist found tremendous amounts of contamination that determined urgent, then the situation may have been handled differently. After July 11, 2016 data is received we will start to finalize the remediation process. On July 20, 2015 A.M. tank reading reported 5882 gallons of fuel, 2185 gallons of fuel had been sold by the time the pumps were shut down leaving 3697 gallons of fuel unaccounted for, 2357 gallons were recovered in the frac tank (July 24, 2015 bullet), Ethan recovers 442 gallons (August 27, 2015 bullet) Josh recovers 150 gallons (August 28, 2016 bullet).

August 28, 2016 stating 746 gallons. The only work plan I have at this time was part of attachment 8 sent with report on June 22, 2016. I have attached it in case you did not get all of it.

Total of 2949 gallons recovered of 3697 gallons leaving 748 gallons unaccounted for. Will need to correct bullet dated

The fact that you are unsatisfied with the time schedule of dealing with this situation is unfortunate. I am dependant upon a lot of other peoples advise and professionalism to determine how to properly deal with this situation. It has been made very clear that we need to do what is necessary to resolve this unfortunate circumstance cost effectively. Now that you have the bulk of the information, keeping you up to date should be much easier. If this information is still not adequate please let me know.

Sincerely,

Theresa Armbruster
Manager, Sac and Fox Truck Stop

From: Drouare, Douglas [mailto:drouare.douglas@epa.gov]

Sent: Friday, June 24, 2016 11:19 AM

To: mark.junker@sacfoxenviro.org; Sac & Fox Truck Stop; lisa.montgomery@sacfoxenviro.org

Cc: Hayes, Scott

Subject: RE: Truck Stop Reports

Good morning Mark,

The January 22, 2016 Site Investigation Report is the type of technical report we were and are expecting for this project. It was helpful in describing the current status of the project. We are wondering why it took five months to get to us.

Considering this release is near to being a year old, we consider progress toward fully evaluating the extent and degree of impact to be behind schedule. Further efforts and communications are going to need to be completed in a more timely manner.

We have the following questions...

What is being done to recover free product?

How much free product has been recovered to date?

How does this compare to the volume of fuel released?

Where is the work plan/proposal for investigation services that will be necessary to fully evaluate the degree and extent of the contaminant plume? We are skeptical that two wells will be adequate to do this as indicated in the attached notes. Perhaps the work plan/proposal is one of the documents that could not be sent by e-mail??? If so, please mail it to us ASAP so that we can review and comment.

As previously stated, we consider this project to be behind schedule. Future efforts and communications are going to need to be completed in a more timely manner.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: M.Junker [mailto:mark.junker@sacfoxenviro.org]

Sent: Wednesday, June 22, 2016 12:07 PM

To: Drouare, Douglas <drouare.douglas@epa.gov>

Cc: Edmore Green <egreen@sacandfoxcasino.com>; Robert L. Trump <rtrump@totalpetroleumservices.com>; 'Sac &

Fox Truck Stop' <sacfoxtsmgr@jbntelco.com>

Subject: Truck Stop Reports

Good afternoon Doug,

Due to the capabilities of the computers in my office I am forwarding to you the report that Theresa Armbruster created to reflect the most current information we have on our tank situation as well as time line reflecting the activity undertaken to characterize and remediate the site.

There are the three attachments included. The first is her report which sites nine different attachments. Due to formatting issues only one is included. It is the one labeled attachment 9. The second attachment include items 1-8. The 3rd attachment contains the bulk of the site characterization.

The documentation represents the most thorough compilation of all data we capable of providing at this time.

You are more than welcome to come visit us at the Truck Stop on July 11, 2016 when we will begin excavating the tank and formulating some plans for completing the data gathering process and remediation.

Mark Junker

Tribal Response Coordinator Sac & Fox Nation Of Missouri in Kansas and Nebraska (785) 742-4706



11904 Grandview Road Grandview, Missouri 64030
Telephone: 913 894-4000 www.terranext.net

February 16, 2016

Mr. Robert Trump Total Petroleum Services 16601 W. 132nd Circle Olathe, Kansas 66062

RE: Conceptual Site Model (CSM) / Soil Vapor Screening & Modeling / Monitoring Well Installation / Groundwater Sampling Costs Sac & Fox Truck Stop 1346 US 75 Highway Powhatten, Kansas

Dear Mr. Trump:

Terranext is pleased to provide costs to install 5 permanent monitoring wells, collect groundwater samples, complete an initial conceptual site model (CSM), screen and model groundwater data to determine soil vapor inhalation risk at the Sac & Fox Truck Stop site in Powhatten, Kansas

Objectives

The objective of the installation of 5 monitoring wells and associated groundwater sampling is to delineate groundwater impacts at the site and to determine the magnitude of the impacts. The objective of the CSM is to provide a description of relevant site features and the surface and subsurface conditions to understand potential migration pathways and potential receptors of chemicals of concern (COC) and the risk they pose to receptors. The objective of the groundwater screening and modeling is to determine if there is a soil vapor inhalation risk to receptors at the site.

Monitoring Well Installation and Groundwater Sampling

Terranext and drilling subcontractor RAZEK Environmental will install 5 monitoring wells whose proposed locations are shown in Figure 1. The wells will be completed in accordance to the Kansas Department of Health and Environment (KDHE) standards and based on the initial site investigation should determine the extent and magnitude of the impacted groundwater due to the failed underground storage tank (UST). Terranext will field screen the soil to determine the extent of impact but, unless requested, will not collect soil samples for laboratory analysis to determine the magnitude of any impact as contamination migration is primarily through groundwater and not the soil. Terranext will utilize KDHE's Tier 2 non-residential risk-based screening values when comparing groundwater impacts to cleanup criteria and to determine any necessary action, Additional welfs may be necessary if, in the field, the perimeter monitoring well locations show impacts by field screening and observation as the perimeter monitoring wells cannot be impacted if one is delineate the extent of impact. The monitoring wells also be able to be used for future groundwater monitoring

South of the southout of the south of the south of the south of the south of the so

Mr. Robert Trump Total Petroleum Services February 16, 2016 Page 2

Conceptual Site Model (CSM)

Terranext will prepare an initial conceptual site model. The CSM will represent the site and area of concern, contaminant sources, the environmental media that have been impacted, and the processes that determine transport of contaminants to potential receptors. The CSM will include, but not be limited to:

- · Site characteristics
- · Potential receptors
- Potential exposure pathways
- Land use survey
- Water well survey
- Exposure risks

The conceptual site model is an iterative tool that should be developed and refined as information is obtained throughout the site investigation and any remediation activities.

Soil Vapor Screening & Modeling

Terranext will use groundwater data and site characteristic information to screen and model soil vapor risk due to COCs utilizing the EPA on-line Johnson & Ettinger (J&E) calculator and EPA's Risk-Based Screening Generic Table for Commercial Air. Terranext will use the standard cancer risk value of 1E-06 and a hazard quotient value of 1 to determine risk and any necessary action.

Terranext appreciates the opportunity to work with TPS on this project and if you have any questions or require additional information, please call me at (913) 894-4000.

Sincerely,

TERRANEXT, LLC

Christopher Kinn, PG

Director Midwest Operations

C215-

Drouare, Douglas

From:

Drouare, Douglas

Sent:

Friday, July 08, 2016 8:35 AM

To:

'Sac & Fox Truck Stop'; 'M.Junker'; lisa.montgomery@sacfoxenviro.org

Cc:

Wilfredo Rosado-Chaparro; Pomes, Michael; Hayes, Scott

Subject:

RE: Truck Stop Reports

Thank you for the update. I am forwarding your message to those at our agency whose focus is on the UST systems (Wilfredo & Michael). My focus is on the release of petroleum that has occurred and the investigation and corrective action that must follow. We are in the process of drafting a formal response to your latest electronic mail.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

Francisco & Fau Trus

From: Sac & Fox Truck Stop [mailto:sacfoxtsmgr@jbntelco.com]

Sent: Thursday, July 07, 2016 5:34 PM

To: Drouare, Douglas <drouare.douglas@epa.gov>

Subject: RE: Truck Stop Reports

Doug,

Just a reminder Sac and Fox Truck Stop ruptured tank excavation will begin Monday July 11, 2016.

Thank You,

Theresa Armbruster
Manager, Sac and Fox Truck Stop

From: Drouare, Douglas [mailto:drouare.douglas@epa.gov]

Sent: Friday, June 24, 2016 11:19 AM

To: mark.junker@sacfoxenviro.org; Sac & Fox Truck Stop; lisa.montgomery@sacfoxenviro.org

Cc: Hayes, Scott

Subject: RE: Truck Stop Reports

Good morning Mark,

The January 22, 2016 Site Investigation Report is the type of technical report we were and are expecting for this project. It was helpful in describing the current status of the project. We are wondering why it took five months to get to us.

Considering this release is near to being a year old, we consider progress toward fully evaluating the extent and degree of impact to be behind schedule. Further efforts and communications are going to need to be completed in a more timely manner.

We have the following questions...

What is being done to recover free product?

How much free product has been recovered to date?

How does this compare to the volume of fuel released?

Where is the work plan/proposal for investigation services that will be necessary to fully evaluate the degree and extent of the contaminant plume? We are skeptical that two wells will be adequate to do this as indicated in the attached notes. Perhaps the work plan/proposal is one of the documents that could not be sent by e-mail??? If so, please mail it to us ASAP so that we can review and comment.

As previously stated, we consider this project to be behind schedule. Future efforts and communications are going to need to be completed in a more timely manner.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: M.Junker [mailto:mark.junker@sacfoxenviro.org]

Sent: Wednesday, June 22, 2016 12:07 PM

To: Drouare, Douglas <drouare.douglas@epa.gov>

Cc: Edmore Green <egreen@sacandfoxcasino.com>; Robert L. Trump <rtrump@totalpetroleumservices.com>; 'Sac &

Fox Truck Stop' <sacfoxtsmgr@jbntelco.com>

Subject: Truck Stop Reports

Good afternoon Doug,

Due to the capabilities of the computers in my office I am forwarding to you the report that Theresa Armbruster created to reflect the most current information we have on our tank situation as well as time line reflecting the activity undertaken to characterize and remediate the site.

There are the three attachments included. The first is her report which sites nine different attachments. Due to formatting issues only one is included. It is the one labeled attachment 9. The second attachment include items 1-8. The 3rd attachment contains the bulk of the site characterization.

The documentation represents the most thorough compilation of all data we capable of providing at this time.

You are more than welcome to come visit us at the Truck Stop on July 11, 2016 when we will begin excavating the tank and formulating some plans for completing the data gathering process and remediation.

Mark Junker

Tribal Response Coordinator Sac & Fox Nation Of Missouri in Kansas and Nebraska (785) 742-4706

Drouare, Douglas

From:

Sac & Fox Truck Stop <sacfoxtsmgr@jbntelco.com>

Sent:

Thursday, July 07, 2016 5:34 PM

To: Subject:

Drouare, Douglas RE: Truck Stop Reports

Doug,

Just a reminder Sac and Fox Truck Stop ruptured tank excavation will begin Monday July 11, 2016.

Thank You.

Theresa Armbruster
Manager, Sac and Fox Truck Stop

From: Drouare, Douglas [mailto:drouare.douglas@epa.gov]

Sent: Friday, June 24, 2016 11:19 AM

To: mark.junker@sacfoxenviro.org; Sac & Fox Truck Stop; lisa.montgomery@sacfoxenviro.org

Cc: Hayes, Scott

Subject: RE: Truck Stop Reports

Good morning Mark,

The January 22, 2016 Site Investigation Report is the type of technical report we were and are expecting for this project. It was helpful in describing the current status of the project. We are wondering why it took five months to get to us.

Considering this release is near to being a year old, we consider progress toward fully evaluating the extent and degree of impact to be behind schedule. Further efforts and communications are going to need to be completed in a more timely manner.

We have the following questions...

What is being done to recover free product?

How much free product has been recovered to date?

How does this compare to the volume of fuel released?

Where is the work plan/proposal for investigation services that will be necessary to fully evaluate the degree and extent of the contaminant plume? We are skeptical that two wells will be adequate to do this as indicated in the attached notes. Perhaps the work plan/proposal is one of the documents that could not be sent by e-mail??? If so, please mail it to us ASAP so that we can review and comment.

As previously stated, we consider this project to be behind schedule. Future efforts and communications are going to need to be completed in a more timely manner.

Douglas E. Drouare, CPG USEPA, Region 7, AWMD - STOP 11201 Renner Boulevard Lenexa, Kansas 66219 (913) 551-7299 drouare.douglas@epa.gov

From: M.Junker [mailto:mark.junker@sacfoxenviro.org]

Sent: Wednesday, June 22, 2016 12:07 PM

To: Drouare, Douglas <drouare.douglas@epa.gov>

Cc: Edmore Green <egreen@sacandfoxcasino.com>; Robert L. Trump <rtrump@totalpetroleumservices.com>; 'Sac &

Fox Truck Stop' <sacfoxtsmgr@jbntelco.com>

Subject: Truck Stop Reports

Good afternoon Doug,

Due to the capabilities of the computers in my office I am forwarding to you the report that Theresa Armbruster created to reflect the most current information we have on our tank situation as well as time line reflecting the activity undertaken to characterize and remediate the site.

There are the three attachments included. The first is her report which sites nine different attachments. Due to formatting issues only one is included. It is the one labeled attachment 9. The second attachment include items 1-8. The 3rd attachment contains the bulk of the site characterization.

The documentation represents the most thorough compilation of all data we capable of providing at this time.

You are more than welcome to come visit us at the Truck Stop on July 11, 2016 when we will begin excavating the tank and formulating some plans for completing the data gathering process and remediation.

Mark Junker

Tribal Response Coordinator Sac & Fox Nation Of Missouri in Kansas and Nebraska (785) 742-4706

Drouare, Douglas

From:

M.Junker <mark.junker@sacfoxenviro.org>

Sent:

Wednesday, June 22, 2016 12:07 PM

To:

Drouare, Douglas

Cc:

Edmore Green; Robert L. Trump; 'Sac & Fox Truck Stop'

Subject: Truck Stop Reports

Attachments:

removed.txt; TankReport Jun22 2016.docx; TankReportAttachments Jun22 2016.pdf;

Complete 2015 Site Investigation Report.pdf

Good afternoon Doug,

Due to the capabilities of the computers in my office I am forwarding to you the report that Theresa Armbruster created to reflect the most current information we have on our tank situation as well as time line reflecting the activity undertaken to characterize and remediate the site.

There are the three attachments included. The first is her report which sites nine different attachments. Due to formatting issues only one is included. It is the one labeled attachment 9. The second attachment include items 1-8. The 3rd attachment contains the bulk of the site characterization.

The documentation represents the most thorough compilation of all data we capable of providing at this time.

You are more than welcome to come visit us at the Truck Stop on July 11, 2016 when we will begin excavating the tank and formulating some plans for completing the data gathering process and remediation.

Mark Tunker

Tribal Response Coordinator Sac & Fox Nation Of Missouri in Kansas and Nebraska (785) 742-4706

Douglas E Drouare, CPG USEPA, Region 7 11201 Renner Boulevard Lenexa, Kansas 66219 August 20, 2015 Revised June 22, 2016

RE: Leaking Underground Storage Tank Sac & Fox Truck Stop 1346 US Hwy 75 Powhattan, Kansas 66527

Dear Mr. Drouare,

Sac and Fox Truck Stop was built in 1998 by M.A.C. Corporation, Independence MO. Robert Andrew who is still currently with M.A.C. was involved at the time of construction. Four fuel tanks were installed at that time. Documentation (Attachment 1) show that the tanks were XERXES double wall tanks with a 30 Year warranty.

Here is a timeline of events and actions taken regarding the ruptured fuel tank at Sac and Fox Truck Stop. (Attachment 2) is a diagram of the Truck Stop and where tanks set on the property for reference.

- July 20, 2015 Phone call from staff stating tank alarm was going off at approximately 9:30 p.m. Amanda responded by having them check fuel levels and the north tank was below alarm level and needed fuel to siphon from the South tank. A few minutes later staff calls back and says alarm is still going off, Amanda then has them check water levels. At this time we now have a vehicle in the parking lot that will not stay running. Immediately all pumps are shut off at approximately 9:35p.m. Any car fueling with midgrade fuel during that 5 minute period would not run. Police, fire, emergency management and all other personnel needed responded. Parking lot was evacuated for everyone's safety until we could assess the situation. We knew water was coming from somewhere but had no idea where from. On site personnel spent about an hour trying to determine water source. Our tank monitoring print out showed no water in the fuel at the beginning of the day.
- July 22, 2015 Robert Trump with Adler Tank Rentals, brought a Frac tank and pumped approximately 19,000 gallons of fuel and water into the Frac tank. At this time we could tell tank was ruptured and the probe was stuck in the ground from the pressure and that ground water was the responsible water source. At this time fuel needs to separate from water for 2-3 days to determine how much fuel was recovered. Then samples need to be sent for testing.
- July 24, 2015 Robert Trump with Adler returns to take samples of fuel and water for testing. We also determine that on July 20, 2015 Midgrade tank totals were

- 5,882.00 gallons, we sold 2185.11 gallons of midgrade fuel and that 2357.00 gallons of midgrade fuel was in the Frac tank, (Attachment 3) leaving 1339.89 gallons of midgrade fuel unaccounted for. Water and fuel samples are taken to Pace Analytical.
- July 27, 2015 Results of fuel and water samples come back from Pace Analytical. (Attachment 4)
- Fuel can be recovered but need to determine who will recover fuel from Frac tank and how to properly handle the contaminated water. Activated carbon vs. reclaim facility.
- July 27, 2015 Tankology Inc. comes to scope tanks and determine possible cause and damage. North midgrade tank is ruptured and south midgrade has a crack on top where vent pipe had been run over recently. South and north tanks are manifolded. Appears water pressure from excessive ground water caused pea gravel to erode, allowing tank to rupture.
- August 6, 2015 Estimates come from Robert Trump with Adler to determine procedure of disposing of contaminated water.
- August 11, 2015 Tribal Council approved to have midgrade fuel recovered from Frac tank by HAAG oil and to have contaminated water hauled to a reclaim facility.
- August 18, 2015 2000 gallons of fuel is recovered from frac tank and blended with 1250 gallons of premium fuel to make fuel the correct octane level. (Attachment 5)
- August 19, 2015 Adler hauls contaminated water to reclaiming facility (Attachment 6). Also delivers a 300 gallon bladder for the ongoing process of reclaiming fuel from ruptured tank. Waiting on estimate to purchase a diaphragm pump and a compressor.
- At this time we know that there is still fuel in the ground because we have stuck the tank. Our thought is that it is in overfill tanks and that we will recover most of the missing fuel.
- Ongoing, will now start to pump bi-weekly out of ground to recover any fuel
 missing. Will store in bladder, let fuel separate from water and keep track of all
 product recovered each time. This procedure could take up to 12 months or until
 we can no longer recover any more fuel. After a period of time when there is no
 more recovery of product we will need to have soil tested.
- At this time we are possibly considering properly abandoning the North ruptured tank which is no longer in use.

- August 27, 2015 Ethan with PEI capped off manifold to south tank so we could start operating north tank. Reclaimed 442 gallons of fuel. (tank reading) (Attachment 7)
- August 28, 2015 Josh with PEI flushed fuel lines and recovered 150 gallons of fuel. Remaining gallons of fuel unaccounted for now totaling 746 gallons.
- Estimate received 9-21-2015 from Total Petroleum Services for Consultant, Geologist and site characterization. Waiting for Tribal Councils approval to continue with clean up/compliance efforts and free product recovery.
- Ace North American Claims is insurance covering remediation only. Contact Brian Hong 866-635-5698.
- Sac and Fox Truck Stop has been operational since incident on 7-20-2015 excluding the use of the ruptured north midgrade tank.
- November 19, 2015 Geologist take analytical samples for testing and drill for 4 Temporary Piezometers. Robert Trump from Total Petroleum Services, Robert Andrew from M.A.C. Corporation who installed the tanks, Ethan Kappler with P.E.I. and Mark Junker with Tribal EPA were all here. Appears contamination is within the Truck Stop property. Ruptured tank video was viewed by all, video shows a rupture approximately one third of the way up on north side approximately 7-8 inches in diameter. I was to receive test results in 10-12 days.
- January 18, 2016 have not received any results from analytical testing or piezometers. Still no response from Robert Andrew on Xerxes warranty.
- February 16, 2016 Received Site Investigation Report of general soil characteristics of the subsurface and initial impacts to the soil and groundwater due to failing gasoline underground storage tank. Terranext also provided cost to install 5 permanent monitoring wells, collect groundwater samples, complete an initial conceptual site model (CSM), screen and model groundwater data to determine soil vapor inhalation risk at Sac and Fox Truckstop. (Attachment 8)
- February 29, 2016 Meeting onsite at Sac and Fox Truckstop to discuss next steps and overall plan to continue with finalization of remediation and repair or abandonment of ruptured fuel tank. In attendance were Randy Dolifka PEI, William Millard Crawford and Company, Robert Trump Total Petroleum Services, Chris Kinn Geologist, Robert Andrews MAC Corp., Lisa Montgomery Sac and Fox EPA, Gary Bahr Sac and Fox Tribal Council, Theresa Armbruster Sac and Fox Truck Stop Manager, Amanda Kramer Sac and Fox Asst. Manager and VIA phone Anita Ketola ACE Insurance. It was unanimous by all in

attendance that the only way to determine the cause of the ruptured fuel tank would be to investigate the site. After determining the cause, being impact or defect then the decision will be made to either repair the existing Xerses double wall tank with a 30 year warranty which was installed in 1998 and have it recertified or properly abandon the tank which would be the safest option and install a new tank in a new site. While the tank site is open we will be prepared to deal with free product, define plume and install wells. Initially 5 wells were suggested but was determined 2 would be sufficient. All work pending estimates and approval from Insurance Companies.

- March 21, 2016 Received estimate to repair ruptured fuel tank.
- April 20, 2016 Robert Trump Total Petroleum Services responds to Region 7.(Attachment 9)
- April 22, 2016 Insurance needing a breakdown of proposed estimate and an estimate for a replacement tank from M.A.C. Corp.
- May 11, 2016 Currently waiting for Estimates to install new tank if that
 determination is made immediately following the excavation of the northern area
 of the tank exposing the ruptured tank.
- May 17,2016 Received estimate from Randy Dolifka PEI for new tank not sure of status on estimate from Robe I Andrew MAC Corp.
- May 20, 2016 Received revised estimate from M.A.C. Corp.
- May 25, 2016 Tribal Council approved the excavation work proposed by M.A.C.
 Corp. Need to contact Robert Andrew to confirm a stall date.
- June 8, 2016 Robert Andrew, M.A.C. Corp. still trying to coordinate with XERXES.
- June 16, 2016 M.A.C. Corp has a start date July 11, 2016 need to confirm with all involved.
- June 20, 2016 Confirmed with M.A.C. Corp. Everyone would be available for July 11, 2016 start date.
- June 21, 2016 contacted Robert Trump about providing Region 7 with an acceptable form of reporting.

Sincerely,

Theresa Armbruster Manager, Sac and Fox Truck Stop

Attachments 1-8a are attached separately Attachment 8b is attached separately Attachment 9

Sac & Fox Truck Stop

From: Robert L. Trump [strump@totalpetroleumservices.com]

Sent: Wednesday, April 20, 2016 8:24 AM

To: Drouere, Obuglas, mark junker@sactoxanvko.org, Sac & Fox Truck Stop, L.Montgomery

Co: Randy Carlson, Scott O'Neal, mmcerian@kdheks.gov, Hayes, Sooti, Bosch, Raymond,

koorus tahyhighi@amec.com, cklim@terranest.net

Subject: RE: Leaking Underground Storage Tank Site - Sac & Fox Truck Stop

Good morning,

Robert Trump, Total Petroleum Services LLC responding. We were contracted to remove free product and contaminated waters from the LUST in question.

Since then we have performed exploratory work with temporary peizometers to accertain the geology of the subsurface and gain insight into the outer boundaries of contamination.

In March a meeting with Sac & Fox, Total Petroleum, Representatives from insuring parties, our contracted geologist Terranext, and the original installer MAC was held to form a concesus between the parties for the next steps.

At that time MAC put forward a work plan to excavate the Northern area of the tank so a representative from Xerxes, tank manufacturer, could make a determination regarding cause of breach and possible repair of tank.

Total Petroleum advanced a work plan to support the excavation activities with a Vac system to remove any additional free product and/or ground water during excavation, and inspection and/or repairs.

Total Petroleum/Terranext also advanced a work plan for soil vapor monitoring and installation of permanent monitoring wells for extended ground water sampling.

To date: Antea Group has approved Total Petroleums work plan on behalf of Ace-Chub insurers and we have received an approval letter from Chub this week.

We were contacted last Friday by AMEC Environmental who we learned has now been retained by Crawford Group to also review all plans to determine if they are reasonable. A conference call was held Monday between AMEC, Total Petroleum Services, and Terranext, to explain our work plan for remedial activities.

As of today, we have not received this approval from AMEC/Crawford to move forward.

We also do not know if MAC has submitted their work plan for tank inspection by excavation, flowable fill closure, or complete tank removal.

I will be out of the office until Friday. I am reachable by cell, text, or email to answer any questions you may have.

Sincerely,

5/6/2016

adding documention to back up information.

Douglas E Drouare, ČPG USEPA, Region 7 11201 Renner Boulevard Lenexa, Kansas 66219

August 20, 2015

RE: Leaking Underground Storage Tank Sac & Fox Truck Stop 1346 US Hwy 75 Powhattan, Kansas 66527

Dear Mr. Drouare,

Here is a timeline of events and actions taken regarding the ruptured fuel tank at Sac and Fox Truck Stop. Attachment number 1 is a diagram of the Truck Stop and where tanks set on the property for reference.

- July 20, 2015 Phone call from staff stating tank alarm was going off at approximately 9:30 p.m. Amanda responded by having them ck fuel levels and the North tank was below alarm level and needed fuel to siphon from the South tank. A few minutes later staff calls back and says alarm is still going off, Amanda then has them check water levels. At this time we now have a vehicle in the parking lot that will not stay running. Immediately all pumps are shut off at approximately 9:35p.m. Any car fueling with midgrade fuel during that 5 minute period would not run. Police, fire, emergency management and all other personnel needed responded. Parking lot was evacuated for everyones safety until we could assess the situation. We knew water was coming from somewhere but had no idea where from. Spent lots of time trying to determine water source. Our tank monitoring print out showed no water in the fuel at the beginning of the day.
- July 22, 2015 Robert Trump with Adler Tank Rentals, brought a Frac tank and pumped approximately 19,000 gallons of fuel and water into the Frac tank. At this time we could tell tank was ruptured and the probe was stuck in the ground from the pressure and that ground water was the responsible water source. At this time fuel needs to separate from water for 2-3 days to determine how much fuel was recovered. Then samples need to be sent for testing.
- July 24, 2015 Robert Trump with Adler returns to take samples of fuel and water for testing. We also determine that on July 20, 2015 Midgrade tank totals were 5,882.00 gallons, we sold 2185.11 gallons of midgrade fuel and that 2357.00 gallons of midgrade fuel was in the Frac tank, leaving 1339.89 gallons of midgrade fuel unaccounted for. Water and fuel samples are taken to Pace Analytical.
- July 27, 2015 Results of fuel and water samples come back from Pace Analytical.

- Fuel can be recovered but need to determine who will recover fuel from Frac tank and how to properly handle the contaminated water. Activated carbon vs. reclaim facility.
- July 27, 2015 Tankology Inc. comes to scope tanks and determine possible cause and damage. See attached diagram labeled 2. North midgrade tank is ruptured and south midgrade has a crack on top where vent pipe had been run over recently. South and north tanks are manifolded. Appears water pressure from excessive ground water caused pea gravel to erode, allowing tank to rupture.
- August 6, 2015 Estimates come from Robert Trump with Adler to determine procedure of disposing of contaminated water.
- August 11, 2015 Tribal Council approved to have midgrade fuel recovered from Frac tank by HAAG oil and to have contaminated water hauled to a reclaim facility.
- August 18, 2015 2000 gallons of fuel is recovered from Frac tank and blended with 1250 gallons of premium fuel to make fuel the correct octane level.
- August 19, 2015 Adler hauls contaminated water to reclaiming facility. Also delivers a 300 gallon bladder for the ongoing process of reclaiming fuel from ruptured tank. Waiting on estimate to purchase a diaphragm pump and a compressor.
- At this time we know that there is still fuel in the ground because we have stuck the tank. Our thought is that it is in overfill tanks and that we will recover most of the missing fuel.
- Ongoing, will now start to pump bi-weekly out of ground to recover any fuel
 missing. Will store in bladder, let fuel separate from water and keep track of all
 product recovered each time. This procedure could take up to 12 months or until
 we can no longer recover any more fuel. After a period of time when there is no
 more recovery of product we will need to have soil tested.
- At this time we are possibly considering properly abandoning the North ruptured tank which is no longer in use.

Sincerely,

Theresa Armbruster
Sac and Fox Truck Stop Manager

		ž.	

Continuation

- August 27, 2015 Ethan with PEI capped off manifold to south tank so we could start operating north tank. Reclaimed 443 gallons of fuel. (tank reading)
- August 28, 2015 Josh with PEI flushed fuel lines and recovered 150 gallons of fuel. Remaining gallons of fuel unaccounted for now totaling 746 gallons.
- Estimate received 9-21-2015 from Total Petroleum Services for Consultant, Geologist and site characterization. Waiting for Tribal Councils approval to continue with clean up/compliance efforts and free product recovery.
- Ace North American Claims is insurance covering remediation only. Contact Brian Hong 866-635-5698.
- Sac and Fox Truck Stop has been operational since incident on 7-20-2015 excluding the use of the ruptured North midgrade tank.
- November 19, 2015 Geologist take analytical samples for testing and drill for 4 Temporary Piezometers. Robert Trump from Total Petroleum Services, Robert Andrew from M.A.C. Corporation who installed the tanks, Ethan Kappler with P.E.I. and Mark Junker with Tribal EPA were all here. Appears contamination is within the Truck Stop property. Ruptured tank video was viewed by all, video shows a rupture approximately one third of the way up on east side approximately 7-8 inches in diameter. I was to receive test results in 10-12 days.
- January 18, 2016 have not received any results from analytical testing or piezometers. Still no response from Robert Andrew on Xerxes warranty.

Updated 5-15-2016


- February 16, 2016 Received Site Investigation Report of general soil characteristics of the subsurface and initial impacts to the soil and groundwater due to failing gasoline underground storage tank. Terranext also provided cost to install 5 permanent monitoring wells, collect groundwater samples, complete an initial conceptual site model (CSM), screen and model groundwater data to determine soil vapor inhalation risk at Sac and Fox Truckstop.
- February 29, 2016 Meeting onsite at Sac and Fox Truckstop to discuss next steps and overall plan to continue with finalization of remediation and repair or abandonment of ruptured fuel tank. In attendance were Randy Dolifka PEI, William Millard Crawford and Company, Robert Trump Total Petroleum Services, Chris Kinn Geologist, Robert Andrews MAC Corp., Lisa Montgomery Sac and Fox EPA, Gary Bahr Sac and Fox Tribal Council, Theresa Armbruster

			ž.	٠

Sac and Fox Truck Stop Manager, Amanda Kramer Sac and Fox Asst. Manager and VIA phone Anita Ketola ACE Insurance. It was unanimous by all in attendance that the only way to determine the cause of the ruptured fuel tank would be to investigate the site. After determining the cause, being impact or defect then the decision will be made to either repair the existing Xerses double wall tank with a 30 year warranty which was installed and have it recertified or properly abandone the tank which would be the safest option and install a new tank in a new site. While the tank site is open we will be prepared to deal with free product, define plume and install wells. Initially 5 wells were suggested but was determined 2 would be sufficient. All work pending estimates and approval from Insurance Companies.

- May 11, 2016 Currently waiting for Estimates to install new tank if that determination is made immediately following the excavation of the northern area of the tank exposing the ruptured tank.
- May 17, 2016 Received estimate from Randy Dolifka PEI for new tank not sure of status on estimate from Robert Andrew MAC Corp.

4	* *	

 

Total Petroleum Services LLC

January 21, 2016

Ms. Theresa Armbruster Sac & Fox Truck Stop 1346 US 75 Highway Powhatten, KS

Dear Ms. Armbruster:

Per our conversation this week I have attached the invoice for work performed, the cost estimate for this invoice, and a complete Site Investigation Report prepared by our Geologist Mr. Christopher Kinn of Terra Next.

It is the opinion of Terra Next and Total Petroleum Services LLC that the level of contaminates above KDHE risk based levels do pose a risk and the source of the contamination, the tank, should be removed from the ground and any subsequent contaminated soil from within and surrounding the tank pit.

We recommend installing 5 ground water monitoring wells for the specific purpose of monitoring natural attenuation of contaminates remaining on this site.

It is recommended that sampling and analysis of the well which supplies water to the Tower adjacent to and North of the site be completed as a precautionary measure.

 
It is recommended that the original tank installer, MAC Corporation, be contacted and request a proposal to remove the tank in question along with any contaminated soils. Due to the close proximity of the tank in question to additional UST(s) it is recommended MAC Corporation bring in an expert in shoring to prevent any movement of existing UST(s) during excavation and back fill.

Total Petroleum Service LLC and its Geological firm will be on site during the tank removal and provide sampling of soils within the tank pit per KDHE recommended practice.

We are in the process of putting together our proposal to provide the necessary services as outlined above excluding the actual tank removal and soil disposal to be provided by MAC Corporation or others as Sac & Fox sees fit.

Thank you for your business and we look forward to working with you to complete this project.

Robert L. Trump - President



Invoice

	Jiatric, ICS 0000	Date	Invoice #		
Phone #	Fax#	1/21/201	1466		
913-461-5985	913-948-9532	www.totalpetroleumservices.co	m rtrump@to	otalpetroleumservices.com	
Bill To			Ship To		
Sac & Fox Theresa Armbruster 1346 US 75 Powhattan, KS 66527			Sac & Fox Theresa Armbrus 1346 US 75 Powhattan, KS 6		
			P.O. No.	Terms	Project
		r	heresa Λ.	Due on receipt	15110

Quantity	Description	Rate	Amount
1	Site Characterization per Cost Estimate dated 9/18/2015 attached	6,605.00	6,605.00
	The second secon		661 ct 9
	The state of the second of the	of the dwell brain? A	in telephone
	promption of a promption of the construction o	pergerman di mangga persanan di mangga	17.1 W/ 25.10
	1-15-16 St. av. 21 and a semigraph of the first of the copie of interest of the copie of the copie.	ant and horse on the second and and	
	and the second of the second o	and the left find to see the left of the l	pattern 1 morphish altern ka attention
	Annual scarce among super-compound augmorphic flowing proceedings of an ani- construction of the compound of t		A LOT REST
	to morning and the second of t	nto to regard patric of the sea particles of particles	2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 -
	to Mark and a state of the contract of the state of the s	and toward do	grant.
We appreciate y	our prompt payment.		
		Payments/Cre	dits \$0.00
		Balance Due	\$6,605.00



SITE CHARACTERIZATION COST ESTIMATE

Total Petroleum Services LLC - Project Team Leader

Date: 9/18/2015

Terranext , LLC - Project Geologist

Project Name - Sac & Fox

Project Location - Powhattan, KS

	Rate	Unit	Quantity	Cost	
Site Characterization - Field Work			198		
Geologist	\$75.00	Hour	14	\$1,050.00	
Pick-Up	\$60.00	Day	1	\$60.00	
Water Level Meter	\$20.00	Day	1	\$20.00	
Subsurface Drilling 4 Tempora	ry Piezometers				
Drilling and Site Utility Locates	\$3,300.00	Day	1	\$3,300.00	
Laboratory Analytical Testing Ground Water					
BTEX, Naph, Oxygenates	\$125	Sample		5 \$625.00	
& TPH GRO (Method 8260B)	Standard Turnaround				
	Subsurface	e Investigat		\$5,055.00	
	ciest Management				
Site Characterization - Report/Pro Project Manager Project Geologist	\$250.00			\$250.00 \$1.300.00	
	\$250.00 \$1,300.00	Lump Sur		\$1,300.00	ne aref resonce sendono
Project Manager	\$250.00	Lump Sur			ne anet resioned x griding
Project Manager Project Geologist Sac & Fox Acceptance	\$250.00 \$1,300.00	Lump Sureparation Subsurface	m 1	\$1,300.00 \$1,550.00	\$5,055.00
Project Manager Project Geologist	\$250.00 \$1,300.00	Lump Sureparation Subsurface	m 1	\$1,300.00 \$1,550.00	



11904 Grandview Road Grandview, Missouri 64030 Telephone: 913 894-4000

January 6, 2016

Mr. Robert Trump Total Petroleum Services 16601 W. 132nd Circle Olathe, Kansas 66062

RE:

Site Investigation Report Sac & Fox Truck Stop 1346 US 75 Highway Powhatten, Kansas

Dear Mr. Trump:

Terranext is pleased to provide this Site Investigation Report for the Sac & Fox Truck Stop site in Powhatten, Kansas.

Objectives

The objective of this investigation was to determine general soil characteristics of the subsurface and initial impacts to the soil and groundwater due to a failing gasoline underground storage tanks (UST) located on the property.

Site Investigation Activities

Site characterization activities included the advancement of four borings near the failed UST. Figure 1 (Attachment C) illustrates the site and the locations of the four probes, existing monitoring well and UST basin. Activities also included geologic logging and field screening of the subsurface at three of the probe locations and collection of ground water samples from three of the four probes (the probe, P1, was dry) and the existing monitoring well for laboratory analysis.

Terranext, along with drilling subcontractor PSA Environmental and Total Petroleum Services, LLC were on-site November 19, 2015. After review of the site, discussion of probing locations, calibration of the Photo lonization Detector (PID) and a health and safety meeting, activities to investigate the site began.

General Subsurface Soil Conditions

Attachment A contains the geologic logs of the Probe locations P1-P4.

Probe P1 encountered fill gravel from the current UST basin down to 7 feet below ground surface (bgs); underlain by primarily clay to depth of 22.5 feet bgs. The clay did contain some silt and sand in the interval of 10- 12.5 feet bgs. A thin layer of silty sand was encountered from 22.5 feet bgs to refusal at 23 feet bgs.

Probe P2 encountered refusal at 20 feet bgs. No geologic logging or field screening was performed at the P2 location.

Site Investigation Report Sac & Fox Truck Stop Page 2

Probe P3 encountered primarily clay to depth of 17.5 feet bgs. The clay again contains some silt in the interval of 10.5 0-12 feet bgs. A thin layer of sand with silt was again encountered (17.5 – 19.5 feet bgs) just above refusal at 20 feet bgs.

Probe P4 encountered primarily clay to depth of 18.5 feet bgs. Beneath the clay was silt with some clay and sand from 18.5 feet bgs to the total depth of 24 feet bgs.

Based on the four probes, it appears the general geology is primarily clay with silty sand at depths below approximately 18 feet bgs. This lower silty sand zone is a preferential pathway from groundwater migration.

Soil Impacts

Terranext screened the soil at with a calibrated PID in the field. Table 1 (Attachment B) illustrates the results of the VOCs detected and the sample intervals and indicates the subsurface has been impacted at the P1, P3 and most likely P2 locations. Based on the PID readings, the subsurface does not appear to have been impacted at the P4 location.

Groundwater Impacts

Terranext collected groundwater samples for analysis from Probe locations P2, P3, P4 and the existing monitoring well on-site. P1 was dry and unable to be sampled. Table 2 (Attachment B) illustrates the analytical results. Samples from the existing monitoring well, P2 and P3 all show petroleum impact above Kansas Department of Health and Environment (KDHE) Risk-Based Standards (RSK) limits. Specific chemical of concerns TPH-GRO, benzene, toluene, ethylbenzene, xylenes, naphthalene, and tert-butyl-alcohol (TBA) are all above the respective RSK values. It appears the impact has not yet reached the P4 location. Figure 2 (Attachment C) illustrates the concentrations of TPH-GRO detected and the lab report is included as Attachment D.

Conclusions

Based on the advancement of 4 probes at the subject site and the analysis on groundwater samples collected from the probes, the soil and groundwater near and to the east (downslope) of the failed UST has been impacted by petroleum hydrocarbons. It appears the impacts have not yet reached the P4 location near the eastern property boundary.

Recommendations

Based on the results of this initial site investigation, Terranext recommends the following actions

- Remove the primary contamination source (the failed UST and surrounding impacted soils).

 Address groundwater impacts by natural attenuation and install 5 monitoring wells to monitor this natural degradation. Figure 3 (Attachment C) illustrates the location of the proposed monitoring well locations.

 During the site investigation, Terranext noticed a water tower adjacent to the north of the site. Terranext recommends laboratory testing for chemical of concerns from the well that provides water to the water tower. Site Investigation Report Sac & Fox Truck Stop Page 3

Terranext appreciates the opportunity to work with TPS on this project and if you have any questions or require additional information, please call me at (913) 894-4000.

Sincerely,

TERRANEXT, LLC

C115.

Christopher Kinn, PG Director, Midwest Operations

ATTACHMENT A

Geologic Logs

		erro	Nex	3	LOG OF BORING NO: PI	SASET NUMBER 1 OF 1
		The Land	de la constant de la			Water Level Data
क्रीम १०स आहे			X Truck St		DRILLING PROSNIC CONTRACTOR PSA / Geoprobe 5490	Date Time Depth
PROJECT LECK!	CB		75 Highwa		DRILLINIG WETHOO / EDRE DIAMETER DIRECT Push	WAS DIY OF 1245
	-		n Kansas		SAMPLING METHOD Macro core. TOTAL DEPTH Heet) 2 3	2 2
PROVICE I MUVE	iii	17102879				Survey Data Ground Surface
3870.0545°		Meredith Robert Ti			START DATE 11/15 COMPLETION DATE 11/19/15	Ground Surface.
EAMPLE SEPTI-	Ha	RESERVED	DENCH	mert	GEOLOGIC DESCRIPTION	Ground Water
SUC CIG	JAPLEYS .	PLETT.	DEPTH DEFECT	CONTRIBUTION	(NAME, color, particle size, characteristics)	NOTES:
1038	Imputiti	IPSE14	() ELI)	GUSTA WILLIAM		700723
In 3.0					Concrete Surface	
			1		Fill Syave	
		3.	2			
		3/4	-	1		
		1	3	1		
	023	1		1		3-4' slight adar
	52.1		4			3131
104				100		
14.	1		5			
		11/				
		17	6			
		4		1		
			7			
	1507				CH: modern most mottled broand sx.	7-8' Streng agol
	1,30 9	100	8		Medium Sieste CLAY black stelling	3
644						
			9			
		VI	10			
	1621			6	MI : med in most motiled preme and only	10-11 strang order
	164)	M	11	S	12 (3) Sin 15 (3)	7
					ML: atit moist area non- Dista SILT	
			12	3	some send (C) 3	
1051				7 2		
1			13	30 manufe	CH: still moust began high dusting CLAY	
				-2	TR imestore reduces	
		11/	14	8		
	26	14				14-15 strong notes
	630		15			3
			16			
1058			16			
1026		1 1	17		* * * * * * * * * * * * * * * * * * * *	
		1/	18	1		
	100	14			CH: of the moist area his blestic CLAV	18-19' mal odor
	211	, ,	19		with some accord and interbedded	
					white clay u	
			20		CH: V. stiff mast gray, high Dady CLA	
1107					1/3/	
		1.11	51			
		4/				
		7	22			22 22/ 1
	697		22	1	SM: Heave mint proper sity mit SAND	22-23' story odor
1117		-	23		M: Heave mint groups sity mf SAND	
1116			24		KETTSELIN ZSTT	
-	-		24			
			25			
LEGENE):	SS - Spl	The second second		- Concrete - Bentanite Chip Seal	ST - Shelby Tube
	18			on Detector	- Flush Mount Vault Filter Pack	HSA - Hollow Stem Augers
1			Parnuery		- Well Screen	PPMV - Paris Far Million by Volume

	erranext	LOG OF BORING NO: PZ	Water Level Data
10-77	Sac & Fox Truck Stop	ORILLING : PROBING CONTRACTOR PSA / Geoprobe 5400	Date Time Depth
ECT LOCATION	1348 US 75 Highway	DRILLING METHOD / BORE DIAMETER. Direct Push	11/19/15 1556 19.2
HT BARWALINET	Powhattan, Kansas	SAMPLING METHOD Macro core	
ECT NONSIER	17102679	TOTAL DEPTH (Very 20)	Survey Data
20061	Meredith Watson	START DATE 1/19/15 COMPLETION DATE 11/19/15	Ground Surface,
CII .	Robert Tieman	GPS COORDNATES	
PLEDENTH PO	RECOVERY DESIR SELE	GEOLOGIC DESCRIPTION	Ground Water: NOTES:
OTHE PPWV	PRATE PRATE CONSTRUCTION	(NAME, color, particle size, characteristics)	NOTES.
300		Concrete Surface	
			soils not logged
	2		
- 4			Bother for only
	3		ara advister sample
- 1			9
-	4 /		
	5	17 - 17 - 17 - 17 - 17 - 17 - 17 - 17 -	
	6 -		
	7 4		174-3)_2.
	H		
	1 -1/		
	9 6		
	o of water		The same same
	10 6		
- 1	1 8		
	11 19		
	12		
	13		
	14		
1	15		
	16	The second secon	
	10		Tencer-
	17		
	16		
	19		
	20		
350		Refuse @ 20 H	
100	21		
	22		
	23		
N.			
	.24		
	26		
EGEND:	SS - Split Spoon PID - Photolonization Defector	- Concrete - Flush Mount Vault - Filter Pack	ST - Shelby, Tube HSA - Hallow Stem Augers PPMV - Parts Per Million by Volum

Terranext						LOG OF BORING NO: P3	Water Level Data
40,000,000	-	Sec s F-	x Truck S	lan.		ORILLING PROBING CONTRACTOR PSA / Geoprobe 5400	Date Time Depth
HOLEST HAVE,		-				CRILLING METHOD (SCRE DIAMETER Direct Push	11/19/15 1554 914
HÖRET LECA	15/16		75 Highwi			SAMPLING METHOD Macro core	All and the second of the seco
ATTOM S		1710267			-	TOTAL DEPTH (Red) 7.0	Survey Data
MOJECT NUMB	296	-			100	START DATE 11/19/15 COMPLETION DATE 11/19/15	Ground Surface,
EDLDG/KT	_	Meredin			-	GPS COORDINATES	
SALES:		Robert T	The same of		-	GEOLOGIC DESCRIPTION	Ground Water
Print Man		4EDONER!	GERDS	D355		(NAME, color, particle size, characteristics)	NOTES
ALC: THE	Det/A	FEET	AUSTI	CONSTRUC	TON .		NOTES
1412		14	2			Concrete Surface Chi median stiff moist moffled blown and grey, law plastic, silty char	3.4' 05 0200
	0.0			10			2.4 6/6 91-94
The second			4	1			
1415							
		1/4	5	1			6-7' ne eder
	35.4	, ,	7				0 7 10 0007
. 1.2	-	-		See			
1414			9	VA -			
		1/4	10				
	1357		11	Sentonite		pleste sleyey SILT orange med.	11-12' strong oder
1424				1		CH: stiff moist mottled brown and crey	
			13			high plastic CLAY	
	1	u/	14	12		chi salt mettled brown and sex	13-14 Strong poor
	417	1/4	1	-		THE ME THE STATE OF THE STATE O	
		14				Not I VECT CONT.	
			15				
			10	/			
7,41			18	1			
1431			-				
			17	1			17-18 mod poor
		111	18	- Inde		SM: medium derse, wet orange, SAND	1
	295	1/4	10	1			
		14	19			(8-4), With 211	
			1.8	1			
			20	1		CHI with moral bring this of the CIA	
-		-	20		-	CHI stiff moist brown high phopic CLAN	
1440						Meresci in North	1
			21				
			20				
		1	22				
			201				
			23				
			7.				
	-		24			The second secon	
			200				
		-	25		0.1	E - Concrete	ST - Shelby Tobe
LEGEN	LJ:	PID - P	hit Spoon hotoloniza	tion Detector	**	Firsh Mount Vault - Firsh Mount Vault - Fifter Pack - Grout - Well Screen	HSA - Hollow Stem Augers PPMV - Paris Per Million by Volume

	G.	effe	INE)	(I)	LOG OF BORING NO:	SHEET NUMBER 1 OF 1
	-	GOVE !	Sept.		1 17	Water Level Data
TOTAL TALLE		Sac & Fo	x Truck S	top	DRILLING PROBING CONTRACTOR PSA / Geoprobe 5400	Date Time Depth
ALUSCI OSCATA	ON.	1346 US	75 Highwi	ay	CRILLING METHOD FORE DAMETER Direct Push	11/20/15 1028 11.2"
		Powhatia	in Kansas		SAMPLING METHOD Macro core	
ROUTET NEWBE	R	1710267			TOTAL DEPTH (Fen) 24	Survey Data
Tenone		Mered th			START DATE 1/19/15 COMPLETION DATE 1/20/15	Ground Surface
DATTLE.	_	Robert T	-		GEOLOGIC DESCRIPTION	Ground Water
MAINE DEPTH	80	RECOMENT	SEFT	WELL	(NAME, color, particle size, characteristics)	NOTES:
ANSITHE	"PFARS	WEEE	WELT	SONS METICA		
1453	0.0		1		CL: still meist, dest brewn, bur plastie	0-1' no odal
	0.0	44	3	1	CL: of VE, moint, brown, low plastic, CLAY	2-3' nu cost
1457	0.0	4/4	5	W. W.		. 51
4 Jan - A	8.0		8	5	CL: All, ment, grey, levelidin CLAY	6-7' no acer
1501	0.0	1/4	10	Sextonite Con	CH: of the most mother brown and cray	11-12' no poer
1506	1			0/1		
1500	1		13	1		
	0.0	14	14			14-15 no oner
1512						
13	0.0	44	18		ML: v. stiff, moist brown non-plastic, clayer SILT, some & send	18-19' no oder
1521	0.0	4/4	21		ML: VIGHT wet brown non-plants.	21-22' ne oder
			24			
1530					TD @ 24 G	
		-	25			07 7 1 7 1
LEGEN	0:	PID - PI	ilit Spoon notoloniza Recoven	tion Detector	- Concrete - Flush Mourit Vault - Grout - Figer Pack - Welt Screen	ST - Shelby Tube HSA - Hollow Stem Augers PPMV - Parts Per Million by Volume

ATTACHMENT B

Tables

TABLE 1 SOIL FIELD SCREENING RESULTS

Sac & Fox Truck Stop 1346 US 75 Highway Powhatten, Kansas

PROBE ID	DATE MEASURED	SAMPLE INTERVAL (feet bgs)	FIELD SCREENING RESULT (ppmv)
P1	11/19/15	3-4 7-8 10-11 14-15 18-19 22-23	82.1 1,507 1,621 264 211 697
P3	11/19/15.	3-4 6-7 11-12 13-14 17-18	0.0 35.4 1,351 417 295
P4	11/20/15	0-1 2-3 6-7 11-12 14-15 18-19 21-22	0.0 0.00 0.00 0.00 0.00 0.00

NOTE:

Soil samples were collected from probes utilizing Geoprobe™ technology.


bgs - below ground surface ppmv - parts per million by volume


	Analyticat	EPA 8260				
	ETHYL-TERT-BUTYL ETHYL-TERT-BUTYL		MONIDON	N(50)	NDCI	ND(3)
	лучорус (Зчіа) язні з		(00170N	ND(50)	ND(1)	(1.)CIN
	JYHTƏMJYMA-TRƏT (SMAT) RƏHTƏ		(001) (N)	ND(50)	NDCI	ND(1)
	JYTUB_IRBT (ABT) JOHODJA	828	2,750	2,570	(ortign	MECTO
Sac & Fox Fruck Stop 1346 US 78 Highway Powhaten, Kansas	MUBE (up/l)	262	NO(100)	(0g)(QN	(L)CIN	(1)KIN
	Nephthalone (ugil)	2.11	NOITEDOS	ND(500)	68.9	ND(10)
	Total BTEX (Mgff)		31,830	13,486	5,897	QN
S. L.	Xylanets: (ugit)	10,000	13,400	2,810	2,220	ND(3)
	Ethýl Bônzane (vg/l)	700	2,550	908	Bar	(L)(JN
	Toluene (usil)	1,000	11.300	7,830	2,380	(F)(J)
	. Benzené (µan)	VII.	-4,580:	6,940:	968	(F)CN:
	TPH GRO , Benzeno	260	115,000	42,860	.22,500	(005)UN
	Stauc Water Covel (ft bgs),		5,02	200	20	1.2
	Date Sampled	Tier 2 RSK Non Residential	SWARW LIVENZOIS	11/19/15	41/19/15	11/20/15 /
	Walifo	Non'Re	C3VV-MIV	GW-P2	GW/P3	GW.P4


Values in bold exceed non-Reidenhell Tem? RSKs RSKs. Ries: Tusser Standard for Kaness (RSK), Value, August 2010)

ATTACHMENT C

Figures

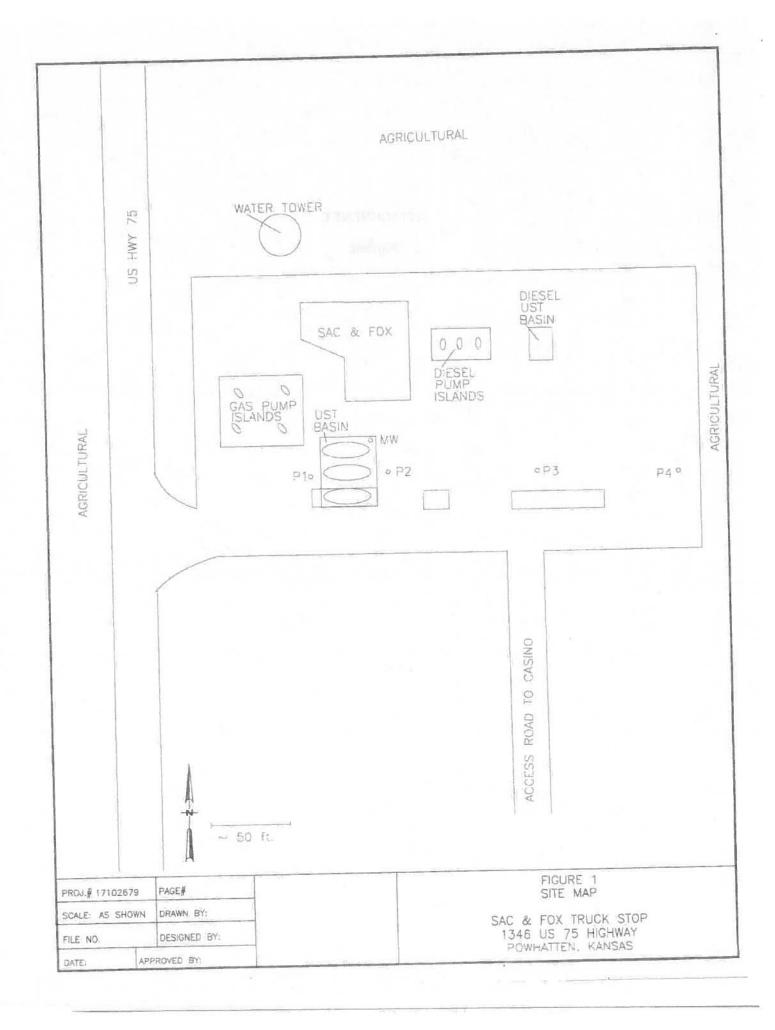

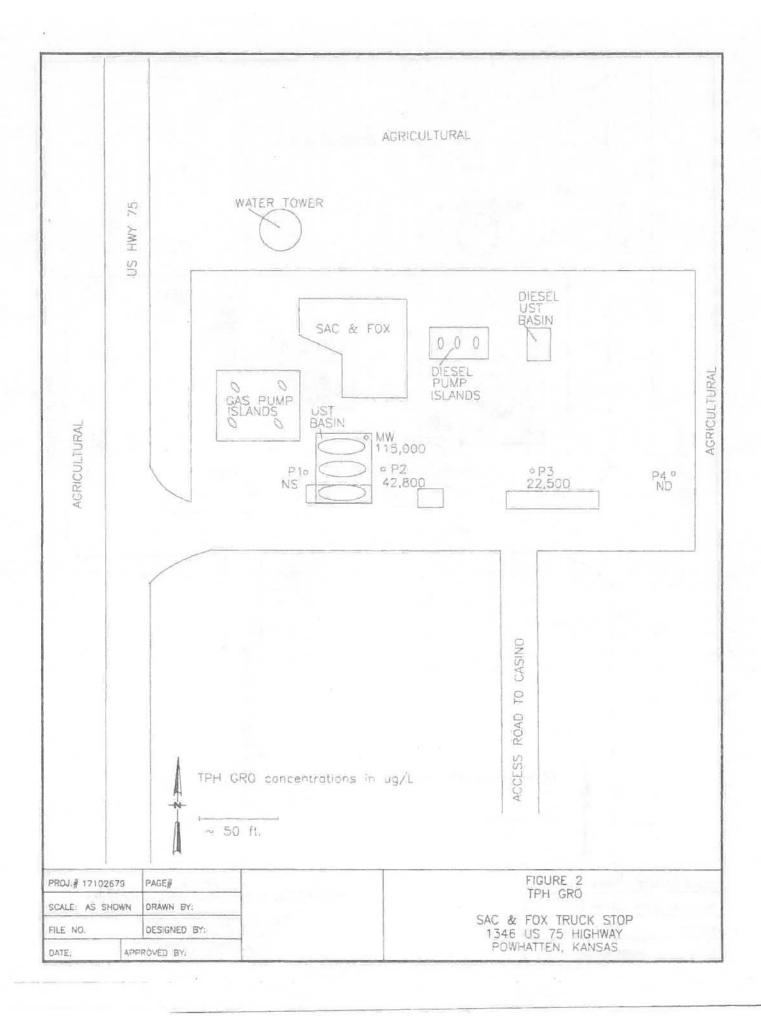

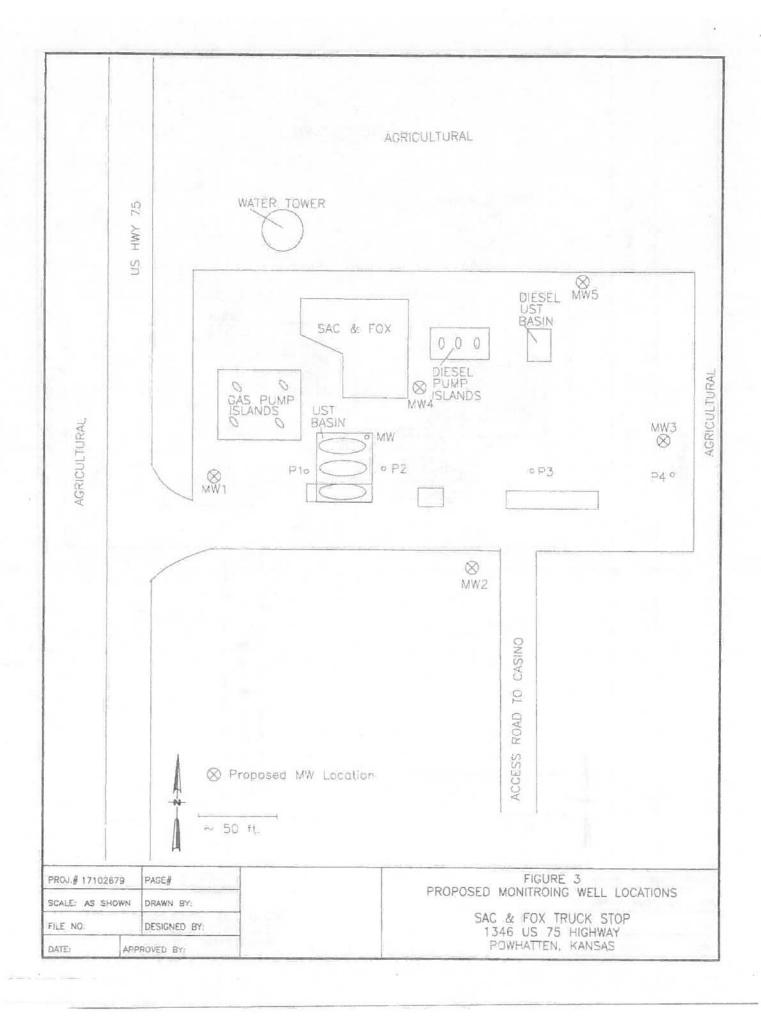

ATTACHMENT D Lab Data





December 03, 2015

Meredith Watson TERRANEXT 11904 Grandview Road Grandview, MO 64030

RE: Project SAC & FOX

Pace Project No.: 60207920

Dear Meredith Watson:

Enclosed are the analytical results for sample(s) received by the laboratory on November 20, 2015. The results relate only to the samples included in this report. Results reported herein conform to the most current TNI standards and the laboratory's Quality Assurance Manual, where applicable, unless otherwise noted in the body of the report.

If you have any questions concerning this report, please feel free to contact me.

Sincerely,

 
Emily Webb for Alice Flanagan alice flanagan@pacelabs.com Project Manager

Enclosures

cc Mr. Christopher Kinn, TERRANEXT



This repair shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc.





CERTIFICATIONS

Project:

SAG & FOX

Race Project No :: 60207920

Kansas Certification, IDs 9508 Lorret Boulevard, Lenexa, KS 66219 WY STR. Certification #: 2456,01 Arkansas Certification #: 15-016-0 Illinois Certification #: 003097 towa Certification #: 118 Kansas/NELAP Certification #: E-10116

Louisiana Gertification #! 03055 Revada Certification #: KS000212008A
Revada Certification #: KS000212008A
Revada Certification #: 8205/9935
Texas Certification #: T104704407
Utah Certification #: KS00021

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full. without the written consent of Pace Analytical Services, Inc.





SAMPLE SUMMARY

Project:

SAC & FOX

Pace Project No.: 60207920

Lab ID	Sâmplê ID.	Matrix	Date Collected	Date Réceived
60207920001	ĠW:MW	Water	11/19/15 12:32	11/20/15 12:35
60207920002	GW-P2	Water	11/19/15 16:26	11/20/15 12:35
60207920003	GW-P3,	Water.	11/19/15 16:04	11/20/15 12:35
60207920004	GW-P4.	Water	11/20/15/10:33	11/20/15 12:35
60207920005	TRIP BLANK	Water	11/19/15 12.00	11/20/15 12:35

REPORT OF LABORATORY ANALYSIS.

This report shall not be reproduced, except in full, without the Wniten consent of Pace Analytical Services, Inc.





SAMPLE ANALYTE COUNT

Project:

SAC & FOX

Pace Project No.2 60207920

Lab ID	Sample ID	Method	Analysts	Analytes Reported
60207920001	GW-MW	EPA 8260	EAG	15
60207920002	GW-P2	EPA 8260	EAG	15
60207920003	GW-P3	EPA 8260	EAG, JDH	15
60207920004	GW-P4	EPA 8260	EAG, JDH	15
60207920005	TRIP BLANK	EPA 8260	EAG	15

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full, without the written consent of Pace Analytical Services, Inc.





Project:

SAC & FOX

Pace Project No.: 60207920

Sample: GW-MW	Lab ID: 602	07920001	Collected 11/19/1	5 12:32	Received: 11/20/15 12:	35. Matrix: Water	
Parameters	Results	Units	Report Limit	DĖ	Prepared Analyz	red GAS No:	Qual
8260 MSV GRO and Oxygenates	Analytical Met	nod. EPA 828	10				
tert-Amylmelhyl ether	ND	ugiL	100	100	12/02/15	17:47 '994-05-8	
Benzene	4580	ug/L	100	100	12/02/15	17:47 71:43-2	
Iart-Bulyl Alcohol	2750	ug/L	1000,	100	12/02/15		
Disopropyl ether	ND	ug/L	100	100	12/02/15	17:47 108-20-3	
Ethylbenzene	2550	ug/L	100	100	12/02/15	17:47 100-41-4	
Ethyl-tert-butyl ether	ND	tig/L	100	100	12/02/15	17:47 '637-92-3	
Methyl-tert-butyl elher	ND	,ug/L	100	100	12/02/15	17:47 1634-04-4	
Naphihalene	NÔ	iug/L	1000	100	12/02/15	17:47 91-20-3	
Toluênê	11300	ugiL	-100	100,	12/02/15	17:47 108-88-3	
TPH-GRO	115000.	ug/L	50000	100	12/02/15	17:47	
Xylane (Total) Surrogates	13400	ug/L	300	100	12/02/15	17:47 1330-20-7	
Toluene-d8 (S)	,95	95	80-120	100	12/02/15	17:47 2037-26-5	
4-Bromofluorobenzene (S)	.68	% .	80-120	1001	12/02/15	17:47 460-00-4	
1,2-Dichloroethane-d4 (S)	104	94	82-119	100	12/02/15	17:47 17060-07-0	
Preservation pH	1.0		0.10	100	12/02/15	17:47	

REPORT OF LABORATORY ANALYSIS






Project.

SAC & FOX

Pace Project No. 60207920

Sample: GW-P2	Lab ID: 602	07920002	Collected	11/19/1	5 16:28	Received: 1	11/20/15 12:35	Matrix: Water	
Parameters	Results	Units	Repo	rt Limil	DF	Prepared	Analyzed	CAS No.	Qual
3260 MSV GRO and Oxygenates	Análytical Met	hod EPA 82	60					n - 1 112	10
ert-Amy methyl ether	ND	ug/L		50 0	50		12/02/15 18:01	994-05-8	
Benzene	6940	ug/L		50.0	50		12/02/15 18:0	1 71-43-2	
ert-Butyl Alcohol	2570	ug/L		500	50		12/02/15 18:01	75-65-0	
Disopropyl ether	ND	ug/L		50.0	50		12/02/15 18:01	108-20-3	
thylbenzene	906	ug/L		50.0	50		12/02/15 18:01	1 100-41-4	
Thyl-tert-butyl ether	ND	ug/L		50.0	50		12/02/15 18:01	637-92-3	
Aethyl-tert-butyl eiher	ND	üg/L		50.0	50		12/02/15 18:01	1 1634-04-4	
łaphlhalene	ND	ug/L		500	50		12/02/15 18:01		
Toluène	2830	ug/L		50.0	50		12/02/15 18:01	108-88-3	
PH-GRO	42800	ug/L		25000	50		12/02/15 18:0		
(ylene (Total) Surrogatés	2810	ug/L		150	50		12/02/15 18:01	1330-20-7	
Toluene-d8 (S)	99	96		80-120	50		12/02/15 18:0	2037-26-5	
-Bromofluorobenzene (S)	101	96		80-120	50		12/02/15 18:01		
.2-Dightorgethane-d4 (S)	105	%		82-119	50		12/02/15/18:01	17060-07-0	
Preservation pH	5.0			0.10	50		12/02/15:18:0	May 1	р́Н

 



SAC & FOX

Pace Project No : 60207920

Sample: GW-P3	Lab ID: 602	07920003	Collecte	d 11/19/1	15 16:04	Received:	11/20/15 12:35	Matrix: Water	
Parameters	Results	Units	Rep	ort Limit	DF	Prépared	Analyzed	CAS No.	Qual
8260 MSV GRO and Oxygenates	Analytical Met	nod: EPA 82	60						
tert-Amylmathyl ether	ND	ug/L		1.0	1		12/03/15 08:0	994-05-8	
Benzens	968	ug/L		20.0	20		12/03/15 13:50	71-43-2	
iert-Butyl Alcohol	ND	ug/L		10.0	1		12/03/15 06:0	1 75-65-0	
Diisopropyl ether	ND	ug/L		1.0	1		12/03/15 06:0	1 108-20-3	
Ethylbenzene	429	ug/L		20.0	20		12/03/15 13:51	6 100-41-4	
Elhyl-tert-butyl ether	ND	ug/L		1.0	1		12/03/15 06:0	400	
Welhyl-tert-butyl either	ND	ug/L		1.0	1		12/03/15 06:0		
Naphihalené	68.9	ug/L		10.0	1		12/03/15 06:0	91-20-3	
sneuloī	2380	ug/L		20.0	20		12/03/15 13:50		
TPH-GRO	22500	ugiL		10000	20		12/03/15 13:50	à	
Xylena (Total)	2220	ug/L		60.0	20		12/03/15/13:50	* Committee of the comm	
Surrogates									
Toluene-d8 (S)	98	%		80-120	1		12/03/15 06:0	2037-26-5	
4-Bromofluorobenzene (S)	97	%		80-120	1		12/03/15 08:0	460-00-4	
1,2-Dichloroethane-d4 (S)	91	%		82-119	1		12/03/15 06:01		
Preservation pH	5.0			0.10	1		12/03/15 06:0	1	pH





Project:

SAC & FOX

Pane Project No.: 60207920

Sample: 'GW-P4	Lab ID: 6020	7920004	Colle	cted: 11/20/1	5 10:33	Received: 1	1/20/15 12:35	Matrix: Water	
Parameters	Results	Un(Is		Report Limit	DF	Prepared,	Analyzed	CAS No.	Qual
8260 MSV GRO and Oxygenates	Analytical Meth	od: EPA 8	260				S I THE THE THE STEEL SHOWN		
ert-Amylmethy) ether	ND	ug/L		1.0	1		12/03/15 06:16	994:05-81	
Benzene	ND	ug/L		1:0	4		12/03/15 14:10	71-43-2	
êrt-Butyl Alcohol	ND	ug/L		10.0	1		12/03/15 06:16	75-65-0	
Diisopropyl elher	.ND	ug/L		1.0	1		12/03/15 06:16	108120-3	
Ethylbenzene	ND	ug/L		1.0	4		12/03/15 14:10	100:41-4	
thyl-tert-butyl ether	ND	üg/L		1.0	1		12/03/15 06:16		
Mathyl-tert-butyl ether	ND	ug/L'		1.0	1		12/03/15 06:16	1634-04-4	
Naphthalena	NÖ	ug/L		10.0	1		12/03/15 06:16	91-20-3	
foluene	ND	ug/L		1.0	1		12/03/15 14:10	108-88-3	
TPH-GRO	ND	ug/lu		500	1		12/03/15 14:10		
Kylene (Total)	ND	ug/L		3.0	1		12/03/15 14:10	1330-20-7	
Surrogates		~						ETE EU	
Toluene-d8 (S)	101	%.		80-120	1		12/03/15 06:16	2037-26-5	
-Bromofluorobenzene (S)	101	%		80-120	1		12/03/15 06:16	460-00-4	
1,2-Dichloroethane-d4 (S)	101	%		82-119	1		12/03/15 06:16	17060-07-0	
Preservation pH	1.0			0.10	1		12/03/15 06:16		





Project.

SAC & FOX

Pace Project No.: 60207920

Sample: TRIP BLANK	Lab ID:	60207920005	Colle	ecles: 11/19/1	5 12:00	Received:	11/20/15 12:35	Matrix: Water	
Parameters	Results	Units		Report Limit	DF	Prepared	Analyzed	CAS No.	,Qual
8260 MSV GRO and Oxygenates	Analytical	Method EPA 82	60				44		
eri-Amylmethyl ether	NE	ug/L		1.0	1		12/03/15 06:30	- 994-05-R	
Benzene	NE			1.0	1		12/03/15 06:30		
ert-Butyl Alcohol	NE			10.0	4		12/03/15 06:30	4 1	
Disopropyl ether	NE			1.0	31		12/03/15 06:30		
Ihylbenzene	NE			1.0	1		12/03/15 08:30	100	
Ethyl-tert-butyl other	NO			1.0	1		12/03/15 06:30		
Methyl-ters-butyl ether	NE			10	1		12/03/15 06:30		
laphthalene	NE			10.0	1		12/03/15 06:30		
foluene	NE			1.0	1		12/03/15/06:30		
PH-GRO	NE	***		500	1		12/03/15 06:30	27 27 2	CU
(ylene (Total) Surrogates	ŊĊ			3.0	1		12/03/15 06:30		CO
foluene-d8 (S)	100	94		80-120	- 1		12/03/15 06:30	2037-26-5	
-Bromofluorobenzene (S)	100	96		80-120	1		12/03/15 06:30	4 4 4 2 4 4 7	
,2-Dichloroethane-d4 (S)	101			82-119	1		12/03/15 06:30		
Preservation pH	1.0			0.10	1		12/03/15 06:30	199.90	





Project:

SAC'S FOX

Pace Project No.: 60207920

QC Batch:

MSV/73115

Analysis Method:

EPA 8260

QC Batch Method: EPA 8260

Analysis Description:

8260 MSV MC GRO Oxygenates

Associated Lab Samples: 60207920001, 60207920002

METHOD BLANK: 1677401

Matrix: Water

Associated Lab Samples: 60207920001, 60207920002

Parameter	Units	Blank Result	Rêporting Limit	Analyzed	Qualifièrs
Benzéne	ug/L	ND	1.0	12/02/15 12:39	
Diisopropyl ether	ug/L	ND	1.0	12/02/15 12:39	
Ethýl-terl-butýl ether	ug/L	ND	1.0	12/02/15 12:39	
Elhylbenzene	ug/L	ND:	1.0	12/02/15 12:39	
Methyl-tert-butyl ether	ugiL	ND	1.0	12/02/15 12:39	
Naphthalene	ugil	ND	10.0	12/02/15 12:39	
lert-Amylmethyl ether	ug/L	ND	1.0	12/02/15 12:39	
lert-Butyl Alcohol	ug/L	ND.	10:0	12/02/15 12:39	
Toluene	ug/L	ND	1,0	12/02/15 12:39	
TRH-GRO	ug/L	ND	500	12/02/15 12:39	
xylene (Total)	ug/L	ND	:310	12/02/15 12:39	
1.2-Dichloroethane-d4 (S)	146	99	82-119	12/02/15 12:39	
4-Bromofluorobenzene (S)	% %	100	80-120	12/02/15 12:39	
Toluene-d8 (S)	.9%	103	80-120	12/02/15 12:39	

LABORATORY CONTROL SAMPLE:	1677402	No. of the contract of the con					
:Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers	
Benzenē,	ug/L	20	1,8;4	92	80-120		
Disopropyl ether	ug/L	20	18.1	90	71-126		
Ethyl-tert-butyl ether	ug/L	20	19.1	95	79-121	1.00	
Ethylbenzene	ug/L	20	18.2	91	80-120		
Methyl-tert-butyl ether	ug/L	20	20.1	101	74-120		
Naphthalene	ug/L_	20	19.1	95	73-128		
tert-Amylmethyl ether	ug/L	20	18.9	94	80-120		
teri-Butyl Alcohol	ug/L	100	107	107	65-131		
Toluene	ug/L	20	18.0	90	80-120		
TPH-GRO	ug/L	4000	3720	93	53-122		
Xylene (Total)	Lig/L	60	55.0	92	80-120		
1.2-Dichloroethane-d4 (S)	%			103	82-119		
4-Bromofluorobenzene (S)	₹,			97	80-120		
Toluene-dB (S)	%			101	80-120		

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full. without the written consent of Pace Analytical Services Inc.





Project:

SAC & FOX

Pace Project No.: 60207920

QC Batch:

MSV/73126

Arialysis Method:

EPA 8260

QC Batch Method:

EPA 8260

Analysis Description:

8260 MSV MO GRO Oxygenates

'Associated Lab Samples: 60207920003, 60207920004, 60207920005

METHOD BLANK: 1677605

Mātrix: Water

Associated Lab Samples: 60207920003, 60207920004, 60207920005.

'Parameter	Units	Blank' 'Result	Reporting Limit	Analyzed	Qualifiers
Benzens	ug/1_	ND	1.0	12/03/15 05 47	
Dilsopropyl ether	ug/L	ND	1.0	12/03/15 05:47	
Ethyl-tert-butyl ether	ug/L	ND	1.0	12/03/15 05:47	
Ethylbenzene	ug/L	ND	1.0	12/03/15/05:47	
Methyl-tert-bulyl ether	Ug/L	ND	1.0	12/03/15 05:47	
Naphthalene	ug/L	ND	10.0	12/03/15,05:47	
tert-Amylmethyl ether	ug/L	ND	1.0	12/03/15 05:47	
tért-Butýl Alcohol	ug/L	ND	10.0	12/03/15,05:47	
Toluene	ug/L	ND	1.0	12/03/15 05:47	
TPH:GRO	. ug/L	ND	500	12/03/15 05:47	
Xylene (Total)	ug/L	ND	3.0	12/03/15 05:47	
1,2-Dichlorgethane d4 (S)	9%	100	82-119	12/03/15 05:47	
Bromofluorobenzene (S)	140	99	80-120	12/03/15 05:47	
Toluene-d8 (S)	%	98	80-120		
				12/03/15 05:47 12/03/15 05:47	

LABORATORY CONTROL SAMPLE	1677606						
Parameter	Units	Spike Conc	LCS Result	LCS % Rec	% Rec Limits	Qualifiers	
Benžene	ug/L	20	184	92	80-120		
Disopropyl'ether	ug/L	:20-	18.4	92	71-126		
Ethyl-tert-butyl ether	ug/L	20	18.9	95	79-121	•	
Ethylbenzene	ug/L	20	18.9	.94,	80-120		
Methyl-tert-butyl ether	⊔ĝ/L	20	20,1	100	74-120		
Naphthalene	ug/L	20	18,5	93	73-128		
tert-Amylmethyl.ether	Lig/L	20	18,6	93	80-120		
tert-Butyl Alcohol	ug/L	100	103	103	65-131		
Toluene	ug/L	20	19.3	97	80-120		
TPH:GRO	ug/L	4000	3220	80	53-122		
Xylene (Total)	ug/L	60	59.0	-98	80-120		
1.2-Dichloroethane-d4 (S)	%			98	82-119		
4-Bromofluorobenzene (S)	% **c			99	80/120		
Toluene-d8 (S)	%			102	80-120		

Benzene	ug/L	0.35J	20	20	17.9	18.3	88	90	46-155	- 2	13	
Parameter	Units	60207823007 Result	Spike Conc.	MSD Spike Conc.	MS Résult	MSD Result	MS % Rec	MSD % Rec	% Rec	RPD	Max RPD	Qual
MATRIX SPIKE & MATRIX SP	IKE DUPLIC	ATE: 16776	07		1677608							

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

REPORT OF LABORATORY ANALYSIS





Project.

SAC & FOX

Pace Project No : 60207920

MATRIX SPIKE & MATRIX SP	IKE DUPLI	CATE 16776	07		1677608	77						-
Parameter	Units	60207823907 Result	MS Spike Conc.	MSD Spike Conc.	MS Result	MSD Result	MS % Rec	MSD % Rec	% Rec Limits	RPD	Max RPD	Qual
Dilsopropyl ether	ug/L	ND	20	20	16.0	17.6	80	88	61-136	g	44	
Elhyl-terl-butyl ether	ug/L	ND	20	20	16.2	18.0	81	90	60-142	11	45	
Ethylbenzene	ug/L	ND	20	20	17.5	17.3	87	87	51-148	1	14	
Methyl-tert-butyl ether	ug/L	74.7	20	20	112	116	184	205	41-156	d	17	M1
Vaphthalene	ug/L	ND	20	20	17.9	18.8	89	94	41-148	5		211.5
ert-Amylmethyl ether	ugiL	0.691	20	20	17.2	18.7	83	90	66-136	8		
ert-Bulyl Alcohol	ug/L	10.9	100	100	103	110	93	99	47-141	6		
foluane	ug/L	ND	20	20	18.1	18.1	90	90	47-149	0		
(ylene (Total)	ug/L	ND	60	60	53.1	53 7	88	90	39-158	1	15	
,2-Dichloroethane-d4 (S)	9/5						103	104	82-119	,	,,,	
-Bromofluorobenzene (S)	%						99	98	80-120			
oluene-d8 (S)	%						101	98	80-120			
Preservation pH		1.0			10	1.0	.01	33	29.724	0		

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.





Project:

SAC & FOX

Pace Project No.: 60207920

QC Batch:

MSV/73139

Analysis Method:

EPA 8260

QC Batch Method: EPA 8260

Analysis Description:

8260 MSV MO GRO Oxygenates

Associated Lab Samples: 60207920003, 60207920004

METHOD BLANK: 1678123

Associated Lab Samples: 60207920003, 60207920004

Mālrix: .Water

Parameter	Unils	Blank Result	Reporting	Analyzed	Qualifiers
Benzene	ug/L	ND	1.0	12/03/15 12:12	
Ethylbenzene	üg/L	ND	1.0	12/03/15 12:12	
Toluene	ug/L	ND	1.0	12/03/15 12:12	
TPH GRO .	uģ/L	ND	500	12/03/15 12:12	
Xylene (Total)	ug(L	ND	3:0.	12/03/15 12:12:	
1.2-Dichloroethane-d4 (S)	96	98	82-119	12/03/15 12:12	
4-Bromofluorobenzene (S)	9/2	98	80-120	12/03/35 12:12	
Toluene-d8 (S)	0.70	101	80-120	12/03/15 12:12	

LABORATORY CONTROL SAMPLE: 1678124

Parameter	Units	Spike Coñe,	ECS Result	LCS % Rec	% Rec Limits	Qualifiers
Benzene	ug/L	20	17,8	89	80-120	
Ethylbenzene	ug/L	20	17.7	89	80-120	
Toluene	lug/L	20	18.8	94	80-120	
TPH-GRO	vg/L	4000	4360	109	53-122	
Xylene (Total)	ug/L	60	54.5	91	80-120	
1,2-Dichloroethane-d4 (S)	96			97	82-119	
4-Bromofluorobenzene (S)	9/9			99	80-120	
Toluene-d8 (S)	°/a			103	80-120	

Results presented on this page are in the units indicated by the "Units" column except where an alternate only is presented to the right of the result.



Pace Analytical Services, Inc. 9608 Loret Blvd, Lenexa, KS 66219 (013)599-5865

QUALIFIERS

Project:

SAC & FOX

Pace Project No.:

60207920

DEFINITIONS

DF - Dilution Factor, if reported, represents the factor applied to the reported data due to dilution of the sample aliquot

ND - Not Detected at or above adjusted reporting limit.

J'- Estimated concentration above the adjusted method detection limit and below the adjusted reporting limit.

MDL - Adjusted Method Detection Limit.

PQL - Practical Quantitation Limit,

RL - Reporting Limit.

S - Surrogale

1,2-Diphenylhydrazine decomposes to and cannot be separated from Azobenzene using Method 8270. The result for each analyte is a combined concentration.

Consistent with EPA guidelines, unrounded data are displayed and have been used to calculate % recovery and RPD values.

LCS(D) - Laboratory Control Sample (Duplicate)

MS(D),-Matrix Spike (Duplicate)

DUP - Sample Duplicate

RPD - Relative, Percent Difference

NC - Not Calculable.

SG - Silica Gel - Clean-Up

U.- Indicates the compound, was analyzed for, but not detected.

N-Nitrosodiphenylamine decomposes and caffrot be separated from Diphenylamine using Method 8270. The result reported for each enalyte is a combined concentration.

Pace Analytical is TNI accredited. Contact your Pace PM for the current list of accredited analytes.

TNI- The NELAC Institute.

BATCH QUALIFIERS

Batch: MSV/73115

[M5] A matrix spike/matrix spike duplicate was not performed for this batch due to insufficient sample volume.

 
ANALYTE QUALIFIERS

CU The continuing calibration for this compound is outside of Pace Analytical acceptance limits. Analyte presence below reporting limits in associated samples. Results unaffected by high bias

Mil Matrix spike recovery exceeded QC limits. Batch accepted based on laboratory control sample (LCS) recovery

pH Post-analysis pH measurement Indicates insufficient VOA sample preservation.

REPORT OF LABORATORY ANALYSIS





QUALITY CONTROL DATA CROSS REFERENCE TABLE

Project;

SAC & FOX

Pace Project No.: 160207920

áb ID	Sample ID	QC Batch Method	QC Batch	Analytical Method	Analytical Batch
50207920001 50207920002	GW-MW GW-P2	EPA 8250 EPA 8260	MSV/73115 MSV/73115		-110
0207920003	GW-P3	EPA 8260	MSV/73126		
0207920003	GW-P3	EPA 8260	MSV/73139		
0207920004	GW-P4	EPA 8260	MSV/73126		
0207920004	GW-P4	EPA 8260	MSV/73139		
0207920005	TRIP BLANK	EPA 8260	MSV/73126		



Sample Condition Upon Receipt

WO#: 60207920


Client Name:	Terribust						Öptional
Courier: FedEx []	UPS C VIA C Clay C	PEX-B	Ē	CI EI	Pacé El Others	Client 2	Prol Due Date:
Tracking #:		Pace S				Vò 🗇	Proj Name:
Custody Seal on Cool	er/Box Present: Yes 🗆 No	4 - 1		ntact			- 14111001
Packing Material:	Bubble Wrap L1 Bubble Ba			Foam	-24	Qther 🖺	
Thermometer Used:		ype of h	ce:	Web B	lue None 🏻 Sam	ples received on	ice, cooling process has begun.
Cooler Temporature:	28			(Citc	le one)		is of person examining
Temperature should be abo		AL.	0.11			contants:	8 11 8
Chain of Gustody preser		77. 7	7	AME.	1.		
Chain of Custody filled o		Z Yes	-		2,		
Chain of Custody relingu		Myse	מאם	DNIA	3.		
Sampler name & signatu		Alyes		.DN/A	A.		
Samples arrived within h	nolding time:	WYes:	DNo	DNA.	5,		
Short Hold Time analys	ses (<72hr):		Kiyo	□N/A	6.		
Rush Turn Around Tim	e requested:	□Yes	(CNo	ENTA	7:.		
Sufficient volume:		12 ves	□No	DINZA	8		
Correct containers used		Eyes	□No	ĒN/A			
Pace, containers used:		Wives	⊕ No	DNIA	9;		
Containers intact:		Oyes	DNo	□N/A	10.		
Unpreserved 5035A soll	sifrozen win 48hrs?	☐ Yes	ÔNo	MINIA	11.		
Filtered volume received	for dissolved tests?	Oves	Die	(DN/A	12.		
Sample labels match CC	oc:	(LYan	Dep	□N/A			
Includes date/time/ID/ar	nálýses Matrix,	TW			13,		
All containers needing press	ervation have been checked.	Üves	UNO	DINA			
All containers needing press with EPA recommendation.	arvalion are found to be in compliance			DHIA			
Exceptions! -VOA, Californi,	O&G, WI-DRO (water)	MYes	(This		Initial, when	Loj#	of added
Trip Blank present:		WYss:		Own	completed.	press	rvative
Pace Trip Blank lot # (if c	purchased): Courch	(CM T. ESS)	CIVÔ	LINIA	15.		
Headspace In VOA vials	(>6mm):	, Dyes	MNn	ONIA	Tu,		
		'em (ned	PELIN		4.6		
Project sampled in USDA	Regulated Area	Tivar	Ülvá	Wines	17. List Stale:		
	d to 5035A vials in the field?						
Client Notification/ Res		C to Cle		MINIA.		manufactural by	/ 47
Person Contacted:		te/Time:	175.5	. 1 1	TIEG UER R	edalien ()	1 Ø
Comments/ Resolution:	Ud	ering;	-				
				-		14-14	
						-	
Project Manager Review:	AAF				Date. 11/20/15	- millione	

CHAIN-OF-CUSTODY / Analytical Request Document The Chain-of-Custody is a LEGAL DOCUMENT. All relevant fields must be completed accurately

SAMPLE ID	\$	Required	li.	lian			Involte In	Involte Information:	ii.						Page :	-	10
SAMPLE ID The Contract road process of the Co	Company Terranesa	Report To.	- 1	ison			Atterner	SU.	7,000								
Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle Particle		Copy To					Сотря	W Name									
AMPLE ID The Company of the property of the p	andHew, MD BACOD						Address			Y					Regula	tory. Agency	
AMPLE ID Character from the contract of the property and	mediacal (le antesi ne)	Purchase, (10.0				C sadd	uzpto									
AMPLE ID Consideration for the constraint of th	10 0046	Project Na		34			Parts P.	opect Manag		Paragony	Oppositates.	com			State	/ Location	
SAMPLE ID Office of the control of	quested the Date	Project #					Pace Py	ofile et.		1			-			KS	
SAMPLE D One Character for the control of the cont			-			T	E			T	E	Requested A	nativale Fither	CVW)	T		
SAMPLE ID O SAMPL			-	00	KLECTFD		MO	Pros	zavalives		1/4						
Complete for one of the following the follow	SAMPLEID			SAR							190)	521			Hig (Vibit)		1941
5W-P2 5W-P2 7W-P2 7W			SHAT SJAMAS			Tak	NOF CONTAINS	HYSON	HOPN	tento	ESSÓ AGCE	desla	do Har		Residue Chio	200	2
TRIP BLANK					I III		3		-		×	X				3) Deh	3:
TRIP BLANK TRIP BLANK MINITER BLANK WINDS 623 3 5 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6			-		1/11/1		2					1 18				(+) Disan.	Cus
TRIP BLANK WITH ROOD 2 V V V V V V V V V V V V V V V V V V					11/14/1		W									4) DC4H	and
ADDITIONAL COUNTERTY OF THE MAJOR AND SHOWN TH	GW.			/	11/24	Contract of	~					> < <				-	ST.
ADMITTED ONTE THE ACCOUNTS THE TARKEN DATE THE SAMPLES	TRIP		\ \ \ \ \		Arthur A		7		>		-5×	10	7			CADGANTO	3
ADDRITONAL COMMENTS ADDRITONA	9																
ADDITIONAL COMMENTS RELIGIOUS OF 1 AFFLANTSM DATE TIME SAMPLE CONDITIONS SAMPLE COND	1																
ADDITIONAL COMMENTS ADDITIONA	82			-													
ADMITCHAL COUNTER TO THE ACCESSION DATE THE SAMPLER WANTE AND SIGNATURE. SAMPLER WANTE AND SIGNATURE. PRINT NAME AND SIGNATURE. PRINT NAME AND SIGNATURE. PRINT NAME AND SIGNATURE. PRINT NAME OF SAMPLER. PRINT NAME OF	(n)																
ADDITIONAL COLUMENTS ADDITIONAL DATE THE SAMPLE CONNOTION OF SAMPLE CONNOTIONS ADDITIONAL COLUMENTS ADDITIO	10																
ADDITIONAL COLONIENTS RELIANDIGUED BY LAFTE AND TO STORYTUNE SAMPLER NAME AND STORYTUNE PRINT NAME AND STORYTUNE PRINT NAME AND STORYTUNE	13																
ADDITIONAL COLOMENTS ADDITIONAL COLOMENTS ADDITIONAL COLOMENTS ADDITIONAL SAMPLER NAME AND SIGNATURE SAMPLER NAME AND SIGNATURE PRINT NAME OF SAMPLER SAMPLER NAME AND SIGNATURE SAMPLER NAME AND SIGNATURE SAMPLER NAME AND SIGNATURE SAMPLER NAME OF SAMPLER SAMPLE				-	-												
APRAL TECTORE — W20 15 1225 (1235 1225 1225 1225 1225 1225 1225 1225	ADDITIONAL COMMENTS		RELINGUISHED	BV J.AFFRAA	TION	DATE	The		A/	Tag and	AFFLATIO		DATE	THE		SAMPLECO	OTTOMS
SAMPLER NAME AND SIGNATURE: PRINT Nume of BAMPLER: SIGNATURE of SAMPLER: SIGNATURE SAMPLER: S		,	5-1	clane		1/20/1	17.3	5	10	S. C.	356			N	2.0	N	4
SAMIPLER NAME AND SIGNATURE: PRINT NAME OF SAMPLER: RICHARD STANDARD F.P. SIGNATURE OF SAMPLER: SAMPLE																	
	Page 17 o			GAMP a	LER NAME RINT NUMB	AND SIGHA		leads	N air	Ats		E lange			p ur divi	i(N	ufbjøt,

ATTACHMENT E

Field Notes

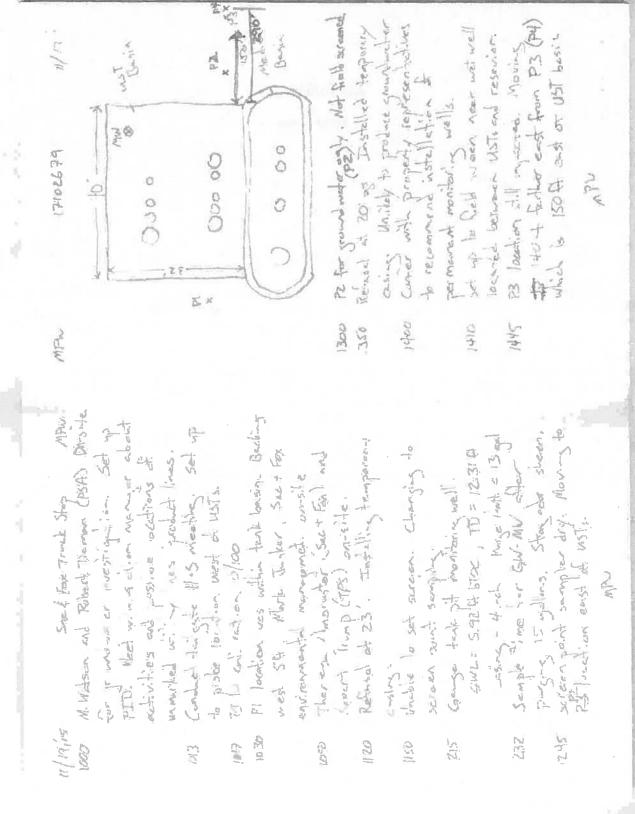

Mindson on-eile the cullect ground water Grow Py location. Sample I'm the Gariph collected	pl placed with borbonic directions of the semont of the Samples on its	Face Problimes.
1025 1025 1025 1025 1025 1025 1025 1025	5	W MA
Enstree Section 19 Sec	Collect 12 sample. Samples on ice. Pet leadion of dry.	Lewing the spokery consing. Locations Pl. 72. A Pa were plugged with beatonite chips after removing cosing and employed with consinte to match sometimes surface. PSA at levernest thirth sometimes surface.
15.745 15.745 15.745 15.746	1000	

SITE HEALTH AND SAFETY PLAN

	tion
Dates: No	vember 2015 Location: 1346 US 75 Hwy Powhattten, Kansa
Site Hazard	s: automotive traffic, slips, trips, falls, and exposure to BTEX
Area Affect	ed: Retail gasoline station
Surroundin	g Population: Commercial
Weather Co	onditions: Mild to severe winter weather
	siderations - The safety concerns and objectives of the initial and ntrics to the impacted area are to:
Tr.	
Be aware c	of traffic at the gasoline station and exposure to contaminated ground water
On Site Co	ordination - The following personnel are designated to carry out the functions during the field investigation activities:
On Site Co stated job f	ordination - The following personnel are designated to carry out the
On Site Co stated job f Project Ma Site Safety	ordination - The following personnel are designated to carry out the functions during the field investigation activities: nager: _Christopher Kinn Officer: _Meredith Watson
On Site Co stated job f Project Ma Site Safety Field Team	ordination - The following personnel are designated to carry out the functions during the field investigation activities: nager:Christopher Kinn Officer:Meredith Watson Leader:Meredith Watson
On Site Co stated job f Project Ma Site Safety Field Team	ordination - The following personnel are designated to carry out the functions during the field investigation activities: nager: _Christopher Kinn Officer: _Meredith Watson
On Site Co stated job f Project Ma Site Safety Field Team Field Team	ordination - The following personnel are designated to carry out the functions during the field investigation activities: nager:Christopher Kinn Officer:Meredith Watson Leader:Meredith Watson
On Site Co- stated job f Project Ma Site Safety Field Team Field Team State Agen	ordination - The following personnel are designated to carry out the functions during the field investigation activities: nager: _Christopher Kinn Officer: _Meredith Watson Leader: _Meredith Watson Members: _Meredith Watson

SITE HEALTH AND SAFETY PLAN (Continued)

E. Hazard Evaluation - The following substance(s) are known or suspected to be on the site. The primary hazards of each are identified.

Substance Involved
Benzene

Concentration

Primary Hazards human carcinogen

F. Personal Protective Equipment - Based on the evaluation of potential hazards, the following levels of personal protection have been designated for the applicable scope of work:

<u>Level D</u> - Includes site protective clothing, steel-toe boots, protective gloves, hard hat when necessary.

<u>Level C</u> - Includes air purifying cartridge respirator and protective clothing - the level of protection will be determined by the on site Field Team Leader.

G. Personal Monitoring - The following personal monitoring will be in effect on site:

A PID will not be utilized on-site. Visual and olfactory observation will be utilized.

H. Emergency Medical Care - The following first aid equipment is available on site at the following locations:

First Aid Kit On BE&K/Terranext vehicle

Eye Wash On BE&K/Terranext vehicle

_is the designated facility for emergency medical care.

List of Emergency Phone Numbers:

Agency

Phone Number

Contact


EMS

911 '

Horton Community Hospital

785-486-2642

Horton Community Hospital is located at 240 W 18th St in Horton, KS 66439

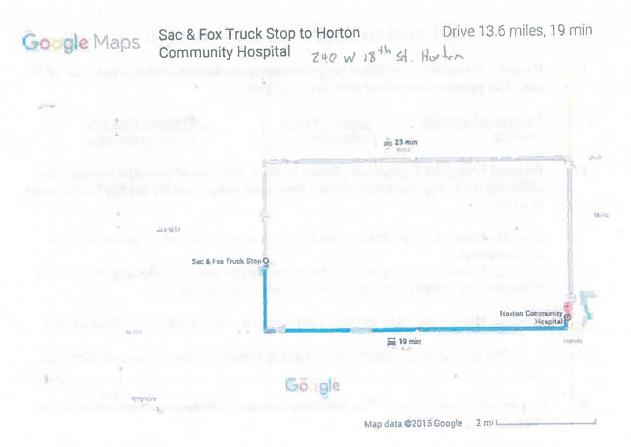

Sac & Fox Truck Stop

Table us is inwester thebest

Continue to US-75 S





Horton Community Hospital

240 W. 18th Street

These directions are for planning purposes only. You may find that construction projects, traffic, weather, or other events may cause conditions to differ from the map results, and you should plan your route accordingly. You must obey all signs or notices regarding your route.

which a

20 di

I. All site personnel have read the above plan and are familiar with its provisions:

Name	Signature	Date
Sobot Timan	27/4-	11-19-15
Provide Watson	1000 CV A	11-19-15
ROSERAL TUNAP	Robert M. Can?	11-19-15 UZANS
Theoresa Armbruster	Theresa Cliphonst	11-19-15
1977		-
	A STATE OF THE STA	

Douglas E Drouare, CPG USEPA, Region 7 11201 Renner Boulevard Lenexa, Kansas 66219 August 20, 2015 Revised June 22, 2016

RE: Leaking Underground Storage Tank Sac & Fox Truck Stop 1346 US Hwy 75 Powhattan, Kansas 66527

Dear Mr. Drouare,

Sac and Fox Truck Stop was built in 1998 by M.A.C. Corporation, Independence MO. Robert Andrew who is still currently with M.A.C. was involved at the time of construction. Four fuel tanks were installed at that time. Documentation (Attachment 1) show that the tanks were XERXES double wall tanks with a 30 Year warranty.

Here is a timeline of events and actions taken regarding the ruptured fuel tank at Sac and Fox Truck Stop. (Attachment 2) is a diagram of the Truck Stop and where tanks set on the property for reference.

- July 20, 2015 Phone call from staff stating tank alarm was going off at approximately 9:30 p.m. Amanda responded by having them check fuel levels and the north tank was below alarm level and needed fuel to siphon from the South tank. A few minutes later staff calls back and says alarm is still going off, Amanda then has them check water levels. At this time we now have a vehicle in the parking lot that will not stay running. Immediately all pumps are shut off at approximately 9:35p.m. Any car fueling with midgrade fuel during that 5 minute period would not run. Police, fire, emergency management and all other personnel needed responded. Parking lot was evacuated for everyone's safety until we could assess the situation. We knew water was coming from somewhere but had no idea where from. On site personnel spent about an hour trying to determine water source. Our tank monitoring print out showed no water in the fuel at the beginning of the day.
- July 22, 2015 Robert Trump with Adler Tank Rentals, brought a Frac tank and pumped approximately 19,000 gallons of fuel and water into the Frac tank. At this time we could tell tank was ruptured and the probe was stuck in the ground from the pressure and that ground water was the responsible water source. At this time fuel needs to separate from water for 2-3 days to determine how much fuel was recovered. Then samples need to be sent for testing.
- July 24, 2015 Robert Trump with Adler returns to take samples of fuel and water for testing. We also determine that on July 20, 2015 Midgrade tank totals were

5,882.00 gallons, we sold 2185.11 gallons of midgrade fuel and that 2357.00 gallons of midgrade fuel was in the Frac tank, (Attachment 3) leaving 1339.89 gallons of midgrade fuel unaccounted for. Water and fuel samples are taken to Pace Analytical.

- July 27, 2015 Results of fuel and water samples come back from Pace Analytical. (Attachment 4)
- Fuel can be recovered but need to determine who will recover fuel from Frac tank
 and how to properly handle the contaminated water. Activated carbon vs. reclaim
 facility.
- July 27, 2015 Tankology Inc. comes to scope tanks and determine possible cause and damage. North midgrade tank is ruptured and south midgrade has a crack on top where vent pipe had been run over recently. South and north tanks are manifolded. Appears water pressure from excessive ground water caused pea gravel to erode, allowing tank to rupture.
- August 6, 2015 Estimates come from Robert Trump with Adler to determine procedure of disposing of contaminated water.
- August 11, 2015 Tribal Council approved to have midgrade fuel recovered from Frac tank by HAAG oil and to have contaminated water hauled to a reclaim facility.
- August 18, 2015 2000 gallons of fuel is recovered from frac tank and blended with 1250 gallons of premium fuel to make fuel the correct octane level. (Attachment 5)
- August 19, 2015 Adler hauls contaminated water to reclaiming facility (Attachment 6). Also delivers a 300 gallon bladder for the ongoing process of reclaiming fuel from ruptured tank. Waiting on estimate to purchase a diaphragm pump and a compressor.
- At this time we know that there is still fuel in the ground because we have stuck the tank. Our thought is that it is in overfill tanks and that we will recover most of the missing fuel.
- Ongoing, will now start to pump bi-weekly out of ground to recover any fuel
 missing. Will store in bladder, let fuel separate from water and keep track of all
 product recovered each time. This procedure could take up to 12 months or until
 we can no longer recover any more fuel. After a period of time when there is no
 more recovery of product we will need to have soil tested.
- At this time we are possibly considering properly abandoning the North ruptured tank which is no longer in use.

- August 27, 2015 Ethan with PEI capped off manifold to south tank so we could start operating north tank. Reclaimed 442 gallons of fuel. (tank reading) (Attachment 7)
- August 28, 2015 Josh with PEI flushed fuel lines and recovered 150 gallons of fuel. Remaining gallons of fuel unaccounted for now totaling 746 gallons.
- Estimate received 9-21-2015 from Total Petroleum Services for Consultant, Geologist and site characterization. Waiting for Tribal Councils approval to continue with clean up/compliance efforts and free product recovery.
- Ace North American Claims is insurance covering remediation only. Contact Brian Hong 866-635-5698.
- Sac and Fox Truck Stop has been operational since incident on 7-20-2015 excluding the use of the ruptured north midgrade tank.
- November 19, 2015 Geologist take analytical samples for testing and drill for 4 Temporary Piezometers. Robert Trump from Total Petroleum Services, Robert Andrew from M.A.C. Corporation who installed the tanks, Ethan Kappler with P.E.I. and Mark Junker with Tribal EPA were all here. Appears contamination is within the Truck Stop property. Ruptured tank video was viewed by all, video shows a rupture approximately one third of the way up on north side approximately 7-8 inches in diameter. I was to receive test results in 10-12 days.
- January 18, 2016 have not received any results from analytical testing or piezometers. Still no response from Robert Andrew on Xerxes warranty.
- February 16, 2016 Received Site Investigation Report of general soil characteristics of the subsurface and initial impacts to the soil and groundwater due to failing gasoline underground storage tank. Terranext also provided cost to install 5 permanent monitoring wells, collect groundwater samples, complete an initial conceptual site model (CSM), screen and model groundwater data to determine soil vapor inhalation risk at Sac and Fox Truckstop. (Attachment 8)
- February 29, 2016 Meeting onsite at Sac and Fox Truckstop to discuss next steps and overall plan to continue with finalization of remediation and repair or abandonment of ruptured fuel tank. In attendance were Randy Dolifka PEI, William Millard Crawford and Company, Robert Trump Total Petroleum Services, Chris Kinn Geologist, Robert Andrews MAC Corp., Lisa Montgomery Sac and Fox EPA, Gary Bahr Sac and Fox Tribal Council, Theresa Armbruster Sac and Fox Truck Stop Manager, Amanda Kramer Sac and Fox Asst. Manager and VIA phone Anita Ketola ACE Insurance. It was unanimous by all in

attendance that the only way to determine the cause of the ruptured fuel tank would be to investigate the site. After determining the cause, being impact or defect then the decision will be made to either repair the existing Xerses double wall tank with a 30 year warranty which was installed in 1998 and have it recertified or properly abandon the tank which would be the safest option and install a new tank in a new site. While the tank site is open we will be prepared to deal with free product, define plume and install wells. Initially 5 wells were suggested but was determined 2 would be sufficient. All work pending estimates and approval from Insurance Companies.

- March 21, 2016 Received estimate to repair ruptured fuel tank.
- April 20, 2016 Robert Trump Total Petroleum Services responds to Region 7.(Attachment 9)
- April 22, 2016 Insurance needing a breakdown of proposed estimate and an estimate for a replacement tank from M.A.C. Corp.
- May 11, 2016 Currently waiting for Estimates to install new tank if that
 determination is made immediately following the excavation of the northern area
 of the tank exposing the ruptured tank.
- May 17, 2016 Received estimate from Randy Dolifka PEI for new tank not sure of status on estimate from Robell Andrew MAC Corp.
- May 20, 2016 Received revised estimate from M.A.C. Corp.
- May 25, 2016 Tribal Council approved the excavation work proposed by M.A.C.
 Corp. Need to contact Robert Andrew to confirm a stall date.
- June 8, 2016 Robert Andrew, M.A.C. Corp. still trying to coordinate with XERXES.
- June 16, 2016 M.A.C. Corp has a start date July 11, 2016 need to confirm with all involved.
- June 20, 2016 Confirmed with M.A.C. Corp. Everyone would be available for July 11, 2016 start date.
- June 21, 2016 contacted Robert Trump about providing Region 7 with an acceptable form of reporting.

Sincerely,

Theresa Armbruster Manager, Sac and Fox Truck Stop

Attachments 1-8a are attached separately Attachment 8b is attached separately Attachment 9

Sac & Fox Truck Stop

From: Robert L. Trump [rtrump@tetelpotroleumservices.com]

Sent: Wednesday, April 20, 2010 8:24 AM

To: Drouere, Douglas; markjunker@sactoxenviro.org; Sac & Fox Truck Stop; L.Montgomery

c: Randy Carlson; Scott O'Neal; mmeerian@kdheks.gov; Hayes, Scott, Bosch, Raymond;

koorus.tahghi@amec.com; ckinn@ierranext.net

Subject: RE: Leaking Underground Storage Tank Site - Sac & Fox Truck Stop

Good morning,

Robert Trump, Total Petroleum Services LLC responding. We were contracted to remove free product and contaminated waters from the LUST in question.

Since then we have performed exploratory work with temporary peizometers to assertain the geology of the subsurface and gain insight into the outer boundaries of contamination.

In March a meeting with Suc & Fox, Total Petroleum, Representatives from insuring parties, our contracted geologist Terranext, and the original installer MAC was held to form a concesus between the parties for the next steps.

At that time MAC put forward a work plan to excavate the Northern area of the tank so a representative from Xerxes, tank manufacturer, could make a determination regarding cause of breach and possible repair of tank.

Total Petroleum advanced a work plan to support the excavation activities with a Vac system to remove any additional free product and/or ground water during excavation and inspection and/or repairs.

Total Petroleum/Terranext also advanced a work plan for soil vapor monitoring and installation of permanent monitoring wells for extended ground water sampling.

To date: Antea Group has approved Total Petroleums work plan on behalf of Ace-Chub insurers and we have received an approval letter from Chub this week.

We were contacted last Friday by AMEC Environmental who we learned has now been retained by Crawford Group to also review all plans to determine if they are reaonable. A conference call was held Monday between AMEC, Total Petroleum Services, and Terranext, to explain our work plan for remedial activities.

As of today, we have not received this approval from AMEC/Crawford to move forward.

We also do not know if MAC has submitted their work plan for tank inspection by excavation, flowable fill closure, or complete tank removal.

I will be out of the office until Priday. I am reachable by cell, text, or email to answer any questions you may have.

Sincerely,

5/6/2016

Am. a

Part of the second seco

Tree Tree Land

And the state of t

The state of the s

All and the second seco

egan and each to the second se

And the second of the second o